



This is a digital copy of a book that was preserved for generations on library shelves before it was carefully scanned by Google as part of a project to make the world's books discoverable online.

It has survived long enough for the copyright to expire and the book to enter the public domain. A public domain book is one that was never subject to copyright or whose legal copyright term has expired. Whether a book is in the public domain may vary country to country. Public domain books are our gateways to the past, representing a wealth of history, culture and knowledge that's often difficult to discover.

Marks, notations and other marginalia present in the original volume will appear in this file - a reminder of this book's long journey from the publisher to a library and finally to you.

Usage guidelines

Google is proud to partner with libraries to digitize public domain materials and make them widely accessible. Public domain books belong to the public and we are merely their custodians. Nevertheless, this work is expensive, so in order to keep providing this resource, we have taken steps to prevent abuse by commercial parties, including placing technical restrictions on automated querying.

We also ask that you:

- + *Make non-commercial use of the files* We designed Google Book Search for use by individuals, and we request that you use these files for personal, non-commercial purposes.
- + *Refrain from automated querying* Do not send automated queries of any sort to Google's system: If you are conducting research on machine translation, optical character recognition or other areas where access to a large amount of text is helpful, please contact us. We encourage the use of public domain materials for these purposes and may be able to help.
- + *Maintain attribution* The Google "watermark" you see on each file is essential for informing people about this project and helping them find additional materials through Google Book Search. Please do not remove it.
- + *Keep it legal* Whatever your use, remember that you are responsible for ensuring that what you are doing is legal. Do not assume that just because we believe a book is in the public domain for users in the United States, that the work is also in the public domain for users in other countries. Whether a book is still in copyright varies from country to country, and we can't offer guidance on whether any specific use of any specific book is allowed. Please do not assume that a book's appearance in Google Book Search means it can be used in any manner anywhere in the world. Copyright infringement liability can be quite severe.


About Google Book Search

Google's mission is to organize the world's information and to make it universally accessible and useful. Google Book Search helps readers discover the world's books while helping authors and publishers reach new audiences. You can search through the full text of this book on the web at <http://books.google.com/>

NYPL RESEARCH LIBRARIES



3 3433 06642667 1

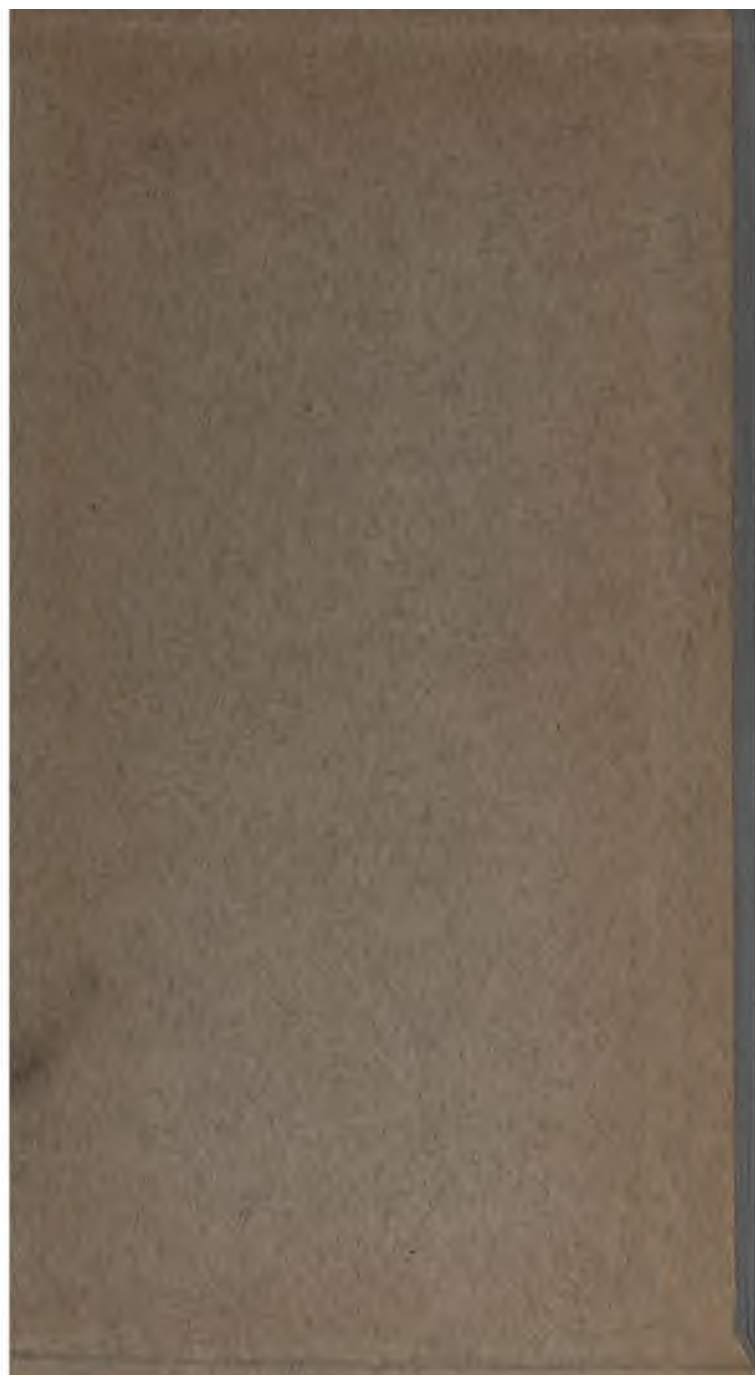

ANNEX



THE
MOULDER'S AND FOUNDER'S
POCKET GUIDE:

A TREATISE ON

MOULDING AND FOUNDING IN GREEN-SAND, DRY-SAND, LOAM, AND
CEMENT; THE MOULDING OF MACHINE FRAMES, MILL-GEAR, HOL-
LOW-WARE, ORNAMENTS, TRINKETS, BELLS AND STATUES;
DESCRIPTION OF MOULDS FOR IRON, BRONZE, BRASS AND
OTHER METALS; PLASTER OF PARIS, SULPHUR, WAX,
ETC.; THE CONSTRUCTION OF MELTING FURNACES,
THE MELTING AND FOUNDING OF METALS;
THE COMPOSITION OF ALLOYS AND
THEIR NATURE, ETC., ETC.

crick
By FRED. OVERMAN, M. E.

A NEW EDITION, TO WHICH IS ADDED A SUPPLEMENT ON
STATUARY AND ORNAMENTAL MOULDING, ORD-
NANCE, MALLEABLE IRON CASTINGS, ETC.

Adolph
By A. A. FESQUET, CHEMIST AND ENGINEER.

Illustrated by Forty-four Engravings.

PHILADELPHIA:
HENRY CAREY BAIRD & CO.,
INDUSTRIAL PUBLISHERS, BOOKSELLERS AND IMPORTERS,
810 WALNUT STREET.

LONDON:
SAMPSON LOW, MARSTON, SEARLE & RIVINGTON,
CROWN BUILDINGS, 158 FLEET STREET,
1893. *H.*

-22768-



COPYRIGHT,
By HENRY CAREY BAIRD & CO.,
1880.

WILLIAM
GREEN
BAIRD

PREFACE.

THE remarkable success which has steadily attended the publication of THE MOULDER'S AND FOUNDER'S POCKET GUIDE, by the late Frederick Overman, has induced the publishers to engage the services of Mr. A. A. Fesquet, in adding to it a supplement which shall bring it up to the best practice of the present day; more especially in some important particulars, which are wanting in the original treatise. That gentleman has therefore, after much conscientious and intelligent labor, and with special facilities which were extended to him, in the most courteous and liberal manner, by the heads of some of the first foundries in this city, produced the matter here presented, which appears under his name. A full Index is now also for the first time added.

We believe that in its present form it must prove even more useful and popular in the future than it has done in the past; great as that popularity has been.

H. C. B.

PHILADELPHIA, *March 25, 1880.*

CONTENTS.

CHAPTER I.

MOULDING.

MATERIALS FOR MOULDING.	PAGE.
Sand, Green-sand.....	14
Dry Sand.....	15
Core-sand.....	16
Clay.....	17
Loam.....	18
Blackening, Coal-dust, Black-lead, Anthracite.....	19
Soapstone Powder.....	20
Localities of Materials.....	21
Grinding-mills for Blackening.....	22
TOOLS.	
Flasks or Boxes.....	23
Crane.....	25
Small Tools, Trowels, Cleaner, Stamper, Shovels, Sieves.....	28
Pease-meal, Parting-sand, Gate-pins, Screws, etc.....	30
MOULDING IN GREEN SAND.	
Moulding of a Wheel.....	31
Filling in the Drag-box.....	32
The Top Box.....	36
Gates.....	36
Removing the Top Box.....	38
Drawing of the Pattern.....	39
Blackening the Mould.....	41
Pattern Fastened to the Moulding-board; Composition of Moulding-sand.....	43
Division of Labor.....	46
MOULDING IN OPEN SAND.	
Making of the Bed.....	48
Moulding in One Box.....	50
Moulding of a Cog-wheel.....	52
Causes of Failures.....	57
Mouldings of More than Two Boxes.....	59
Small Articles of Machinery.....	61
Ornamental Moulding.....	62
Moulding Hollow-ware.....	65
Small Articles.....	67
Moulding of a Coffee-kettle.....	68
Patterns for Hollow-ware.....	70
MIXED SAND MOULDING.	
Moulding in Green-sand with Dried Cores; Cores and their Use.....	73
Core-boxes.....	75
Moulding of a Column.....	76

	PAGE.
Making a Pipe-core.....	80
Moulding with Plates.....	82
DRY SAND Moulding.	
Drying of the Mould.....	84
Glands.....	85
Vertical Castings.....	86
Moulding of a Large Pipe.....	87
Loam Core.....	88
Hay Rope.....	88
Core-iron.....	89
Making of the Core.....	89
Castings Pipes without Cores.....	93
Moulding Fine Castings; Trinkets.....	94
Moulding of a Stag.....	95
Screwing Together of Ornaments; Soldering, Brass Cast- ings.....	99
Fine Iron Castings.....	100
Loam Moulding.	
Quality of Loam; Compounding Loam.....	101
Moulding of Simple Round Forms; Moulding of a Soap-pan.....	104
The Core.....	107
The Loam Board.....	108
The Cope; Taking Apart the Mould; Blackwash.....	110
Gates, Gas-pipe, Cast-gate.....	112
Covering of the Flow-gate; Use of the Flow-gate.....	113
Castings by a Single Gate; Gas-pipes.....	115
REMOVING OF THE CORE—Moulding WITHOUT THICKNESS.	
A Steam Cylinder.....	116
Making of the Cope; the Steam-ways.....	117
Cores for the Steam-ways.....	121
Core for the Cylinder.....	122
Sulphur Piece.....	123
Fastening of the Cores.....	124
Burying of the Mould.....	125
Fastening of the Exhaust-pipe Core; Use of Chaplets.....	126
General Remarks on Loam Moulding.....	127
Irregular Forms.	
Moulding of a Curved Pipe.....	128
Oval Forms; Bathing-tub.....	132
Elbow-pipe.....	133
Complicated Forms.....	134
Moulding of BRONZE ORNAMENTS.	
Moulding of Statues.....	138
French Mode of Moulding Statues.....	139
Present mode of Casting Statues.....	141
Iron Statues; Bas-reliefs.....	142
Moulding of Bells.....	143
MOULDS PARTLY OF LOAM OR SAND, AND PARTLY OF METAL.	
The Bore of Wheels: Chilled Railroad-car Wheels.....	146
Chilled Rollers.....	147
Castings Together of Iron and Steel.....	152
Moulds for Tin, Lead, Pewter, Zinc, Types, etc.....	155
Mould for Copper and Brass.....	154
Stereotyping; Plaster of Paris Moulds.....	155
IMPRESSIONS AND CASTINGS.	
Wax, Crumbs of Bread, Sealing-wax.....	159
Sulphur.....	160
Glass.....	161
Clay, Artificial Wood.....	162
Plaster of Paris.....	163

	PAGE.
Mould of a Coin.....	165
Moulding of Statues.....	168
✓ Castings of Plaster.....	172
Taking of a Mask.....	173
Sulphur Castings.....	174
Wax Castings, Sealing-wax, and other Casts; Elastic Moulds	175
Alum, Saltpetre, Moulding of Natural Objects.....	176

CHAPTER II.

MELTING OF METALS.

IRON.	
Qualities of Iron: No. 1 Iron.....	179
No. 2 Iron, No. 3 Iron; Characteristics of Foundry Pig.....	181
Mixing of Iron.....	184
Kind of Castings.....	187
Kind of Moulds; Melting of Cast-iron; in the Blast Furnace	189
Melting Iron in Crucibles.....	192
Melting in Reverberatories.....	196
The Cupola, Description of.....	201
Operation in a Cupola.....	205
Pots.....	210
Blast-machines: Fans.....	212
Hot Blast; Drying Stoves.....	217
GENERAL REMARKS.	
✓ Cleansing of Castings.....	218
Time of Casting.....	220
Cost of Moulding and Casting.....	221
Melting of Bronze Metal.....	223
✓ Melting of Lead, Tin, Antimony, and Brass.....	224

APPENDIX—RECEIPTS AND TABLES.

ALLOYS OF IRON.	
Iron and Sulphur, Iron and Carbon, Iron and Phosphorus ..	226
Iron and Siliceous, Iron and Arsenic, Iron and Chromium,	
Iron and Gold, Iron and Silver, Iron and Copper, Iron and	
Tin, Iron and Lead.....	227
ALLOYS OF PRECIOUS METALS.	
ALLOYS OF COPPER.	
Bronze.....	228
Bell Metal; Bronze for Guns.....	229
Bronze for Statues.....	230
Bronze of the Ancient Greeks.....	231
Bronze of the Aztecs, Speculum Metal, Speculum Metal of	
Rosse's Telescope.....	232
Bronze for Medals, Bronze Imitation of Gold.....	233
BRASS.	
Common Brass, Solder, Button-brass, Red Brass, Princes'	
Metal, Brass and Lead, Tempering Brass.....	234
Brass for Ship Nails, Brass for Pans and Steps, Brass and	
Platinum; German Silver, Chinese Packfong, Argenta for	
Plating.....	235
Electron, Solder for German Silver, Copper and Platinum,	
Copper and Silver, Copper and Antimony.....	236
Copper and Carbon, Copper and Phosphorus, Copper and	
Arsenic.....	137

	PAGE
LEAD AND ITS ALLOYS.	
Lead and Arsenic, Lead and Antimony, Stereotype Metal, Fusible Metal	238
TIN AND ITS ALLOYS.	
Tin and Lead, Pewter, Queen's Metal, Britannia Metal, German Tin, Music Metal, Antifriction Metal, Spurious Silver Organ-pipes.....	239
Imitation of Diamonds, Tin Foil.....	240
ZINC AND ITS ALLOYS.	
BRONZING.	
Natural Bronze, Antique Bronze.....	241
Various Colors.....	242
Bronze Paint; Gilding of Bronze and Brass.....	243
Gilding of Iron.....	244
Tinning of Brass, Bronze, and Copper; Zincing of Copper or Bronze.....	245
Glazing of Castings, Enamel.....	246
Backening of Iron with Plumbago; with Varnish.....	247
Grinding and Polishing; Malleable Cast-iron.....	248
Silvering of Iron.....	249
TABLE I—Weight of a Lineal Foot of Cast-iron.....	250
TABLE II—Dimensions of Cylindrical Columns of Cast-iron to Sustain a Given Load; Table III—Showing the Tenacities and Resistances to Compression of Various Metals and Alloys.....	251
TABLE IV—Specific Gravities of Metals and Alloys.....	252

SUPPLEMENT.

STATUARY, ORNAMENTAL MOULDING, ORDNANCE, ETC. By A. A. FESQUET.

The Wax Process.....	253
Accidents; Finishing; Philadelphia Bronze Statuary.....	255
The New or French System; Objections and Advantages.....	256
Practical Process.....	257
Separating the Parts of the Plaster Pattern; Tonnons and Mortices.....	258
The Flasks; the Copes.....	259
The Moulding.....	260
The False Cores.....	261
The Openings or Gates for the Entrance of the Metal; the Sands Used, etc.....	263
Turning the Flasks Over; Removing the Pattern, etc.....	265
Requirements for an Inside or Real Core.....	266
Air and Gas Passages; Finishing the True Core.....	267
To Remove the True Core; Fastening the False Cores with Wires.....	268
Interior Coating of the Mould; Dividing the Pattern.....	269
Drying the Moulds; Temperature of the Moulds; Pressure... ..	270
Repairing Accidents; Melting the Metal.....	271
Mounting or Joining the Parts of the Statue.....	272
The Joints of Separately Cast Pieces.....	273
Tools Required; Patterns which may be Cast by this Process.....	274
Hardening the Plaster—Alum Plaster.....	275
Moulds for Castings of White Metals; Zinc Castings; Solders; Moulding in Wax.....	276
Plastic Clay for Deeply-cut Pattern.....	277

CONTENTS.

13

	PAGE.
Brass and Bronze Ornamental Castings for Door Locks, Knobs, Hinges, etc.....	278
Ossepia for Moulding Small Articles.....	279
✓ Difficulty of the Metal Reaching the Extremities in Small Castings; New Alloys; Aluminum-Bronze.....	280
Phosphor-Bronze.....	281
Spiegeleisen; Snap Flasks, Plate Moulding, etc.....	283
Preparation of the Mould for Casting; Door Hinges and Swivels of Cast Iron.....	286
Uniting of Cast and Wrought Iron; Small Sand Cores.....	288
Fitting of the Core in its Place; Malleable Iron Castings..	89
Cupolas; Blast.....	290
✓ Fonderie & Calébasse.....	291
Scaffolding; Ordnance.....	293
Bronze for Ordnance; Moulding.....	294
Melting and Pouring the Bronze; Shrinkage.....	295
Gen. Uchatius's Experiments upon Increasing the Hardness and Elasticity of Bronze; Moulds for Bronze, Cast-iron, and Steel Ordnance; Pig Metal used for Ordnance.....	296
Moulding Sand; Cast Steel Guns; Ordnance Cast Solid and with Core.....	297
✓ Casting Cannon Balls.....	298
Hollow Projectiles.....	299
Hollowness in "Solid Shot" caused by Cooling; Crystallization of Metals in Cooling.....	300
Patterns should have no Sharp Angles, etc.....	301
Chilled Castings; A. Whitney & Son's Chilled Car Wheels.....	302
Stereotypes.....	305
Electrotypes.....	307
Flexible Moulds.....	308
Lottinoplastique.....	309
Gutta-percha Moulds for Electro-Platers.....	313
✓ Gelatine for Moulds.....	314
Contraction or Shrinkage of Metals and Alloys.....	316
Table of the Shrinkages of Castings.....	318
Weights of Castings from Patterns.....	319
✓ Miscellaneous Process and Receipts.....	320
Malleable Iron Castings.....	322
Index.....	324

THE
MOULDER'S AND FOUNDER'S
POCKET GUIDE.

CHAPTER I.
MOULDING.

THE moulding of metals and other materials into the various forms, required for the accomplishment of certain purposes—whether of an economical or ornamental character—is an object of high interest. Moulding is the noblest of the arts; it serves with unvaried interest the fine as well as the useful arts. The heavy castings for the construction of machinery, to the weight of thirty tons and more; the statues of the ancients, and of modern heroes, are ornaments of human genius. The minute, well finished castings of iron and bronze are evidences of human skill and ingenuity.

Moulding may be considered in two distinct branches; the one is the moulding proper, the other

14 **MOULDER'S AND FOUNDER'S POCKET GUIDE**

the forming of the pattern. Moulding proper is almost the same in principle and in practice for each of the various kinds of metals or alloys. Slight variations in the materials for moulding, and in treatment, are the only differences in moulds which are designed to be used for iron, brass, bronze, tin, or lead, and other metals. The principal materials used in moulding, are, sand of various kinds, loam, plaster of paris, blackening, and metal.

Sand is the most common, and certainly the most perfect and convenient material. It is superior to all other materials for moulding. Sand is more or less porous, and very refractory, so that the hot metals do not melt nor bake it; two qualities of great importance in the successful operations of the business. The various kinds of good moulding sand, employed in foundries for casting iron or brass, have been found to be of an almost uniform chemical composition, varying in grain or the aggregate form only. It contains between 93 and 96 parts of siliceous grains of sand, and from 3 to 6 parts of clay, and a little oxide of iron, in each 100 parts. Moulding sand which contains lime, magnesia, and other oxides of metal, is not applicable, particularly for the casting of iron or bronze. Such sand is generally too weak or too close; it will not stand, or retain its form,

as it will cause the metal to boil by its closeness. In practice the different classes of castings require different kinds of sand for the purpose of moulding. For one kind of castings the sand is to be porous, open, and is still to be adhesive; for another class it is to be very adhesive and fine, almost free of grit, to make itself conform to the minutest parts of the pattern imbedded in it. At the proper places in the description of the process of moulding, we shall allude to the various kinds of sand best qualified for specific purposes.

The best moulding sand is generally found along the banks of large rivers; that procured from the shores of mountain streams, is in most cases too coarse or too poor and weak. Good sand, however, has been found on the very top of high hills. The best is generally found in the vicinity of the primary rocks, or along those river banks which receive their supply from the primitive mountains. The alluvium of the transition or metamorphous rocks, as gray-wacke, slate, and feldspar, forms a very superior moulding sand, if it does not contain too much iron. In the coal districts there is generally little or no difficulty in finding good sand, for most of the river flats are composed of that useful material, which, however, frequently contains too much iron, and

is liable to melt from the heat of heavy castings an evil which can be modified by mixing the sand with coke-dust, or anthracite powder. In tertiary regions, and along the sea-coast, some spot is always found where fine and strong sand may be dug; in these localities the best kind is frequently deposited. The greatest difficulty in obtaining sand of a good quality, is mostly encountered in limestone and volcanic regions, also where porphyry, mica slate, and micaceous rocks predominate. Sand which contains too much iron or lime, or still worse, mica, will not adhere, and is liable to absorb and retain too much moisture, and cause rough and unsound castings. Good moulding sand has in its green state a yellowish earthy colour, balls easily on being squeezed in the hand, and, if sufficiently fine, assumes the finest impressions of the skin without adhering to it. White or gray sand is generally either too strong or too weak. Sand for undried moulds—green sand moulds—is generally more open or porous; it should not contain as much clay as that used for dried moulds, or it cannot assume or retain the finest impressions of the pattern. Sand for dry moulding is frequently of the finest kind, and very strong; for heavy castings a coarse but adhesive sand is mostly selected.

Core-sand.—The material most difficult to obtain is

good core-sand. Core-sand should be coarse, very porous, but still very adhesive. Rock-sand—the debris of abraded rock—free-sand from river banks or from the sea-shore, pounded blast-furnace cinder, and other kinds of coarse sand, are frequently mixed with fine strong sand, or with clay; the use of the latter, however, is to be very limited. The best core-sand is frequently found on hillsides, or the very top of hills, in places where feldspathic or primitive rock has recently been decomposed, where the rock contains sufficient clay to make it adhere, and where the coarse angular grains have not supported vegetation, and it is consequently free of all vegetable or animal matter. Where sand of abraded rock cannot be obtained, free-sand, or, which is preferable, pounded blast-furnace cinder may be used, tempered with clay, barm, pease-meal, or horse-dung. In the use of the latter vegetable and animal substances, caution is to be exercised to prevent the boiling of the casting, because of the quantity of gas liberated from such matter. For cores, fresh sand must be used in each cast; old sand, burned sand, or sand mixed with coal, cannot be employed for this purpose.

Clay is frequently used for improving the adhesiveness of sand. It is to be selected from the white

aluminous kind, argillaceous earth, or fine clay. It is either dissolved in a large quantity of water, and kept in the foundry for occasional use, or is dried, pounded, run through a fine sieve, and then mixed with the sand. The best plan is, to mix sand and loam together, and run this mixture moist through a mill; a common grist-mill, or a dust-mill, will answer for this purpose. One part of clay mixed with nine parts of free-sand, or any other pure sand, is considered sufficiently strong for core-sand; still these proportions depend very much on the nature of the sand, and the adhesiveness of the clay, and also what kind of cores are to be made from it. The sand for large and complicated cores, is to be stronger than that for small cores.

Loam.—Common loam, or clay of which common bricks are made, is generally used for loam-moulding. The loam ought to be as free from iron, lime, magnesia, and other alkaline matter as possible, because they make the loam too hard and close, and cause boiling of the metal. Such mixtures are also not sufficiently refractory to resist the heat of a large mass of melted iron. If good loam cannot be obtained, a mixture of sand and clay, as described above, is preferable to any imperfect loam. Loam, or any cement for loam-moulding, is to be mixed with saw

dust, horse-dung, hair, or cut straw, hay, or similar matter, which makes the loam adhesive and porous.

Coal-dust, black-lead, and anthracite dust, are simply means of blackening the mould, by mixing it with the sand or loam. If hot metal is allowed to be in immediate contact with some kinds of fresh sand, the sand will partially melt, or if the sand is coarse, the hot metal will penetrate into the spaces between the grains, and the casting in consequence will be rough. Blackening, or a coating of carbon, will prevent in a great measure the burning of the sand, and consequent roughness of the casting. Black-lead is a very effective material for this purpose; but if used in too large a quantity it is apt to fill the necessary pores of the sand, and, as it is almost incombustible, will prevent the escape of gases from the hot metal, and consequently cause unsound castings. Next to plumbago in refractory quality is anthracite; and its dust, if not too fine, is an excellent means of preventing the burning of the sand. If there is too much anthracite dust in the sand, it will impair its strength; and if the dust is too fine, it will fill the pores of the sand. Dust of bituminous coal weakens the sand considerably, but it makes it very porous and open, thus facilitating the escape of the gas. It causes the castings to be very

smooth, but without fine impressions ; it entirely destroys the sharp angles. Bituminous stone-coal dust appears to have a remarkable influence upon iron. Cast in a mould composed of sand and bituminous coal, the iron appears to be more gray and coarse-grained than when in any other mould. It is in consequence generally weaker ; pig No. 2 improves by it. Coke-dust mixed with sand is better than any of the enumerated materials for making large castings, and for casting stove-plates. It makes the sand open, without impairing its strength too much. Coke-dust is not well qualified for face-dust ; it does not make smooth castings. The most generally useful coal-powder is charcoal dust—ground charcoal of hard wood, such as oak, beech, sugar maple, hickory, or dogwood, well burned. Charcoal powder can be mixed with sand to nearly one-tenth of its volume. It is an excellent face-dust for small castings. Very small delicate castings require a very strong fine sand, free of all coal and coal-dust ; these cannot be dusted with charcoal or any other dust, for such would impair the finer parts of the mould. Very small moulds are blackened by a rush candle, or the flame of a pine-knot.

Scapstone powder is a very efficacious means

of preventing the burning of the sand. For thin castings, as stove-plates and hollow-ware, it is not excelled in making smooth, sharp castings. Its use, however, is not to be carried to an excess, because it is as weak as coal-dust, and finally spoils the sand of the foundry by making it too weak. Coal will burn out of the sand, but the magnesia of the soap-stone will not; both cause porosity, as well as weakness of sand.

Sand, clay, coal of every kind, and blackening are so abundant in the United States, that we hardly need enumerate localities. Good moulding-sand is found everywhere along the eastern slope of the Alleghenies, from the old rocks of Maine, through the metamorphic strata of New Jersey to the Mississippi river, along the sea-coast in the tertiary deposit, or in the coal and gold regions of Pennsylvania, Maryland, Virginia, and the Carolinas. In the coal basins of the Allegheny, Monongahela, and Ohio rivers, there is no lack of good moulding-sand, and the same may be said of the valleys of the Missouri and Mississippi. Clay is also found there in abundance, and of good quality. Anthracite is in Pennsylvania, in Massachusetts, Ohio, and North Carolina, and where it is found, there is hard bituminous coal, or splint coal, which serves the same pur-

pose. Bituminous coal and charcoal are found in every region of the union. Plumbago is found in Pennsylvania, Virginia, North Carolina, and other places. Soapstone exists in Maryland, Pennsylvania, New Jersey, New York, and along the Atlantic coast. There is an abundance of good materials spread all over the United States.

Mills for grinding blackening.—Coal-dust is prepared in mills of a particular construction, to prevent the flying about of the blackcoal. It is commonly ground in iron barrels which turn around their own axis, and in which a number of cast-iron balls roll over the coal and break it, as represented in figure 1. Such an iron cylinder is generally

Fig. 1.




from 2 to 3 feet in diameter, and from 1 to 5 feet long. It makes from 20 to 30 revolutions per minute, and is moved by a strap and pulley, or cog-

wheels. The number of balls, of which each one weighs from 25 to 50 pounds, is indifferent; the more there are at work the better. In the larger cities, as in Boston, New York, and Philadelphia, the manufacturing of blackening and dust is carried on by men who make an exclusive business of it. Remote and country foundries prepare their own dust.

TOOLS.

The instruments and tools used by the moulder are various and expensive. For moulding in green as well as in dry sand, boxes or flasks are used; these may be made of iron or of wood. Iron boxes are in the course of time the cheapest. For moulding in loam, iron plates, core spindles, wrought-iron bars, hoops and wire, are used.

Fig. 2.

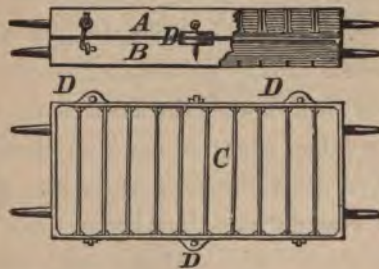


Boxes or flasks are the enclosures of the sand,

which is filled around the pattern. A flask consists of two parts, as is represented in figure 2, where A is the upper box, and B the lower box. C shows the flask from above. The traverses, which are generally wider in the upper box than in the lower, are best made of wood, even if the box is made of cast iron. These traverses are moveable, and may be put into such positions as to suit the varied forms of the patterns. The three iron pins, D D D, are to be well pointed and tapered, and long enough to afford a safe descent of the one box upon the other. In case there are high projections on the pattern, these pins ought to be nearly as long as the flask itself is high. On each side of the flask are two hooks, fitting to eyes, which serve to connect the two parts of the flask as firmly as possible, to prevent a separation or the lifting of the upper box. These hooks are to be strong without being unnecessarily heavy. The eyes in which these hooks fit, are firmly fastened into the wood and clinched inside, or are cast into the iron when the box is being cast. On each box are four snugs or handles; these are for lifting and carrying the boxes or flasks. On large boxes, and also on very small boxes, there are but two handles, in the middle of the small side, strong enough to bear the weight of the box when filled

with sand. In this case the snugs, or swivels, are in the axis of the box; and if a box is suspended by a crane, it may be turned around its swivels, and be at rest in every position. Figure 3 shows a box

Fig. 3.

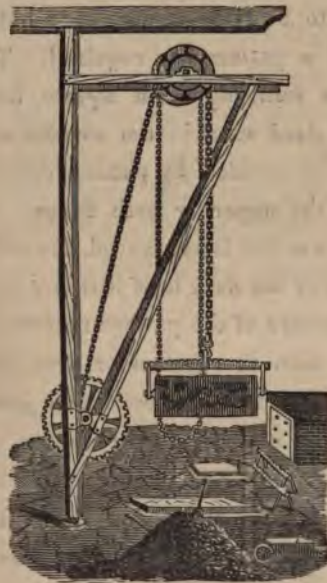

suspended from a crane, which in most instances is the proper way of lifting it. We see here that a box must be very strong to resist the influence of the heavy weight of sand and iron. If the box gives way, the sand will crack and drop out,

spoiling the mould. Large boxes should always be made of iron. The form of the box is generally suited to the pattern; if the pattern is round, the box is made round. This close fitting of the box to the pattern is in many instances expensive; it causes new boxes to be made where often but one or two castings of a pattern are required. The only inconvenience resulting from square boxes, is the amount of dead sand in the corners of the flask, which may be avoided by putting corners of wood or iron in the upper or both boxes. As in most cases the lower box is not moved, the weight of sand in that part of the flask is of little consequence; but where the nature of the pattern renders it necessary to lift and turn the bottom or drag-box, the corners of a square box may be spared just as well as in the upper box. The chief objection to a square box for round castings, is its weight; but where a strong crane is in the foundry, a little more or less weight to be lifted is of small consequence. In all cases, at least two inches space ought to be between the box and the pattern, and in case of heavy castings, more. This space is also to be larger in wooden than in iron boxes. When the space between the box and the pattern is too small, the mould is liable to leak, the hot metal will flow out if the

parting between the box and the pattern is too narrow.

Flasks are to be as rough inside as they possibly can be made, for it is by adhesion chiefly that the sand remains in the box. In large flasks, the adhesion of the sand is increased by driving into the traverses and sides of the box, when the box is made of wood, nails of such a length that the points project on the inside. In cast-iron boxes, nails are either cast in the box, or its inner surface is covered with projections, made by driving the piercer an inch or so into the sand before casting the box; the latter mode is preferable. Nails are inconvenient in many cases, and in all cases troublesome; they frequently cause imperfect castings, as the sand never can be rammed as close where nails project, as where there are none. If the sand is not of a uniform closeness, the cast will be imperfect; for where the sand is too loose to resist the pressure of the fluid metal, the casting will bulge. A better method than the foregoing of making the sand adhere, is to put as many traverses in a box as can conveniently be done, and place them as close together as possible. The interior of the box is made wet, traverses and all, with a solution of

strong loam or clay. This loam or clay is put on by means of a whitewash or any other brush.

Moulding-boxes ought to be made of cast-iron; it makes strong and durable flasks. Wooden boxes cost less than those made of iron, but are more expensive in the course of time; they are liable to burning and leaking, and never make correct castings; their pins never fit well, and the wood is apt to warp. Hollow-ware, pipes, and ornaments are to be cast in iron flasks exclusively, or such castings are liable to incorrectness. Iron boxes are more heavy than wooden ones, which is objectionable, but, considering the greater security of the iron flask, the work may be done to more advantage than in wooden flasks.



Small Tools.—The trowels, Fig. 4, A, A, are from the size of a small mason's trowel, down to one inch long and half an inch wide. The trowel is used for smoothing down the surface of the sand, and clearing away superfluous sand, polishing the blackening or

coal-dust, and repairing injuries in the mould. The whole of the trowel is generally made of metal, handle and all. B, B, are round forms of tools for polishing hollow moulds of a cylindrical or spherical form. C is a cleaner, often twelve and more inches long; it is used for cleaning and smoothing sunken surfaces, where the trowel cannot be used. These tools are generally made of steel, but are thus liable to corrosion, which injures their polish. The best metal for tools is hard bronze, as this is not injured by oxidation. A high polish and straight surfaces are the chief requisites of these tools. Their shape or form may be varied, according to individual taste. The general forms as represented, are the most in use.

Fig. 5.



Fig. 5 represents both a wooden rammer and an iron one. The wooden rammer, edge shaped on both ends, is made on the turning-lathe, in one piece; it serves for pressing the sand close into the corners of the pattern, and also into the flask. The other figure repre-

sents an iron rammer, which, however, is merely cast-iron at one end, where there is a round button of from 2 to 4 inches in diameter on the face. The wooden shank or handie is generally tapered or pointed at the opposite end of the knob, for piercing the sand, or to reach more closely into corners. Each of these rammers may be from 2 to 4 feet long, according to the kind of work to be done with it.

Besides the tools here enumerated, the moulder has short-handled light shovels, for filling boxes and for working the sand; sieves of various sizes or meshes, and a riddle for filling the flask; small bellows, for blowing dry loose sand from the mouldings, and parting-sand from the pattern; and also, coal-dust or blackening. The moulder needs an iron pot for holding parting-sand, and also a water-pot; two or more linen bags for coal-dust, black-lead, and pease-meal; a piece of rope for tufts, for which paint-brushes also can be used. Piercers or pricklers, are iron or brass needles, made of wire, from $\frac{1}{8}$ to $\frac{1}{4}$ of an inch thick; they are from 6 inches to two and more feet long, tapered the whole length, and drawn to a point.

Parting-sand, is that sand which is strewn over the moulding sand where the boxes separate; it is either free-sand, river-sand, sea-sand, or pounded cinder; or it may be the burnt sand scraped off the castings

in cleaning them. *Pease-meal* may be substituted by any other meal; the first, however, is the best. Many tapered pins of various lengths, round, square, oval, and oblong, are needed in a foundry for making gits or gates; some strong, well-tapered and pointed screws for lifting out the patterns; iron hammers and wooden mallets, small crowbars, pinchers and tongs.

Moulding in green-sand.—There are three distinctions in moulding; green-sand, dry-sand, and loam moulding. Green-sand moulding is generally applied to light iron castings; as small, unimportant parts of machinery, stove-plates and stoves, hollow-ware, grate-bars and fire-grates, shot and cart-wheel bushes, water-pipes, gas-pipes, and many other articles. This method is seldom used for any other metal than iron. In making a mould for a small piece of machinery, say a wheel, in green-sand, the pattern is put upon a flat board, which is laid perfectly level upon the floor of the foundry, or, for small articles, upon a pair of trusses, or a box which contains sand. Upon this board the pattern is laid with its smooth side on the board. If the pattern is divided in two halves, but one half of it is laid down, the jointed side upon the board. Figure 6 shows the arrangement seen from above. The board is to be straight and well planed, and

Fig. 6.

made of two-inch pine plank, or, if the article is small, but one-inch. After the wheel is laid down and well adjusted, or made solid by sprinkling some sand on those places where it does not touch the board, the lower box of the flask is put down inverted upon the board. Before the drag-box is put down, a layer of sand of one inch thick is frequently spread over the pattern and the board. In this sand the box is imbedded, and rests more firmly in it than upon the bare board; the box and pattern are not so liable to shake, or the board to vibrate. The first layer of sand upon the pattern is to be worked through a fine sieve: this sieve is to be finer, the smaller and thinner the pattern, or the more smooth the surface of the casting is to be. This facing-sand, or the first layer, is, in instances where a very smooth sharp impression is required, to be fresh sand from the pit, which never before has been in a mould. Of such fresh sand, a layer of $\frac{1}{8}$ to $\frac{1}{2}$ of an inch in

thickness is to be sifted over the pattern. One inch, or, according to the pattern, a greater depth of fine sand, is to form the facing of the mould. All coarse grains of sand are to be prevented from coming in contact with the pattern. If the pattern is complicated, or contains many nooks and corners, the facing is pressed to the pattern by hand, to secure a uniform covering and a uniform tightness of the sand. After the facing is properly secured, common moulding-sand is thrown into the box through a coarse riddle, flush with the box. This sand is rammed down, cautiously and uniformly, with the wooden and edged stamper. When the first box-full of sand is secured and well worked into the cavities of the pattern, the box may be filled again by throwing in sand from the pile, which is repeated until the box is properly filled and of uniform tightness. The coarse, or last sand, is rammed with the round iron stamper, the superfluous sand is stricken off by running an edge rule over the box, so as to make the sand perfectly flush with the box. If this first, or the drag-box, has traverses, as shown in the drawing, there are often difficulties in getting the sand properly distributed over the pattern, and it is not easy to obtain a uniform compactness of the sand. Traverses in the drag-box are admitted only in cases of very

smooth single patterns. Most of the moulds are made without traverses in the lower box; it is considered more safe in working the sand, and the work is done easier and faster. When there are no traverses in the lower box, the sand, after being levelled, is sprinkled over with some loose sand and covered with a board, which covers the box all over; it is gently rubbed on, and the whole, box and board, turned over, so that the former bottom is now the top of the box. If the patterns are large, and the box is heavy, it is necessary to fasten both bottoms to the box by means of glands, so that no slipping of the boards may happen while the box is turned over. If traverses are in the box, and no bottom is used, a smooth place on the floor of the foundry is to be prepared beforehand, upon which the box is laid. In case there are no traverses, it is set upon a plank bottom. When the box is deposited in its proper position, that is, in that place where the casting is to be performed, the first bottom upon which the pattern was laid is removed, in which there is no difficulty, if the bottom is not fastened to the pattern. This bottom is frequently fastened to the pattern, which is done in cases where the patterns are limber; as is the case with light and ornamented railing, ornamented stove or fire-grate

plates. In this case a few gentle taps are to be given on the back of the board, either with a wooden mallet where the bottom is of value, or with an iron hammer; these taps will loosen the sand at the pattern, and there is less danger of breaking or injuring the facing of the mould. In this case the join-pins of the boxes are fastened to the drag-box, and are to go through the bottom to secure the exact position of the pattern in the sand, when repairs are to be made to the mould, in which cases the pattern is put in again after having been removed. In ordinary cases these pins are fastened to the upper box. In many instances no bottom for the pattern is used, but the upper box of the flask is filled with sand, rammed in and levelled; upon this the pattern is bedded, then the drag-box put on, and the work done as described above. It is a bad practice to work without a pattern-bottom; it is a slow way of working, the patterns are liable to be injured or bent, and the castings are never very fine or correct. After the bottom is removed, the upper surface of the sand-parting is smoothed down, and the superfluous sand cut away by means of a trowel. Pattern, sand, and box are to form one flush surface; this surface forms the parting. The parting-surface is thinly covered with parting-sand, gently sprinkled


on by hand; as small a quantity as possible is to be used, just enough to prevent the adhesion of the moulding-sand. As it is impossible to avoid throwing some of the parting-sand on the pattern, which, if left there, would cause a rough surface to the casting, this sand is gently blown off the pattern with a small hand-bellows. After the one half of the mould is so far prepared, the other parts of the pattern are put on, in cases where the pattern is divided; the upper box is then laid in its proper place, the hooks fastened, the facing-sand is put on; after which the common sand is stamped in; in short, the same operation is performed as previously described for the lower box. When the pattern is simple and smooth, there is not much difficulty in adjusting the traverses, which may be straight, and reach with their lower edge down to within half an inch of the pattern. If the pattern is not smooth, and parts of it project into the upper box, the traverses are to be cut out in those places where they touch the relief parts of the pattern. For these reasons wooden traverses are preferable to iron ones, because they can be easily fitted to any pattern. Many boxes have no traverses at all; this is the case with boxes of less than eighteen inches or two feet square.

Gates.—Immediately after the face-sand is put in

the upper box, and before the second layer is thrown in, preparations are made for the *gits*, gates or passages for the metal. This is done by setting in wooden pins, very much tapered, and of a sufficient length to reach above the edge of the upper box. These pins are generally made of wood, and are of a great variety of forms, lengths, and thicknesses. The setting of these for gits is a nice point, and requires some discrimination on the part of the moulder; particularly where iron is to be cast, and where the patterns are very thin. On the distribution of the gits depends in a great measure the success of casting. If the pattern is of a heavy thick form, say more than half an inch thick in its thinnest parts, and its surface is not too large, one gate will be sufficient. In proportion as the surface increases or the pattern is thinner, the number of passages is to be increased. In most instances it is preferable to have the gits outside the pattern; but this always requires a somewhat larger flask, for which reason this rule is not adhered to. Thin plates require flat gits of a very oblong form; mere edges, in case the gits are to be set upon the plate or the casting itself. On round patterns, wheels, pulleys, or any others of that description, the gits must always be set outside. In all cases there is to be an air or

gas gate, which is always set upon the pattern directly, whether the passages are inside or outside of the latter. For very light, thin, or open ornamental castings, it is often difficult to find the proper places for the gits, and it requires some experience to decide, at first sight, where to put the gates on a new pattern. Frequently more than one of the first castings of a new pattern are lost on this account. In all instances it is a rule to put the gits in such places that the metal may find the shortest way to fill the mould; where the metal, in passing through the narrowest parts, will find wider and heavier channels to be filled, so that the partially cooled metal may unite again in the heavier parts of the mould. If one passage is not sufficient, there are to be two or more: in fact, as many as are necessary to secure success. The fluid metal is to be poured into all the gits at once, whatever number there may be, so as to fill the mould in the shortest time, and promote a union of the metal from the various passages.

When boxes, pattern, and gits are in their proper places, the flask has the appearance of Figure 7. When the upper box is well filled with sand and levelled, the hooks are unfastened, and the top box gently lifted by one, two, or more men, or, which is

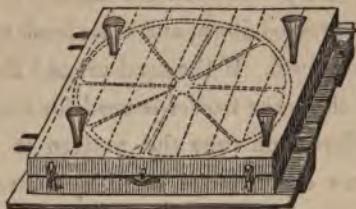Fig. 7.

safest, by means of a crane. The box is then set on one edge, or turned edgewise in the crane; the pins for the gits are then withdrawn, and the tapering holes are cut larger, bell-mouth shaped, at the top of the flask. The gits are to be very tapering and smooth, to allow an easy passage for the hot metal, and prevent the washing down of loose sand. When the upper box is well mended and secured, and ready to be put on again, the pattern in the lower box is removed. Before this can be done, the edges of the sand all around the pattern are wetted, which is done with a swab, or with a paint-brush soaked in water, and pressed gently between the fingers while running it over the mould. In that way a greater or smaller quantity of water may be thrown on the edges, as the workman may find it necessary. The sand is now examined with the finger all around the pattern, in order to ascertain if it is of a uniform closeness. If too loose, so as not to resist the with-

drawal of the pattern or the influence of the hot metal, it is pressed down, and some fresh sand worked in with the trowel. If the sand around the pattern is uniformly close, the trowel is used for smoothing the whole surface, and then the pattern is withdrawn. To withdraw a pattern is in many instances a delicate operation, for the sand will more or less adhere to it and damage the mould, in case the pattern is lifted without being properly liberated from the sand. To free the pattern from the adherent sand, the lifting-screws are put in, after which it is loosened by striking it gently downward with a wooden mallet. In lifting it, it is to be tapped sideways against one of the corners of the pattern, or against the lifting-screws, or against studs made for the purpose.

The lifting-screws are sharp-pointed and tapered, and of a coarse thread when the pattern is of wood. In metal patterns the thread is cut into the pattern, fitting the screw. Richly ornamented or carved patterns, or those of complicated machinery, are seldom lifted without breaking more or less of the mould, and damaging it. The moulder repairs such damages by putting some water on with the swab, and adding as much sand as appears to him sufficient for filling the break. The more prominent parts receive

a touch of the swab. The pattern, when removed, is well cleaned by means of a dry brush, and laid in the sand again, in its former bed. With simple patterns this latter operation is not necessary: a skilful moulder can repair a damaged mould without resorting to this expedient. In ornamental moulds there is, however, no chance of successfully repairing a break. The pattern is once more pressed down to its former site, and then withdrawn, the mould generally being then found to be perfect.

Blackening the mould.—By shaking a small bag filled with blackening or ground charcoal, over the mould, it is covered with a thin film of coal-dust. This dust is to be distributed as evenly as possible. If fresh sand has been used for facing, the dust will adhere to the sand, and the pattern, after being well brushed over, may be laid in again to smooth the dust down. The sand around the pattern is smoothed with the trowel. If the mould is faced with old sand, the dust is not likely to adhere, and may be blown off, which is to be avoided. In this case a coating of fine meal is given to the mould; any meal will answer for this purpose, either rice, corn, or pease-meal. If meal has been used before the dust is put on, it is not advisable to put the pattern again in the mould, until a heavy coating of dust has been given over the

meal. Care must be taken in using coal-dust or meal, as both cause dull castings if used to excess. The best and smoothest castings are made where the facing consists of a thin coating of fresh sand, and with as little blackening as possible brought upon it. Skilful moulders will however succeed in putting in the pattern again, whether they have been using meal or not. When the sand is well smoothed down, and the pattern laid in again, the channels or passages are scooped out of the parting surface. The pins which formed the gits, have given an impression in the sand of the lower box. Between these impressions and the pattern, channels are dug a quarter of an inch or more deep: where these channels join the pattern, they are seldom more than of the above-mentioned thickness, but may be thicker and narrower towards the gate; the channels must be thinner at the pattern than anywhere else, to make them break close to the pattern, when broken off. If one of such channels is not deemed sufficient, two or more may be cut from the same gate; the channel also may be widened towards the pattern, to afford a sufficient inlet for the metal, and may be swabbed, to give greater security against being washed away by the hot metal. After this is done, the pattern is taken out once more, the upper box

put on gently, the hooks fastened, and the mould is ready for casting.

When parts of the pattern project into the upper box, or the pattern is divided, the same process is to be followed with the upper, as has been done with the lower box. In this case the upper part of the box is to be covered with a board after the gate-pins are withdrawn, and the box laid upon its back, so as to have that part of the pattern uppermost, which is to be withdrawn. The process of lifting the pattern is here exactly the same as in the lower box, except that more caution is required in patching up damages than in the lower box, to prevent the dropping of sand when putting this box on the other.

When a pattern is fastened to the pattern board, it is lifted out before the upper box can be filled with sand. In this case the upper box is filled over a smooth board, well polished with the trowel, and put on without further preparation. It is preferable in this instance to bear the upper box down by weights of pig-iron, instead of hooks. This mode of moulding is easy and works fast, but is only applicable to very tapered and low patterns.

Composition of Moulding-sand.—Although moulding in green-sand at first sight appears to be so simple, yet great difficulties, and often failures, may

be encountered by not observing certain practical rules. The composition of the moulding-sand is of the first importance. If the sand is too strong, that is, if it contains too much clay, it is only fit for small or very thin castings. In this instance, care is to be taken not to make it too wet, for it absorbs a great deal of water without showing dampness, but it is soon found to be too damp for casting. Such fat, strong sand may be improved by burning it, or by continual use. It may also be improved by a mixture of charcoal-dust, coke-dust, or anthracite-dust. If too much coal-dust is used to make the sand work well, the castings are apt to be rough. Such strong sand is to be avoided for heavy castings. The heavier the cast, the poorer and coarser the sand is to be. Fine moulding-sand is liable to the same objections as strong sand; it works well in small moulds, if mixed with charcoal-dust, but it will not do for heavy castings. A large mass of hot metal generates a great quantity of steam in the moist sand, also compounds of carbon, which gases require vent: open coarse sand is necessary to give that vent. Core-sand is always coarser than moulding-sand, and seldom fit to be mixed with it. Where many cores are used, whether large or small, it is advisable to carry the castings to some spot in or out of the

foundry, where the cores may be withdrawn and broken without their sand mingling with the moulding-sand of the foundry. A lot of good, well prepared old sand, is of great value in a foundry; its proper aggregation ought to be kept up by daily additions of fresh sand, or is liable to become too weak in the course of time. After each casting the sand is to be wetted with as much water as is required to give it the dampness necessary for its adhesion. The amount of water differs in almost every instance, and can be determined only by experience. All the sand of a foundry ought to be riddled at least once a week, to free it from chips of wood, pieces of iron, lumps of burnt sand, and similar matters, which produce inconveniences in founding. If green sand is rammed too tightly, especially for large castings, it is frequently broken, and bad porous castings are the consequence. This happens because the confined steam or gases cannot escape through the sand, and in rushing over the face tear it down. The running in of the piercer, to make artificial air-holes, is in such cases of great service, but is almost ineffectual in large or thick castings. It needs open, porous sand, to make the best kind of vent. Vent-holes pierced or left purposely, will never replace the advantages of open sand. If the

sand is not rammed tight enough, the liquid metal is apt to break down all the projections in the sand, and by its fluid pressure cause unevenness and swelling of the mould, and in consequence imperfect castings. Each kind of sand, and each form of pattern, requires a different treatment to insure success. Too loose open sand, and too much coal or blackening, will make rough, imperfect, dull castings. Fine or strong sand is liable to cause boiling, explosions, or porous castings. Many of the difficulties may be removed by a skilful moulder; still it cannot be expected of him to make smooth sharp castings in coarse sand, or in sand which contains too much coal. The skill of a green-sand moulder is more frequently put to the test, than that of any other artisan. Every different form of pattern, different sand, different coal, different metal, and different locality, makes it necessary to modify his mode of working

Division of labour.—The most successful way of overcoming the practical difficulties of green-sand moulding, is to divide the business into branches, so that each different kind of casting may be carried on in its own appropriate locality, and with its own proper workmen and materials. The sand suitable for heavy machine castings, is not fit for moulding small cog-wheels, less so for hollow-ware, and still

less proper for ornamental carved castings. The moulder who has been trained to small articles, is hardly able to do heavy machine work; and those moulders who have been used to moulding heavy articles, cannot at once compete with moulders of light castings. To work successfully in green-sand, it is almost absolutely necessary to divide the articles of manufacture. There ought to be a separate shop, and separate hands, and particular sand for heavy machine-frames; a division for small machine-castings; a separate foundry for hollow-ware and stoves; and another for casting ornaments and railings, for brass and for bronze. Each branch of these articles of founding requires peculiar conditions under which it can be most perfectly done, and carried on with the largest profit. The author has observed an instance where a moulder had been making, for eight consecutive years, a certain kind of flat-bottomed pot, with great success. No other moulder could earn half as much on the same article, nor make it equal in quality. This moulder could not make anything else but that pot; he failed in everything else he tried. Moulding generally is a very particular art, but green-sand moulding more so than any other kind of moulding, if we wish to economize in the prosecution of the business.

Moulding in open sand is frequently resorted to, to avoid the making of flasks. It is in no way cheaper than moulding in boxes, and the castings are always rough and uncouth; but there are instances where it cannot be avoided. To mould in open sand, a particular bed is prepared in the foundry. The ground below it is dug out to the depth of two feet below the level of the foundry floor. This hollow is to be as large in extent as the largest mould to be made; a little larger does no harm. It is filled with coarse charcoal, coke, or anthracite-dust, or even with small, say half-inch pebbles, in the bottom. Upon this bed of open matter, two inches thick of the coarsest mould, or river sand, is riddled, and upon this common moulding-sand is sifted. When the bed is so far prepared, two straight edge-rules are put edgewise, one on each long side of the bed. These rules are adjusted by a level, so as exactly to range with each other, as well as with a horizontal line. If now an edge-rule is drawn slanting over these edges, it of course will cut the sand between the rules down where it is too high, and will fill any cavities there may be. As this surface of the sand will still be rough, even after this levelling is accomplished, some fine sand is now sifted over the whole surface, and a long straight wooden roller, of about

six or eight inches in diameter, and long enough to reach over both edge-rules in the ground, is rolled gently backwards and forwards over the bed, care being taken that the edges of the rules are clean, and that the roller never misses them. This operation will smooth the surface of the bed; and in case the sand is not considered sufficiently solid, some more fine sand is sifted on, and the roller used to press it down. This process may be repeated as often as it is found necessary, until the sand is sufficiently compact to resist the pressure of the fluid metal. After finishing the bed, the rules are removed. Upon this level bed the pattern is laid; if it has any projections, these are turned downwards and pressed into the sand; the largest part of the pattern however is left above the sand, particularly if the pattern forms a plate. Around the pattern, which is to have a straight surface, some sand is piled by hand to form a dam all around the pattern, and flush with it. After the pattern is withdrawn the sand-dam forms the enclosure, and must be strong enough to resist the pressure of the fluid metal. On a convenient side of the mould the channel is elevated; that is, a place on the top of the dam is made broad enough to receive the fluid metal, and distribute it gently over the mould. If there are any cores in the

mould, these are to be held down by pieces of iron, to prevent their being lifted by the fluid metal. After casting, the hot congealed metal should be covered by a thin coating of sand, to prevent its radiating too much heat into the work-room. This kind of moulding is hardly ever used but for the roughest kind of iron castings; it is seldom applied to other metals. It is mostly in use for foundry utensils, as plates and platforms for the loam-moulder, furnace-plates, grate-bars, and the like articles. Plates of any size and form may be made without pattern: the edges are then formed by rulers, and the corners by wooden squares of the desired angle. The thickness of such plates is determined by the amount of metal poured into the mould. Rough flooring plates, rough railing, and other indifferent castings, are sometimes made in open sand.

Moulding in one box.—In castings which are to be made from smooth patterns, and where no great accuracy is required, the pattern may be sunk into the foundry floor and covered by a box. Every foundry floor is considered to consist of sand, at least a couple of feet deep. A ditch is dug, or a place as large as the pattern, and every coarse piece of burnt sand, nails, iron, &c., removed, by riddling the sand. If the place is too dry, some water is

thrown over it, and if too damp, dry sand is thrown over until it is so far elevated that the moisture will not injure the casting. The place is to be level. The pattern to be moulded is laid upon the sand and pressed into it, and the sand worked against the pattern by hand. The filling-up around the pattern is to be flush with the pattern, and to extend far enough to resist the pressure of the fluid metal. Upon this mould, which forms the lower box, the upper box is laid, and kept in its place by four or more wood-poles, driven around the box into the ground. This upper box is managed just as any other upper box, with only this difference, that weights are used to bear down upon it and resist the fluid pressure of the metal. If a pattern is large, and there are no means in the foundry to lift a heavy box, and if the upper side of the pattern is smooth, the mould may be covered with iron frames in the form of open network, cast in open sand, and covered with a coating of coarse loam, well dried. By joining the edges closely where these plates meet, a casting may be made just as good as if an upper box had been used. Castings made in these kinds of moulds are never so good as if made in the regular way in two boxes; moulding in this manner is admissible only where necessity compels, and quality is no desi-

deratum. It is in rather more general use than there is need for. In a foundry where large machine castings are made, it requires much room and considerable dead capital to keep a sufficient stock of flasks, but the interest on capital thus invested is easily paid for by the facilities and security afforded in moulding, and the better quality of the castings. Moulding in the floor of the foundry answers for some kinds of pig-iron better than for others.

Moulding of a Cog-wheel.—Heavy green-sand mouldings are very frequent, and it will not be amiss to describe the moulding of a large piece. We will select the moulding of a large face-cogwheel. Some of the wheel-patterns are divided into arms and circumference, which is on many accounts preferable to other methods, but particularly on account of exactness. A wheel cast to its spokes is never round, as the arcs between the arms stretch in cooling. We will adopt a wheel with arms, and these arms divided on account of their cross section.

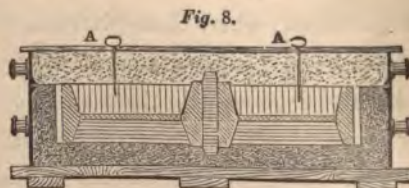


Figure 8 is a vertical section of a flask filled with

sand, and ready for lifting the upper box. The different shades of the sand indicate what belongs to the upper and what to the lower box. In a wheel of this kind the face of the wheel is square, as a matter of necessity; no tapering is permitted, as in patterns of other descriptions. The inside of the rim may be tapered, and as the spokes of the wheel cannot be lifted from the lower box, only the spokes are divided so as to lift one half of each with the upper box. The lifting of the upper box is now not difficult, since a part of the pattern is carried with it. The part of the pattern which belongs to the upper box, is fastened to the box by the screws A, A, which pass through the sand, and are fastened to planks on the top of the box. These screws are drawn tight, so as to leave no space for any motion of the pattern. The half pattern in the lower box is withdrawn, by lifting it perfectly vertical and in all its parts at once. This work is done by several men; ten or more hands are often required to perform this part successfully. While the pattern is being raised, the men lift with one hand on iron pins firmly screwed into the pattern, and strike the pattern gently but in rapid succession, so as to loosen the adhering sand. Before the pattern is lifted the damages done by removing the upper box are repaired, which is easily ac-

5 *

complished by using some damp sand and the trowel. In case the sand is not very porous, it is pierced close to the pattern, to make air holes for the escape of the gases. The number of holes required depends entirely on the quality of the sand; close, strong, or fine sand requires more vent-holes than that which is coarse and open. If the pattern in the lower box is smooth and varnished, the swab may be used liberally, but if not, or if the wood is porous or coarse, but little water is used, and the pattern is to be withdrawn as soon as possible. It is altogether a good rule in moulding to work fast, and withdraw the pattern from the sand as soon as possible, particularly a wooden one. It is no advantage to a metal pattern to remain long in the sand; no pattern ought to remain there over night.

It is almost unavoidable to prevent injury to the mould, particularly at the periphery of a cog-wheel; the sand between the teeth will be always more or less broken. To repair these injuries, one or more single teeth are generally supplied by the pattern-maker, of which two at once may be set in and the sand between the two filled up by means of a long sleeker. A preferable mode is to have a segment of the wheel, of at least three teeth; such a segment may be easily withdrawn, and gives more

correct divisions. To work with loose teeth requires great experience not to injure the division or pitch of the wheel. Other parts of the mould are generally simple, and if any injury is done it is not difficult to repair such with damp sand, by means of the trowel or sleeker. A long, well made, and polished sleeker is of great service in moulding wheels. The mould is well polished over, after the pattern is withdrawn and every broken part mended; it then receives a slight sprinkling of charcoal-dust, and is again polished.

When the lower box is finished, the upper box, which is still fastened to and suspended in the crane, may be turned over and laid upon its back. If the box is too heavy, or the means insufficient to turn the box, it is left suspended in the crane as it is, face down. Some temporary supports however ought to be erected below the box, to hold it in case the chain of the crane should break, which would endanger the life of the workman engaged in repairing injuries. All the work to be done at the upper box is in this case accomplished from below the box. While one workman is below, first mending and wetting, and then watching the mould, others unscrew the pins from above, and in case there is any danger of sand breaking loose, the unscrewing is stopped, and the

doubtful places soaked with water, and firmly pressed. In many instances hooks of small wire, wet in clay-water, are stuck around the edges of the pattern in the sand. The pattern, after every injury has been repaired, is removed, the mould polished, and the upper box is then ready to be put on the lower. In this instance no coal-dust can be used in polishing the mould; the casting, therefore, will be rough at the upper side. In all cases of divided patterns the better plan is to turn the top box upside down, which gives an equal chance to the upper as to the lower box; the proper work can then be performed on it. To turn a box upside down, requires a suspension of it on two points or swivels; the box must of course be strongly made. In lifting, too much attention cannot be paid to the uniform and vertical raising of the box; the least twisting of it will break the sand and cause injury to the mould. Boxes made too weak are very apt to bend, and often cause the falling out of the sand altogether. After the upper box is well repaired, the gits ready, and the channels cut in the lower mould, the flask may be closed. Hooks are useless on large boxes; the only means to keep the upper box down against the pressure of the fluid metal, is by weights or screws. Planks are laid over it to prevent damage to

the mould, and the weight, which may consist of broken pig-iron or any other heavy metal, is gently laid upon these planks; in this way the pressure is more uniformly distributed. The gits to a wheel should be between two spokes, near the periphery, and two or three channels cut from each git, either to the spokes, or, preferably, to the spokes and rim. For a large wheel there are to be at least two gits—three would be better. There are also to be some flow-gates, one in the centre and two or more at the circumference. The gits should to be large, say two inches wide, and also have a wide trumpet-shaped mouth. The channels which conduct the fluid metal from the gits to the mould, are to be smaller in section than the git; for in pouring the metal the git is to be kept full, to avoid the passing in of impurities, as coal, dross, or sand, which may float on the metal; such impurities would injure the casting if permitted to pass into the mould.

Failures from some unforeseen difficulty frequently take place in the moulding and casting of large patterns. Fine strong sand is never to be used for heavy mouldings in green-sand; it invariably causes boiling, or at best, causes the castings to be porous and full of holes. If fine sand is mixed with much coal-powder, it is liable to be too weak to resist the

pressure of the metal, or even the drawing of the pattern. It requires too much coal to make fine sand porous enough for heavy castings. Coarse open sand is the best for heavy castings where a large quantity of metal is poured in a mould; such sand however makes rough castings, which can be remedied in various ways. The mixing of coal-powder with coarse sand is not to be recommended, for it makes the sand too weak, and causes the generation of too much gas. Open porous sand, free from coal, can be used to advantage, if the pattern is covered with a layer of fine sand, say one quarter of an inch thick, or such thickness as is sufficient to resist the pressure of the iron; a very thin coating is in most cases sufficient. Such a coating of fine sand, well dusted and polished, will make smooth castings. Coal is not of much use in sand for heavy castings, for if the iron retains its heat long, as it does in ponderous masses, it destroys the coal nearest to it, in consequence of which the casting assumes a peculiar roughness. The only coal which resists the influence of hot iron in large masses, is plumbago or anthracite, but these, if they are so fine as to make a smooth surface, are too fine to admit the free escape of the gases, and if such carbonaceous matter is coarse, it causes as rough castings as coarse sand.

In practice, coal mixed with the sand is advantageous, but it is not to be in excess, and coke or charcoal-dust are to be preferred on account of their peculiar porosity. But in heavy castings, coal can never prevent the metal from penetrating between the grains of sand; and if coal is of no service on the facing, it is of none in the body of the mould. Heavy castings are therefore best made in dried sand or loam, as we shall hereafter describe. Machine frames of a large body of metal, or of little importance, may be moulded in green-sand; but frames which are to be strong, wheels, or beams, ought to be cast in dry sand, for the unequal shrinkage of iron in wet sand, caused by the moisture, is very apt to impair the strength of a casting.

Mouldings of more than two boxes, are not so frequent, and are generally avoided in moulding machine frames. Many a complicated pattern may be moulded in two boxes, if properly managed. If no division of a pattern can be devised to meet all the difficulties, the moulding with cores is resorted to, to meet the emergency. We will illustrate this in one instance. Figure 9 represents a flask in which a pulley is moulded. The pattern of the pulley is divided at the dotted line. After the lower box is filled and turned, the sand is cut out around the

Fig. 9.

circumference as indicated, the surface of the sand smoothed and parting-sand sprinkled on, which is carefully brushed or blown off the pattern. The other or upper part of the pattern is now laid down, and a core of fresh moulding-sand pressed carefully into the groove of the pulley, in the form as indicated. This core is filled flush with the pattern, and slanted towards the edge of the box. It is well polished, covered with parting-sand, and then the upper box put on and moulded. When both boxes are filled, the flask is covered with a board and turned upside down, the drag-box is then lifted off first, and the lower half of the pattern removed. After this the flask is once more closed and turned, putting it this time on its bottom part. The upper box is now lifted, and the other half of the pattern removed. While turning the box, and lifting the pattern, the very brittle round core of green-sand is here always supported, without danger of its breaking. In a similar manner many complicated

patterns may be moulded, by simply putting in cores of this kind. Where green cores cannot be applied, dry cores must be used, and the spaces for such provided for in the pattern ; but of these hereafter.

Small articles of machinery require in many instances very skilful workmen, and a dexterous handling of the patterns. There is no branch of mechanics where more perfect castings are required and made, than for spinning machines. These castings are to be true, smooth, sound, and malleable, conditions which are not easily effected. To succeed well, it requires particular sand, and a certain amount of coal mixed with it, and workmen who are experienced in that kind of work. Many advantages, however, may be given to the moulder in the arrangement of a pattern. If a small face-wheel is to be moulded, and the teeth are to be parallel, it is difficult to mould such a pattern. If however a ring of lead is cast around the wheel, so that each space between the teeth of the wheel is occupied by a lead tooth, and the wheel may be drawn through the lead without difficulty, the moulding of such a small wheel is rendered comparatively easy, by laying the lead ring upon the sand around the wheel, when the weight of the lead will hold the sand down, which otherwise is apt to fol-

low the wheel, particularly that portion between the teeth. In moulding small machinery of iron, it is not so much the smoothness of the castings which is to be considered, as the soundness of the metal; for this reason, the sand of such a foundry will bear and requires more coal-dust in admixture, than other foundry sand.

Ornamental Moulding.—The moulding of ornaments and railing is a subject of some interest, besides being a branch of the fine arts. Railing of simple forms, with one side smooth, may be cast in open sand; but there is the objection against it that open castings, made of the same metal, are never so strong as those cast in flasks. There is no economy in casting railing in open sand. For coarse railing, open porous sand is used, containing a good portion of coal. Here we have to remember that coal causes faint dull castings; the outlines are generally imperfectly developed. Carved work or sharp outlines can never be expected to be good if too much coal is used, either mixed with the sand, or dusted on. In ornamental moulding, it is not generally the strength of the metal which is the most valuable, but it is the perfect representation of the pattern which is desirable. Sharp outlines and smooth castings are the object of the moulder in this case. Some coal mixed

with the sand, is necessary, but it ought to be as little as possible. To secure sharp castings, the facing of the mould is made of fresh fine sand; a layer of one-twelfth of an inch thick is sufficient, and this dusted with fine dust made of oak or hickory charcoal. Ornamental work always is and can be sufficiently tapered to leave the sand readily, and if the pattern is made of metal, and well polished, it may be repeatedly laid in the mould, and all imperfections of the mould may be repaired to the most minute correctness. Dusting the facing of the mould is the very last operation; every damage is to be repaired with fresh sand, and every line of the mould is to be correct before the dust is put on. There is no more coal-dust shaken over the mould, than is just sufficient to make a smooth casting. Pease-meal or any other meal is inadmissible in ornamental moulding; it is injurious to the sharp outlines of the casting. Common pannels of railing are generally smooth on one side, and may be cast in wooden flasks; but where both sides of a railing are ornamented, iron boxes are to be chosen. As an illustration of ornamental green-sand moulding, we will choose a square hollow column or railing-post, represented in figure 10. Figure 11 is the post represented in a section cutting through the post and the flask. The pattern

Fig. 10.*Fig. 11.*

is divisible in four parts ; it divides on each corner. In moulding, one of these parts or one side is laid on a board, and the lower box filled over the pattern; the box is then turned, the sand smoothed, and the two other parts A A put on. To keep these parts of the pattern in their places, four or more small square boards are put between them. These boards are of exactly the size to fill the inside, B, of the square. Parting-sand is now thrown on, and the middle box put in its place. The middle box is divisible on both ends, kept together by hooks, so that each part, A, of the box can be removed by itself. The spaces, A A, and B, are now rammed in and filled flush with the pattern and the box. After this the fourth side of the pattern

is put in its place, which forms the top; parting-sand and the upper box put on, and this box rammed in. The pins for the gits are to pass through the middle box into the lower; and if the metal is to be not more than half an inch thick in its thinnest parts, it requires four gits, if thinner, six gits. On each end of the column a flow-gate is set upon the upper part of the pattern. When all the boxes are filled, and the gate-pins in, the top is covered with a board, and the flask inverted. The drag-box is now lifted, and the side of the pattern removed. The four parts of the pattern are to be fastened, each to its respective box, by means of screws passing through the sand into the pattern. Each of the four sides of the pattern has its taper towards the box. This lower part of the mould is to be well finished before closing, for there will be no opportunity of getting at it again. The small square boards, B, are now withdrawn, and the spaces left by them in the core, filled up with sand. When the requisite work on this side is performed, the drag-box is put on again and the flask reversed. The git-pins are now withdrawn, the upper box with its part of the pattern removed and put aside, until both parts of the middle box are ready. The pins which hold the middle box to the lower, are not to fit too closely, or are to be moveable, for the parts

of the middle box are to be drawn in an angle, because it cannot be done straight. The process of withdrawing the pattern from the middle and upper box is simple, and requires no particular description. For this kind of work a somewhat open sand, or fine sand mixed with ground coke or ground charcoal, is to be used. Too close or too strong sand is liable to cause explosions in this case. Many apparently complicated patterns may, like this pattern, be very easily moulded, and by simple means, if they are properly divided.

Moulding of Hollow-ware.—The distinct objects of this branch are, however numerous, still of great similarity. In no branch of the art of moulding is skill and dexterity brought to such perfection as here; it is the result of the division of labour, practised in this department. The objects belonging to this branch, are pots, kettles, fire-grates, stoves and stove-plates, grate-bars, locks, latches, hinges, and all such articles, which are standard articles of commerce. In this case it is not alone the sharp, well expressed outlines of the pattern which are essential; besides these, well finished articles require smooth surfaces, uniform thickness, and a high degree of lightness. The sand of a hollow-ware foundry is to be fine, but it may be

liberally mixed with coal-powder ; blackening or anthracite may be used for dusting. The most elegant patterns are now manufactured into stoves, and we may say, that there is no nation where the art of constructing elegant and economical iron stoves and fire-grates, has been carried to so great an extent as in our country. The moulding of these patterns is simple, there are but few complicated forms, and therefore this branch is no particular object of our investigation. In the manufacture of hollow-ware, there is a great advantage in good well-finished patterns. If the patterns are perfect there is generally no difficulty found in making good castings, for most of the articles are thin, and there is little danger of the sand burning and adhering to the metal. Articles of commerce are generally worked to as much advantage as possible. Patterns of small articles, as parts of locks, latches, hinges, knife-blades, knife-covers, and other small articles, are generally put ten or twenty or more together, connected by a permanent channel which conducts the metal from the gits to the patterns, and forms a part of the pattern. Such a batch, or set of patterns, generally fills one flask. The New England States, and Pittsburgh, are remarkably successful in manufacturing small articles. In some cases various articles are put promiscuously

into one flask, in which, however, a similarity of size is to be observed. Whatever number of patterns there may be in one flask, it is always calculated to cast a flask of small objects with one ladleful of metal.

Moulding of a Coffee Kettle.—As an object to illustrate hollow moulding, we will choose the form of a common coffee pot, or water kettle, represented as moulded, in figure 12. The form of a water kettle

Fig. 12.



is generally known. It is an almost spherical vessel, with a snout or pipe. We have selected one which fits to a cooking stove, with a contracted flat bottom; in other cases that bottom is round, with three studs to stand on. The pattern is here an exact model of the kettle as it is to be, with the exception of the pipe, which is, or may be solid. The flask consists of three boxes, of which the middle box is divided by a vertical division into two halves—cheeks. This divi-

sion runs through the pipe and divides the mould into two halves, so that when both boxes are removed, the pipe, which is not fastened to the pattern, may be withdrawn. In this case the upper part of the pattern is divided just in the division of the middle box, which leaves an unsightly division, and is likely to expose the pattern to injury. A better plan of working is, to have the middle box in one piece, and divide at the lines A, A, and B, B. At the pipe the upper box reaches down into the middle box, as far as the pipe goes down, and divides the sand just along the bend of the pipe; the middle box parts with the lower at the rim of the kettle, where the core also separates, as indicated by the darker and lighter shades of sand in the drawing. The pattern is only divisible in the line A, A, through the pipe. In moulding this kettle the lower (in the drawing the upper) half is put on a board and the upper box rammed in, this box turned upside down and the other half of the pattern put on. The middle box is then set in its place, and fastened to the upper box. Both boxes may also be put together, and rammed in together, just as conveniently. Sand is then filled in the middle box around the pattern, and after this the sand is rammed inside of the kettle. The parting is made between the lower and middle box, as indi-

cated, and the lower box filled. The flask stands now inverted, and the kettle on its bottom. The lower box—as the flask stands it is the upper box—is now withdrawn, then the middle box lifted and the upper half of the pattern withdrawn. First the middle and then the upper box put on again, and the flask turned, which will now stand as in the drawing. We may now draw the upper box, remove the lower part of the pattern, and put in the core for the pipe, which is made in a separate core-box. The git-pin is now drawn: this is very much tapered one way, and thin, the other way three or four inches wide, formed like a blunt wedge, whose edge is $\frac{1}{4}$ of an inch thick. The box is now put on again, and the mould ready for casting.

Patterns for hollow-ware require to be very accurate, if we expect the moulding to be well done. The originals of these patterns are generally moulded in loam, cast in brass, and turned in a turning lathe, or, if not of a round form, worked by other means until a perfect form is obtained. A pattern having been smoothed and polished, is then cut into such parts as are considered necessary to make it available. Pins, ears for handles, and studs for feet or handles, are generally put on loose. All dished utensils are generally cast with their mouth down-

wards, except covers. Where the neck of a core is narrow, and there is any danger of the hot metal lifting the core, as may occur in the case of the coffee pot, the core is fastened to the bottom of the flask by a thin iron rod with a cross at the upper end, buried in the core and fastened below the bottom. Hollow-ware moulders need a variety of peculiarly shaped tools, and sleekers. Most of the tools are button-shaped, with short studs for handles, more or less round, or even cylindrical, to suit the various hollow forms of the patterns; others are plain and heart-shaped; others again have double plain surfaces at certain angles with each other, to suit certain corners in the mould. Blackening—plumbago—is chiefly used as dust, and if well polished, it will make smooth and good-looking castings.

In this kind of moulding, iron boxes are generally used; this is necessary to secure good and correct castings; it is also the cheapest way. If iron flasks are well made, the work in them is done fast, well, and safe, while imperfectly made or wooden flasks always cause more or less delay in work. From well made flasks many advantages may be derived: we will mention one. Suppose a moulder is to mould twenty flasks of one and the same pattern, if the boxes are well made and fit one upon the other pro-

miscuously, there is no need of boards after the first drag-box is moulded. Upon the first box which is moulded, say the lower box, its complement the upper box is rammed in. After parting upon the upper box, the next lower box is moulded, leaving of course the pattern always in that box which serves as the bottom of the flask. In this way the top box of the first flask serves as the bottom to the next bottom box, and so on through the whole range of boxes. Each two boxes come together as they have been moulded, and it may happen in the course of the work, that one of the last boxes will not fit to one of the first, which however does not make any perceptible difference in the correctness of the castings. It requires some dexterity and experience to succeed well in this mode of moulding.

There are many articles here not enumerated as belonging to green-sand moulding; such as iron castings, parts of architecture, which are now so extensively used. To this belong window and door sills, door and window frames, columns and railing. All these forms are easily moulded, and require no particular details; we shall, however, mention some of them in the following chapters.

Mixed Sand Moulding.—*Moulding in green sand with dried cores* may be considered a mixed moulding, which requires particular knowledge of the composition and construction of cores. In previous pages we have spoken of core-sand, but we shall here treat upon the formation of cores, and the quality of the core-sand for particular purposes. The management of cores is a matter which requires some ingenuity; malformation often causes perplexing failures, and is in most cases the source of unsound castings.

Cores are especially used in forming vacancies in castings, which cannot be successfully formed by the pattern. The forms of cores vary greatly, as may be expected; but in general, if made of open porous sand, free of vegetable and animal matter, and of coal, and if the sand does not contain too much clay, and the cores are properly dried, there is hardly any difficulty experienced on account of the cores. A caution not to be neglected is, that cores are never to be put into a green-sand mould until the very latest moment before casting. Cores which are not surrounded by metal on all sides, are made of stronger sand than others which are often not dried at all. In cores which are covered with metal on all sides, and have only one or


two small vent-holes for the escape of the gases, as is the case with cores for narrow pipes, the sand is moderately mixed with free-sand. It is to have no more clay or adhesive matter than is just necessary to make it adhere for being moulded and dried. Sand of sharp grains, as pounded rock or slag, is more open than the composition of round grains, as river or sea-sand, and for this reason preferable. In many cases, yeast or meal water is used besides clay water to strengthen the core-sand, but these ought to be used cautiously, for not only water, but any other substance which generates gases is injurious to core-sand, causing blower holes in the castings. The safest core-sand is a natural sand which can be used without any artificial admixtures. Moulders ought to examine their neighbourhood until they find sand suited to their purpose, in case they are not already provided with it. Long or thin cores are stiffened by iron wires, or small rods of iron, which are moistened with clay water. Such wires or rods are buried in the core, and recovered when the casting is cleansed from its adhering sand. Cores of considerable length, also those in which the sand is rather strong, are pierced with long wires through the whole length, taking care not to drive the piercer through the surface of the core. Curved or angu

lar cores, which cannot be pierced, and are too long to do without vent-holes, are made open by laying one or more strings along the stiffening wire in the heart of the core, which strings are drawn out after the core is dry. If cores are too long to bear their own weight and the pressure of the metal, they are to be supported by chaplets or by staples. The latter are simply nails with broad flat heads; they are stuck into the sand mould, and project with their heads just so far as the thickness of the metal between the mould and the core is to be. Chaplets are simply bent pieces of sheet iron in the form of a \sqsubset , or two pieces of sheet iron riveted to a pin, the distance between both being equal to the thickness of the metal. Cores are covered with a coating of blackening, which is put on wet. This is the more necessary, as the cavities made by cores are mostly difficult of access, and an easy scaling off of the sand from the iron is therefore very desirable. Liquid blackening for cores is the same as that used in loam-moulding; and by referring to that chapter a receipt for its composition will be found. The blackening is laid on the wet core, as it leaves the core-box, by means of a heavy paint brush, and both the core and its blackening are dried simultaneously.

Small common cores are made in simple core-

boxes, such as are represented in figure 13. A,

Fig. 13.

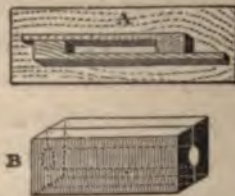

is two strips of boards, with a square projection on each end. Both are at liberty to be moved, and if laid upon a flat board, sand may be filled in the space which is formed by the squares: for each size, that is, section of core, such a box is required, but any length of core of that size may be made in a box of this kind. Round cores are made in boxes similar to that represented in fig. B. Globular cores are made in spherical cavities, and in fact any core in such a cavity as it is destined to form in the casting. Cores are not always made because they are necessary: they are frequently made to save expense in patterns and in moulding, and to render a successful cast more certain.

Moulding of a Column.—As an instance of mixed moulding, we will describe the moulding of a fluted column, which may serve as an illustration for most

cases of this kind, particularly for pipes. Figure 14 represents the pattern of a column with ornz-

Fig. 14.



mented capital, as it is imbedded in the sand, moulded, and ready for removal. A, A, are the core-prints, which leave a cavity to be filled by the long core which is to form the bore, or hollow in the column. It is in many cases difficult to mould a richly ornamented capital in green-sand, along with the trunk of the column, and still the capital ought to be in a solid connexion with the shaft; this case is here represented. On the pattern of the column, instead of the ornamented capital, a block of six or eight sides, or of more or less than that number, occupying the place of the cap, is inserted, as indicated by the lines in the drawing, and more distinctly represented in figure 15, by the dotted lines which represent a hexagon. The fluted shaft of the pattern is divided through the whole length into two halves, which is best done through the opposite channels, as indicated; for a seam which falls otherwise upon two ribs,

Fig. 15.


makes these ribs always more or less imperfect, which is not so glaring if it falls in the channels. Besides this division of the pattern, each half of the pattern is again divided into three subdivisions, or more, as the case may be. These latter divisions, as shown in the drawing, divide the circumference of the column into six parts, each half in three, held together by blocks and wood-screws. After the screws and the blocks are drawn, the pattern may be taken from the sand in parts, each part by itself. No second part is removed until the first impression is mended in the mould, in case there is anything broken in the sand. The capital is formed in the following manner.: If it consists of six equal ornaments, as leaves or spirals, one of these is carved, and prepared for being used as a pattern; over this pattern a core-box is made, and so calculated that a core made in this box will fill one of the parts of the

polygon formed by the pattern. Such a core will fit in the mould, and occupy one part of the space having on one side the impressions of the ornaments of the capital, joining with two sides the next cores, and resting with one side in the sand of the mould. The cores which belong to the upper box may have wires or rods inserted to be fastened with, to the box. After these cores are placed, the centre core is put down, the flask closed, and in fact managed like any other object of our consideration. In placing the cores, care is to be taken that the liquid metal cannot penetrate below a core and lift it; all the crevices which would lead to such a result are to be avoided, or carefully filled up with green-sand; and if there is any doubt as to the safety of the cores, they are to be wired down. At each end of the flask in the parting a small opening is left to communicate with the vent-holes of the core; these openings are in no way connected with the interior of the mould, so as to endanger the cast by admitting hot metal to run out this way. Gits and channels are as usual in the proper places, and if means permit it, the column ought to be cast inclined, into one gate which is at the lowest part, the git raised, by means of small boxes, to such a height as to balance the flow-gate. The latter is to be at the highest point of the pattern and

the box. Here, as in any other case, the cast-gate is to be kept full, in pouring in the metal, to prevent the running in of impurities along with the iron. Directly after the column is cast, or better still while the metal is pouring in, fire is to be applied at both ends to kindle the gases escaping from the core, which gases will explode if left to kindle spontaneously.

Water pipes, gas pipes, or pipes for any purpose whatever, are moulded in the same manner as columns. There is no essential difference, but in the form of the pattern. The core of a pipe is to be a fac simile of the bore or hole to be formed. A core-box for water or gas pipes is represented in figure 16: it shows a

 Fig. 16.




longitudinal section of an iron core-box. Frequently such boxes are made of wood; but in well conducted establishments they are made of cast iron. Wood is apt to twist and warp, and in consequence causes imperfect cores. An iron core-box is generally round, about half an inch thick in metal, and has two square projections to rest upon when laid down, around these projections an iron strap is drawn, to hold both halves together when in use. A core-box

is to be true in its bore, for which reason it is bored or planed, so as to make it true. Both edges, where the halves of the box join, are, if not quite sharp, to form a blunt edge in case the core is made when lying in a horizontal position. To make good cores in a lying box requires a great deal of experience, and it is for this reason not generally practised. In most cases the box is rammed-in vertical or inclined; the latter way is more convenient than the first, and quite as good. The ramming-in of the sand is done by a long iron ramrod. The centre of the core is, in very thin cores, say $1\frac{1}{2}$ inch diameter, an iron rod, along which a wire is laid; both are rammed in together, and the wire is withdrawn while the core is in the box. This leaves a cylindrical channel all through the core, and serves for the escape of the gases. In thicker cores, of two or three and more inches in diameter, the centre rod is a hollow pipe of cast or wrought iron, full of holes. The latter are necessary, or the gas would not find its way to the interior of the pipe. Heavy cores are made of loam, of which we shall speak in another place. The centre rod is to be a few inches on each end longer than the core. This forms the bearing for the core to rest upon when it is to be dried, and

also the journal on which it is to be turned, when the blackening is to be laid on.

Moulding with Plates.—In many cases cast-iron plates with handles are used when one part of the mould is to be removed before the pattern can be drawn. This is the case with the sand between the arms of a bevelled wheel; also with face wheels, or in cases where the pattern, and consequently the sand, is too deep to admit the drawing of the pattern without injury to the mould. Plate moulding is generally performed on bed-plates of steam engines, bed-plates of turning lathes, house props, and in all cases where the sand is surrounded on three sides by hot metal. The sand lifted out in these instances is dried and treated like a core. In the case of a bevelled wheel the moulding by plates is effected as follows: Figure 17 shows a section of a bevelled wheel as it is

Fig. 17.

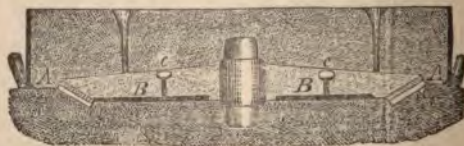

imbedded in the floor of the foundry, which has been levelled for the purpose. The sand, in immediate contact with the pattern, is sifted. The parting

as in the line A, A. In the spaces between the spokes, cast-iron plates, B, B, are inserted, with wrought-iron handles cast into them: these plates are cast in open sand, and from $\frac{1}{2}$ to $\frac{3}{4}$ of an inch thick. They have in this case a triangular form, similar to the space they serve to occupy, and are at least two inches all round, smaller than that space. These plates are laid upon the parting, or, in many instances, impressed into the sand about $\frac{1}{4}$ of an inch deep. They are then covered over with a layer of small iron rods, or wire, or in many cases wooden rods, dipped in clay-water. These rods overhang the plate and reach near to the pattern. The body of sand in the centre of the plate will sustain that end of the rod which is to carry the sand beyond the plate. The space between the arms is then filled upon the plates with moulding sand, flush with the pattern. This forms the parting for the box. After the pattern is covered, and the top box removed, the sand between the arms is removed, by means of the handle C; of which there may be more than one if the core to be lifted is too heavy for one hand, or it is to be lifted by the crane. This part of the mould forms separate pieces: cores in the form of triangles, which may be blackened and dried. The pattern being removed and the other parts of the mould

ready for casting, the plates are replaced, either green or dried, just as convenient. The upper box is put on, and the mould may be filled with metal. This kind of moulding is very extensively used; it is a cheap and very convenient way of working.

Dry-Sand Moulding.—This is a very interesting branch of moulding; to it belong most of the brass and bronze moulding, ornamental iron moulding, and a great part of machine moulding. Dry-sand moulding is in many respects preferable to loam-moulding; it gives a casting more true to the pattern than loam, which latter, on account of its shrinkage, frequently gives imperfect forms to the cast. The strength and uniform texture of the castings is quite as well secured in dry-sand moulds as in loam moulds. Dried or baked sand often consists of a mixture of loam which has been used, and fresh sand; in most cases, however, particularly in ornamental moulding, fresh sand is used. Dry-sand obtains a very firm and open texture, and is well qualified to cast machine shafts, pipes, and such articles as require strength and beauty. The manipulation of moulding in dry sand is exactly the same as in green-sand, but is less difficult. In this case no coal powder is mixed with the sand, which leaves the sand stronger. If fresh sand is used, it is of very easy moulding. When

the moulds are finished and blackened, they are conveyed to the drying stoves, for at least twelve hours, twenty-four hours, is better to expel by the action of heat the moisture contained in the damp sand. The blackening is done by a paint brush, in the humid way, just as loam moulds or cores are blackened. This is done with some caution, so as not to injure the sharp outlines of the mould. The blackening is applied very thin. A moulder who understands mixing his sand properly, so as to be strong and porous, and assume at the same time fine impressions, will make finer castings in this way than can be done in any other mode of moulding. Dry-sand moulding requires strong iron boxes; wood is impracticable, for even if it did not burn in drying the mould, its warping and twisting would injure the mould. All the traverses, if any are needed, are to be of iron. Long patterns, as shafts, require particularly strong boxes, for these are mostly cast in a vertical, or at least in an inclined position. The pressure upon sand and boxes is then very heavy. Hooks and eyes are in these cases not strong enough to hold the boxes together; it requires *glands* to accomplish this. Glands are double angles, made of flat wrought iron. The rods are to be six inches longer than the height of the flask, or of the two boxes together: these six inches are for

bending a square angle at each end of the rod, after which it assumes the form of a [. The distance between the angular ends is to be a little greater than the height of the boxes and bottom. In slanting these glands upon the boxes, the flask may be drawn together as tight as the strength of the glands will permit. The drawing of the glands is performed by small crow-bars gently, so as not to injure the mould. We shall speak of this hereafter. Boxes for dry-sand moulding, if heavy, are to be provided with swivels on each end, for each box is to be turned, the facing of the mould uppermost; blackening and drying require this. In moulding pipes, which need strength, it is necessary to mould them in dry sand, in strong boxes, and to cast them vertically, or at least inclined 30° or 40° . Pipes, or any other objects which are cast horizontal, have always one bad side. The upper side is in most cases porous, unsound, and, in pipes, generally thinner than the bottom side. The liquid metal is apt to lift the core, in spite of staples or chaplets. Another advantage arises from casting vertically, in the better escape of the gas, and the greater security of the core against injury. The core is not so liable to bend and the core-rod may be lighter.


Moulding of a Large Pipe.—There is not the slightest difference between moulding in dry-sand, and moulding in green-sand, except in the composition of the sand, blackening, and drying of the mould; and therefore it hardly seems necessary to illustrate this branch. We will, however, describe the moulding of a large water pipe, as illustrative of this case, and introductory to loam moulding. All water pipes of more than twelve inches diameter, ought to be moulded in dry-sand, and with loam cores. Water pipes are generally made from eight to nine feet long—small pipes frequently but five or six feet long. The pattern is like the exterior of the pipes as it is to be when cast, having at each end a core print five or six inches long. The pattern may be of a solid piece of wood, but is generally composed of strips of plank, to diminish the weight of it; it is divided parallel with its axis, into two halves. After the moulding is performed in the usual way, the mould is blackened and carried to the drying-stove, on an iron tram-road, or by means of a crane. If the foundry possesses no drying stove, or if the boxes are too heavy for transport, some boxes may be put together, a temporary wall of bricks or moulding boxes set around it, covered with sheet iron, and a fire of coke or charcoal or anthracite is kindled

below. The boxes are dried in this way on the floor of the foundry. This mode of drying moulds, however, is imperfect, and slow, produces inconvenience in the foundry, and is expensive. The making of a loam core is a matter of no difficulty, if core-bars, loam-board, and loam are in good condition. The core-bar is in this case a hollow, cast-iron, cylindrical pipe, perforated all over its surface, with either round or oblong holes. The core-bar is about three inches less in diameter than the core is to be, with a view to provide room for a hay or straw rope, by which the core is made porous, and so thick as to leave just sufficient space for loam. The core-iron has a journal at each end, made of wrought iron and screwed to the cast pipe, leaving as much opening as possible for the escape of the gases. These bearings, or journals, may be of cast iron, in which case they are made hollow and square inside, to receive a winch by which the core-bar is made to turn upon

Fig. 18.

its axis. The bar with its bearings is laid upon two iron trestles, as represented in figure 18, on which it may be turned to receive its hay rope and loam. The trestles are about three or four feet long, and are provided with various sized triangular dentations for different-sized journals. The hay or straw for ropes is kept in a moist place, to have it soft and more fit for being twisted. To make a hay rope, a simple winch, made of quarter inch iron rod, with a wooden handle, is required, such as is represented in figure 19, A. Hay ropes are made by the boys when not

Fig. 19.

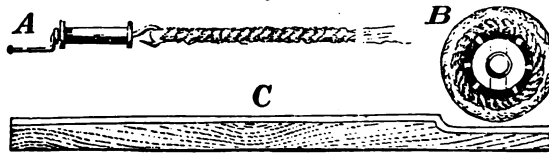

otherwise engaged, and kept for use when required. The method in which the rope is applied is simple: the core-bar is laid with its journals in the trestles, as shown in figure 18, the rope fastened at one end, and the bar turned upon its axis; the rope is led so as to make a close and tight covering. If the rope is loose on the spindle, it is liable to be pressed together by the fluid metal, which would, in the most favourable case, injure the casting, but would

almost invariably cause a failure of the cast. Wooden core-bars are not to be recommended, as it requires something stronger than wood to resist the pressure of a high column of fluid metal. In figure 19, B represents the cross section of a core, in which the core-iron, journal, hay rope, and loam covering are shown. The hay rope receives a slight covering of thin loam, just sufficient to cover the hay, and remove the roughness of the rope. This coating of loam being dried, the core is taken again in the trusses and the loam-board is applied. The loam-board is, in this case, an almost straight board, of eight or ten inches wide. It is straight every way, and to prevent its bending while in use, it is supported by a rib, screwed to it, or by a strong plank, upon which it rests. The board is so long as to rest upon both trusses, and is fastened to these, just so far from the centre of the core-iron, as to form half the diameter of the finished core. The edge of the board (in the drawing, the upper edge) is shaped as the form of the core, which is in this case almost a straight line, but is cut out, at one end, to form the funnel, or cup-mouth, of the pipe. When the board is in its proper position, and fastened at both extremities by means of weights or screws, it is obvious that when the core-

bar is turned upon its axis, it will describe the form of the core along the edge of the board. By turning the core bar with its hay rope and superficial coating of loam, and throwing on additional moist loam, the surplus moist loam will be stricken off by the loam-board, or laid on in those places where the board does not reach the loam. When the core is properly filled up and closely covered with loam, the loam-board is taken away, washed, and put in its place again. The core is now turned somewhat faster than before, and receives a slight washing, merely by dipping the hands into water, and moving them over the surface of the rotary core. When smoothed, which is done with as little water as possible, the core is brought to the stove and dried, then blackened, dried again, and is then ready to be put in the mould. If the cores are long and limber, the staples are not to be forgotten.

The thickness of the covering of loam depends partly on the quality of the loam, but chiefly on the thickness of the metal, and the duration and amount of pressure upon the core by the fluid metal. For common water pipes, if cast inclined, and porous loam is used, one inch is sufficient for the core, but, if cast standing, one inch and a half of loam ought to cover the hay-rope. If the thickness of loam on a

core be more than three-quarters of an inch, it is necessary to lay on the loam in two or more layers, always drying the first layer before the next is put on. The loam which forms the core is made as open as possible in its composition; old moulding-sand, old core-sand, or river-sand is mixed with the loam. The working edge of the loam-board is not a square, but is slanted so as to form an angle of nearly 45° to the tangent of the periphery of the core. This is necessary in order to make the board to sleek (to make the loam smooth). A square edge would cause a rough surface to the core. The slanting of the edge is indicated in figure 19, C, at one end of the board.

After careful drying, blackening, and polishing, the core may be put into the mould, if required. The mould is provided with staples so as to support the core, and is then carefully closed. If the box, or the pipe, is large, it is advisable to cover the box by a strong board, and put the glands upon the board, so that there is a board at top and bottom of the flask, to protect the sand from being pushed out. In many instances the moulding boxes are tapered so as to form half a hexagon; in these cases glands are of no use, and heavy iron weights which reach all across the boxes, are used to bear the top-box

down. Air-holes at both ends of the box are to be provided for, for the core in this case emits a great deal of combustible gas, which is to be kindled in proper time to prevent explosion.

Pipe moulding is a very common employment in iron foundries, but still there is something peculiar in it, which makes it inconvenient to cast pipes in a foundry where green-sand or dry-sand moulding is done at the same time. It suits best in a loam-moulding establishment. There are great varieties in the form of pipes, but as long as they are straight, a pattern is made and moulded in dry or green sand. The core in this case being also straight, is easily made. It is more difficult to form the core for a bent pipe or knee. We will allude to this in the next chapter.

Casting Pipes without Cores.—There was considerable interest manifested, some time ago, in a process for casting pipes without cores, by means of machinery. An iron mould, well bored and polished, is made to turn upon its axis in a horizontal position; the fluid metal cast in at one end, will naturally flow round in the mould, and if sufficiently fluid, will make a pipe of uniform thickness. How this machine turned out in practice, we do not know, for nothing has been said about it for a long time. Any improve-

ment which will reduce the price of iron water pipes is worthy of notice, and the above machine ought to attract sufficient attention to give it a fair trial. One thing is certain, that every kind of pig-iron is unsuitable for this process.

Moulding of Fine Castings.—Before we conclude this chapter we will give a short description of ornamental moulding; that is, the moulding of small ornaments and trinkets in iron or bronze. There is little difference between moulding for iron, and moulding for bronze; the chief distinction is in the thickness of the cast. Bronze must be cast very thin, if sharp, fine, and distinct outlines are desired. In iron, the same attention need not be paid to the weight of the cast. The principal thing to be attended to in moulding small articles, is the quality of the moulding-sand. This must be as fine as it possibly can be obtained. It ought to have as little clay, or any other foreign admixture, as possible, to prevent its shrinking, and in consequence breaking and cracking. Sand for this purpose is to be an almost pure silicious compound. Coal-powder or any other admixture is inadmissible; it is fatal to the beauty of the cast. Good sand of this kind adheres easily with the least amount of water, takes the finest impressions of the skin, and may be cut into fine slices by a

sharp knife. For this kind of work, the greatest evil is too much clay in the sand; other impurities can be removed by sieves, or by washing. Fine tripoli is the best sand for these purposes.

Small articles of bronze or iron, are moulded in the same manner as larger parts of machinery, or hollow-ware. The sand is rammed very close in small iron moulding-boxes, and the boxes dried in the stove, blackened if for iron, but not so if for bronze or brass. For brass or bronze it is advisable to face the mould each time with fresh sand, thrown on through a fine silk sieve. If this coating is but one-twelfth or one-eighth of an inch thick, it improves the casting considerably. Moulds for iron cannot be dusted with charcoal, or black lead, as these would be too coarse. The moulds after they are dry are blackened by a rush-candle, or the black smoke from a pine knot. The box which contains the mould is inverted, so as to turn the face of the mould downwards, rested upon two extreme points. The flame of the candle or wood is held under the mould, which will assume in consequence a velvety coating of fine carbon. There is to be as little blackening as possible: too much will injure the mould and the casting. To mould a simple rosette, or anything which gives but a simple impression in the lower and upper box,

is of very easy performance. The case is different with more complicated forms—articles which can not be screwed together, but must be cast in one piece, as statues, columns, and other similar objects. This is an interesting art, and it may be of some use to illustrate a few cases of this kind.

Moulding of a Stag.—If the small form of a stag, figure 20, resting upon a platform, is to be moulded,

Fig. 20.



it is at once visible that the antlers cannot well be brought into the same mould with the body: they are moulded by themselves, and screwed on. The platform can be cast with the body, but it makes less work in moulding to cast them separate, and screw the platform also to the body. We have now only the body of the animal left to make a mould for. In this case the natural parting is over the back, following the spine, and so dividing the face and breast. The pattern is accordingly cut in two in

this line. When one half of the pattern is moulded, the box is turned up, and so much of the sand as cannot be lifted, is cut out around that half of the pattern; this forms the parting of the boxes. The surface of the parting is well polished, some parting-sand thrown on, and the other half of the pattern set upon the first. Cores are now to be provided in those places where the upper box will not lift. We find that a core is to be made between the two fore-legs, as indicated by the dotted line. Another core is needed on the face, from the nose to the ears; and a third core, joining the second at the ears, running down its neck. This will be all the cores needed, for the other parts of the pattern divide naturally. These cores are made of fresh sand, even if the other mould is made of old sand. Old sand will not stand the necessary moving of these cores. The cores are often moulded upon fine blotting or oiled tissue paper, if small; but if the cores are large, wire is to be buried in them. When the upper box is filled with sand, which is done after the cores are well finished and parting-sand put on, the upper box is lifted, one half of the pattern removed, and the flask closed again. The flask is now inverted, the lower box lifted, and the other half of the pattern removed. The same manipulation, in principle,

is used in moulding a grooved pulley. By this mode of moulding, the cores are not removed. This is only practicable where the pattern can be and is divided, and where it is of light material. If the pattern is heavy, made of metal, and it cannot be divided, then the cores are to be drawn back from it as soon as the upper box has been lifted. There is no need of moving the cores further than is just necessary to have them out of the way for lifting the pattern. Good parting-sand is sufficient to separate cores so large as to take wire. Very small cores are best bedded upon paper; in pulling the paper, the core resting upon it will follow. As soon as the pattern is removed from the sand, the cores are again put in their places, and the boxes removed to the drying-stove for drying. It is a matter of precaution to fasten the cores, if they are once in their places, with hooks of thin iron wire, bent at one end, and pin the cores to the mould. There is less danger of injury happening to the mould, in handling the boxes, if the cores are secured in this manner. When the mould is properly dried, which may be done within twelve hours (though a longer time would be preferable), it is joined together, glands or screws put on, as the case may be, and cast. If the article is to be cast in bronze, brass, or any other metal

besides iron, it is not blackened; but if it is to be cast in iron, it is blackened as before described. There will be no difficulty in casting the antlers to this pattern: the platform also is very simple. Moulders who are skilled in this kind of work, will mould two loose cores, one upon the other, but in most cases it is preferable to dry one part of the mould with its cores, and then put on the other cores; in both cases, however, it requires experience to handle such tender, brittle things, as small sand cores, often but one-eighth of an inch thick, and half an inch in area.

Ornamental compositions are screwed together, to form an ornament of many parts. Small ornaments are soldered together, or riveted and soldered. Solder for iron trinkets is a fluid composition of a little silver and gold. The soldering is performed by the blow-pipe. Solder for brass and bronze is the same, if the articles are to be gilded; in ordinary cases, brass or tin solder is used.

Brass ornaments are mostly cast hollow; this is not so much for reasons of economy, as with a view of making more perfect castings, and saving labour in chipping and chiselling. As no coal can be used to protect the metal against burning together with the sand, it is necessary to cool it as quick as possi-

ble, and in this way give it a smooth surface. The making of cores in these instances is often connected with considerable difficulties. The cores of complicated figures are composed of parts, that is, a core-box is made for one part of the core, and the parts cemented together to form the core. Iron castings are but seldom cast hollow, if small, that is, articles of less than six or eight inches extent; larger figures in iron are cast hollow, for if the body of hot iron is large, it will burn the sand, or melt together with it. Fluid iron, suitable for small castings, and the use of good fine sand, will make ornaments finer and sharper in expression than castings in any other metal. Horse-hair and cotton thread may be imitated to perfection. The wings of a fly with its microscopic nerves may be copied in iron; and green leaves stiffened so as to be applicable as patterns, may be cast in iron without difficulty.

Loam-Moulding.—This is the most ancient branch of moulding. In this department the moulder is his own pattern maker. He furnishes in most cases the pattern, and makes the mould also. In some instances a pattern, or parts of a pattern, are made of wood, and buried in the loam, but these cases do not happen frequently. The loam-moulder will furnish patterns with great ease, which cannot

be made well or so cheaply in any other way. Any form of a pattern, or any casting of whatever kind, may be done in loam. In practice, loam-moulding is generally restricted to forms which cannot be cast conveniently in any other way. Loam-moulding is more expensive, generally speaking, than any other kind of moulding, except in cases of simple forms and heavy castings.

Every piece of loam-moulding is a regularly constructed edifice. No moulding in loam for a casting of importance, is commenced until a perfect plan of the whole operation from beginning to end is laid down. If no such plan is made, it may happen, and frequently does happen, to be impracticable to mould in the way commenced, whereby often the labour spent so far, is lost. The most important part of this branch of moulding, is the composition of the loam employed; it demands the strictest attention, and is varied according to the objects to be moulded, as loam suitable in one case will not answer in another. Fineness and porosity, and as little shrinkage in being dried as possible, are indispensable qualities. The mould must be dried hard, to resist the pressure of the fluid metal, which will otherwise break it or crumble it to dust, and spoil the casting. If loam is too

close, or imporous, it will retain the gases developed by the heat of the metal, and cause either the metal to boil and make porous castings, or in the worst case cause explosion, and throw out the hot metal. If loam shrinks too much in drying, it will inevitably crack, make crevices into which the hot metal runs, and what is still worse, some parts of the facing of the mould will be pressed back, which causes uneven, rugged castings. The most important quality of loam is its porosity. The heat of the cast, and the presence of gas-generating material in every part of the mould, renders it necessary that the gases should escape through the substance of the mould, while it is impervious to the metal. There is no use in piercing holes by the pricker; if the loam is too strong, the cast will boil.

Moulding-loam is generally artificially composed of common brick-clay, and sharp-sand. Instead of the latter, old coarse foundry sand, or used core-sand, or burnt brick-powder, may be used to greater advantage. The quantity of sand to be mixed with the clay can only be known by experience. It is impossible to give receipts for compositions, because the quality of loam as well as that of the sand is variable, and differs in every instance. For heavy, thick castings, the loam is to be stronger than for small or thin castings.

Cow-hair obtained from tanneries is used to prevent the cracking of loam and make it porous. Mill-seeds, sawdust, horse dung, hacked-hay or straw, are still more extensively used than cow-hair. Loam is to be worked diligently, to make its texture as uniform as possible. The matter to be mixed with it is to be distributed equally through the whole mass. Each part of the mould requires a different kind of loam: one for the facing of the mould, and another for the body; a stronger loam for brick-work, and a weaker one, with more straw or horse-dung, for a common mould. Parts of a mould which are almost surrounded by the pattern, and of course by the metal, are to be burned in a fire almost to a red heat, not only to expel water, but also to destroy everything which could generate gas, and to destroy every particle of vegetable and animal matter. This operation is necessary to be performed on all cores, and such parts of a mould as form the interior of it. The gases generated in a loam mould are of a complex nature; there are gases of water—steam—carbonic acid, carbonic oxide, and ammoniacal compositions which are not determined. The flame issuing from a loam mould, generally burns with a blue light, interspersed with greenish yellow streaks and specks.

Moulding of Simple Round Forms.—Articles of a round form, that is, a spheroid, or a segment of it, a cylinder and its auxiliaries, are moulded by means of a loam-board fastened to an iron spindle, which may be turned upon an imaginary axis, or the axis of the spindle. Wherever a loam-mould is built up, it must be always in the sweep of a crane, or it is to be built in that pit where it is finally to be cast. We will commence our illustration by the moulding of a soap-kettle in the pit. A soap-kettle—or soap-pan—is generally partly cylindrical, with a round bottom, broad brim, and a collar, for the wooden superstructure of planks to be set into it. All kettles are moulded and cast in an inverted position, as is shown in figure 21. It would be better for the quality of the cast if kettles could be cast bottom down, but this is almost impossible on account of the core. The moulding of a kettle is represented in figure 21.



It is here performed, for want of a crane in the pit, on the very place where it is to be cast. A hole is dug in the floor of the foundry sufficiently deep to bury the whole mould, and wide enough to permit the moulder to walk around the mould when he is at work. The first thing to be done is to cast a round plate or ring in open sand. This is to reach at least six inches into the kettle: that is, its smallest diameter is to be twelve inches smaller than the shorter or interior diameter of the kettle, and its largest diameter is to be from eight to twelve inches longer than the longest diameter of the pattern. This plate may be three-quarters of an inch or one inch thick. It is placed in a perfectly level position on the bottom of the pit, and raised by bricks to the height of six or eight inches from the bottom. In the centre of this ring-plate a pole or piece of cast iron is driven in the ground, and covered by sand to protect it against heat. In this pole a pan, or step, is cut for the pivot of the spindle to move in. A spindle of one and a half or two inches square wrought iron, having a round bearing at its upper end, and a steel point at its lower extremity, is now erected; resting below in the centre step, and above in a plank laid across the pit, borne down and held in its place by weights placed upon it at the extremities. This

spindle is to stand perfectly plumb, being exactly in the centre of the foundation plate. To this spindle a moveable arm is screwed, made of two rods of flat iron, with many holes in it. At the spindle these two flat bars are bent in such a manner as to catch two corners of the spindle, and be immoveably fastened to it by two screws. In other cases a cast-iron forked arm is made with holes for screwing on the loam-board, and a spindle-box with pinching-screw for adjustment. To this arm the loam-board is screwed, which is an inch thick pine board, clear of knots. The loam-board is at first a skeleton of the interior of the kettle with the brim, and that slanting part beyond the brim, called the knee; if turned upon the axis of the spindle, it will describe the form and size of the interior of the kettle. In commencing the mould, a four inch brick wall is built upon the foundation plate, or platform, round, so as to leave two inches space between it and the loam-board. At the height of six inches below the corner of the bottom, a layer of one and a half inch iron bars is laid, and these are crossed by smaller bars, all walled-in in the brick work. Upon these bars the bricks forming the crown are founded. If the bottom is round, forms half a sphere, these iron bars are not needed; an arch may be sprung of bricks,

which generally is strong enough to resist the pressure of the fluid metal. The moulder leaves a small opening around the spindle, serving the purpose of a draught-hole for the fire which is to be kindled inside. This first brick wall is dried by a stone coal or charcoal fire, kindled inside below the mould. The loam-mortar for putting up the wall, is to be porous, but also strong; some horse-dung is generally mixed with it. It is composed mostly of sand, and the layers of mortar are from half an inch to one inch thick. The bricks used for this purpose are hard-burnt, light, but such as have not been melted, or burned too hard. Bricks are used in halves or bats. While the brick wall is drying, a thin layer of loam may be given to the mould, which here constitutes the core, in case the work is pressing; but if there is time, it is better to dry the bricks first. The loam may after this be increased to within a quarter of an inch to the loam-board, still keeping up the fire, and drying the core gradually. The last layer of loam is put on when the first loam-coating is nearly dry. It consists of finer and stronger loam. It is free from horse-dung, straw, or any other admixture, but is mixed with some cow hair. The surface is finished off by a smooth coating of wet fine loam, the redundancies being swept

off by the loam-board, which has been washed and freed of all adherent loam and straw. As the surface gradually dries, it is painted over, by means of a paint-brush, with a mixture of charcoal-powder, clay, and water. This coating forms the parting between the core and the metal-thickness.

The loam-board with which the core has been formed is now removed, and is replaced by another board, called the thickness board. The edge of the thickness board describes the external form of the kettle, and merely touches the knee made by the first board. We see here the use of the knee: it serves not only for the more perfect closing of the mould below, but it is the standard mark of the loam-boards. Over the nearly dry core a layer of porous sandy loam is now spread, and made smooth by sweeping the thickness board around it. This layer of loam forms the exact pattern of the kettle as it will be after casting. When well dried, this layer of loam receives a blackwash as the core did, and is to be well dried. The spindle may now be removed, for there is no more use for it in this instance. Over the first foundation plate, or platform, is now laid another platform, whose interior diameter is equal to the diameter of the knee, so that this ring when laid down just fits, or is a little larger than

the largest part of the core. Upon this platform another layer of loam of nearly two inches thick is laid, and smoothed over by hand. There is no need of a smooth surface. As long as the loam continues soft, the mould is kept under bars of iron bent in the shape of the bottom, or crown of the mould, and reaching down to the platform, to which they attach themselves by being bent under the platform. Two or three of such bars reach all over the kettle, others may be shorter and reach merely along the sides. These bars are laid over the soft loam, and then the mould is gradually dried. When nearly dry, iron hoops, which keep together the rods, are laid around the mould, and fastened to the rods by means of wire. The whole mould, iron and all, receives after this a good coating of straw loam, with horse-dung, the iron bars being partly covered with it. In this manner, iron and loam are combined and form one solid part of the mould. The structure of the mould is now completed, so far as the form is concerned. The whole is now thoroughly dried or baked by keeping up a constant fire in the interior of the mould. Fire may be applied on the outside also. In this instance, which is that of moulding a kettle with an open core, not so much fire is required as if the core was solid. In the latter case

it requires a thorough burning; the core is then to be made red hot; but in this instance a good drying is sufficient to secure a safe cast. In twenty-four hours the mould will be found to be dry, and ready to be taken apart.

The taking apart of the mould is done by means of a crane, in case there is one; otherwise it is to be done by hand, by a pulley, or by some other means which are sufficient to lift the cape or cope. The first step to be taken is to lift, by means of a sharp crow-bar, the platform of the cope from the platform of the core, that is, to loosen the first from the latter part, after which it may be lifted and set upon a pair of timbers over the pit, or on any other convenient place where it is not exposed to moisture. When the cope is removed, the "thickness" is peeled off from the core, the draft-hole in the crown is closed by a brick-bat and plastered over with loam. The hole in the centre of the cope is also filled up to within two inches, all the damages on the mould repaired, and these patches dried. After this the mould receives a blackwashing, and is then finally dried once more.

Blackwash.—The blackwash for parting consists chiefly of charcoal-powder, and a little clay. This is almost entirely lost in taking the mould apart,

and the remainder is lost in sleeking the mould by the finishing clay-wash. Blackwash is always on hand in the foundry; it is contained in the blackwash tubs, of which there is one for parting and one for finishing. The latter is composed of finely ground plumbago, often mixed with a little charcoal, the whole diluted with horse-dung water, or a solution of the soluble parts of horse-dung. This blackwash is frequently mixed with pease-meal or other meal, glue, and extracts from the refuse of tanneries; but all these latter compositions are more or less too close, and cause a dull surface to the cast. The first is the best, if applied not too much diluted.

The sleek-washing as well as blackwashing is to be done with proper caution, so as not to injure the sharp outlines of the mould; it is better if the first of these two operations can be dispensed with, and the mould finished just as the loam-board left it. This latter can be done in following the plan to be described in cylinder forming, which is also applicable in this case; that is, working without thicknesses. When the parts of the mould are properly dried, it is put together again; but before this is done, a hole of two inches round is cut in the brim of the cope, to connect the gates with, for casting. The cope is to rest firmly upon the core, that is, it

is to be put exactly in that position in which it was before, and shut tightly at the knee. A pipe is now laid below the foundation of the mould, which pipe is to be carried through the sand which is subsequently rammed in, to conduct the gas from the interior of the core to the surface. This pipe may be either an iron pipe, or may be of baked clay, or it may be a space left in the sand. The latter is objectionable, because it may fill up, and cause an explosion by stopping the escape of the gas. The mould is now rammed in with sand, which is done by iron stampers with strokes in rapid succession. This operation is performed by at least three hands at once, to break the vibrations caused by stamping, and prevent injury to the mould in consequence. With the ramming-in of the mould, the gate for the reception of the metal is to be provided for. This we contemplate to be in the lower part of the mould; it is frequently done from the top, but the latter mode is not quite safe, and never makes as sound castings as the way proposed here. The gate may be formed by a wooden pattern or pin, as in green-sand moulding, but this is at best a very doubtful operation in its consequences; for the gate will be a long one in all cases, and in pulling out the pin, sand may drop in the gate and stop it up altogether, or drop s

much sand as to injure the casting. The best plan is to have pipes ready made of burned loam; such pipes may be conical, and tapered so that the smaller end of one pipe will fit in the larger end of another. In this way any length of gate may be formed, perfectly secure against damages from stamping. On the top of the mould a flow-gate is set, which may be also formed of one of burned loam-pipes, or it may be moulded in the sand. The first plan, however, is preferable. The whole space around the mould is in this way filled up with sand, and tightly rammed. Over this sand, that is, over the mould covered by the sand, pieces of pig-iron or other heavy pieces of iron are laid, or iron beams tied down by screws which reach to the platform, and are fastened to the latter, to prevent the least motion of the mould upwards, for such a motion would spoil the mould. Before casting, the flow-gate is covered with a dry ball of loam, to be removed when the fluid metal shows itself in the gate and the mould is filled with iron. Over that channel or pipe, communicating with the interior of the core, a handful of dry wood shavings, or dry straw, is laid, and kindled as soon as the hot metal is being poured in.

The stopping up of the flow-gate is a necessary operation, and the flow-gate itself also is necessary

in all cases of large castings. The flow-gate is very useful, because it is always put on the highest point, or at a point to which most of the light impurities which float on the melted metal are very apt to flow. If the flow-gate is placed in such a situation, the impurities will naturally flow into it. For these reasons the flow-gate is always made wider than the cast-gate. The stopping of the flow-gate until the metal appears, is an operation equally important. If the flow-gate, or any other aperture to the interior of the mould, is open, the gases or hot air will rush to the opening with a force equal to the space of the mould and the amount of hot metal to be poured into it. This rush of air is very apt to tear loose some loam or sand of the mould, or even break the mould. By stopping the openings, a certain amount of confined gas finds its way through the sand or loam of the mould, and opens the pores of the mould. This stopping up of the air channels is the safest way of preventing explosions and making good castings. In case there is no flow-gate to a mould, and only a cast-gate, the latter is to be kept full all the time during which metal is poured in. If there is an interruption of the flow, and the rush of air finds its way through the cast-gate, it is very apt to cool the metal, tear some sand loose, and by that means stop up the gate,

or even break the mould. Such accidents happen frequently, and are the common causes of failure in founding. When castings are made by a single cast-gate, it is advisable to make a reservoir for the fluid metal at the top, that is, to make the mouth of the gate very wide, and skim the metal well to prevent the flowing in of any impurities. In moulding hollow-ware, the wedge-shaped gits are made partly for causing an easy separation of the git from the cast, but chiefly to have a git of large capacity and small opening, to be kept full while casting.

Gas Pipes.—The air pipes leading from the core of a heavy casting ought to be made of iron, for these pipes have an important office to perform. In case such a pipe is stopped up, an explosion is almost inevitable. The atmospheric air confined in the hollow space of the core, and that air contained in the pores of the sand, mixed with the carbonic oxide gas generated of the vegetable or animal matter in the mould, will form an explosive mixture of the most dangerous kind, and will destroy any mould if it explodes. The mouth of the air pipe may be covered with burning shavings, but it is advisable first to lay over the mouth of it a piece of wire-gauze, to prevent the falling in of any dirt or fire. If there is fire in the pipe before the air is moving.

that is, before there is any metal in the mould, an explosion will take place.

Removing of the Core.—As soon as the casting is done, the mould is dug up, and a portion of the core removed before the cast is entirely cooled. Cylindrical castings are liable to be split by the core, if the core is too strong. For these reasons the core is made chiefly of sand, and only enough of clay is used to keep it together. Brick cores are preferable to loam cores, if put together with sand and thick joints, because bricks offer some resistance to the fluid metal by their mass, and are easily moved by a strong power, such as metal in the act of contraction. This is one of the evils attending iron core pipes. If there is no hay-rope or a thick layer of sand around a core-iron, the casting will split upon the core before it is cool, and before it can be prevented. In all cases it is advisable to remove the core as soon as possible, and if it cannot be taken out altogether, then remove at least a part of it, that is, cut it in some place so as to afford room for the contracting cast.

Moulding without Thickness.—As an illustration of moulding in loam without thickness, which is certainly the most advantageous plan of loam-moulding, we will describe the moulding of a cylinder

The operation is similar in all cases: whether for a steam-engine, a blast-machine, or a cylinder for any other purpose; for illustration, however, we prefer that of a steam-engine, as the most complicated. In cases of narrow cylinders it is preferred to have the core fixed, and move the cope, particularly where the latter is to be divided. Dividing the cope ought to be avoided, if possible, for it is almost impossible to make a correct casting in such a mould. We will take a case for illustration where core and cope are each in one piece, and the latter stationary, that is, moulded in that place where the cylinder is to be cast. In this instance the mould for the cope is put in the pit, the same as the mould of the pan, above described, and founded the same way upon a platform. It is not advisable to make the cope above ground, even if there is a crane strong enough to carry it to the pit. In a mould like this, a crevice may open in transporting it, and give access to hot metal, which may frustrate the purpose for which the mould has been made. In figure 22, the moulding of a short cylinder is represented, such as is now used in steam-engines to turn the screw propellers of steamboats. A pattern of the steam-ways is made in wood, solid, as represented in figure 23, which figure shows a side

118 MOULDER'S AND FOUNDER'S POCKET GUIDE.

elevation, and a view from above. This block has the length of the cylinder between its flanges, and in

Fig. 22.



Fig. 23.



case there are any mouldings in the flange which run across the steam-ways, they are to be moulded in the wood. The three core-prints are of considerable length, because the cores find here their chief support. The middle core finds another support in the opening for the exhaust pipe, as shown in figure 23. One side of the pattern is hollow and cylindrical, fitting the exterior diameter of the cylinder, or the sweep of the loam-board. Having laid

the platform, erected the spindle, and screwed in the loam-board—which is almost a straight board, with the exception of the two knees, one above and one below, and the moulding or hoops around the cylinder—the brick enclosure is laid, leaving from two to two and a half inches space for loam. The pattern of the steam-ways is fastened, just touching the loam-board in its travel upon its axis, and walled in, giving it a loam coating where the bricks touch it. After the brick wall is nearly dry, a coating of loam is given; this loam may be pretty strong, and mixed with hay, for the pressure upon it will be great, and if the loam gives way to this pressure, the cylinder will be defaced. This coating is superficially dried, and another coat of hair-loam laid on, which is to reach very near the loam-board, so that the last coating is but a little thicker than a clay-wash. In drying the previous loam coats, and making the coats thin, an almost perfectly smooth surface of the mould may be obtained. It will be as round and straight as a turned and polished iron cylinder, and of course the casting will be similar to the moulding. Clay which shrinks a great deal, or is plastered on in too heavy coats, causes uneven and rugged surfaces in the mould, which is the case also if the ground is not dry before the last washing

is performed. A good facing is as smooth, sharp, and distinct in its outlines as a well made pattern of wood. The blackwashing is here to be the very last operation, and to be well performed, and when dry must be polished by a large sleeker fitting the circle of the cylinder. Before the blackwashing of the cylinder is performed, however, the steam-ways are moulded; while the cylinder is under the influence of the fire. The pattern of the steam-ways is covered by hair-loam, leaving the core-prints projecting, so as to afford access to the interior through the holes left by the core-prints. The pattern receives two or three coatings of loam, sufficient to make the loam at least two inches thick. Close to the brick, or as far off as the square of the pattern goes, a groove is cut in the loam, around the pattern, indicated by the dotted line, figure 23. This groove cuts the loam nearly through, so that the mould may be separated at this mark. The mould around the steam-ways pattern is provided with iron, bent around it, and also irons bent around the cylinder. These irons meet at the joint or parting, and are secured in their places by wire and loam, the ends of the irons at the parting terminating in hooks. Fastening a mould in this way by iron straps is convenient and advantageous, and answers every pur-

pose, if the mould is made strong enough. If a cope is made too weak because of the iron straps, the above is a bad fastening, and the cause of failures or imperfect castings. Fastening a mould with iron is expensive, and where it can be avoided it is advisable so to do. In this instance it can be avoided, and the mould may be made serviceable without iron fastenings. When the steam-ways pattern is removed, and the mould ready to be closed again, it is simply closed and secured by brick-work, which latter is commenced at the bottom. While the brick-work is progressing, the cope of the steam-ways is secured temporarily by some wire fastened around the cylinder. The brick-work forming the enclosure to this part of the mould is dried by external fire, or the united heat of the fire inside and outside of the mould.

The cores, forming the steam-ways, must be strong and porous. They are to be as long as the hollow they are to form in the casting, to which is to be added the length of the core-prints. Cores of this description are generally moulded in a wooden core-box; but this plan is not to be recommended, for wood will twist and warp, particularly where it is wet on one side and charring hot on the other, as is the case in this instance. The best plan of mak


ing the cores, is to make a wood pattern of a core-box, and cast it at once in iron and in open sand. In such an iron box, a good and correct core may be made without much labour. The cores for the steam-ways are made of strong loam, and provided with several core-irons, which are rods of quarter or half inch square iron, bent in the curves of the core. The core-irons are dipped in strong clay-water before they are buried in the core.

Besides the core-irons, strings of hemp, cotton, or straw, are laid in the core, which burn out in drying and form channels for the escape of air. A great many of these strings may be used, but they must be thin, so as to arrest the fluid iron, in case any of it finds access to the interior of the core. The core-loam may contain cow-hair if necessary, but this is a matter which depends entirely on the quality of the loam of which the core is made. The cores, after being moulded, are heated to redness in a coal fire, with liberal access of air, to expel every trace of water, vegetable and animal matter, and carbon. When well burned, the cores receive a good black-washing of black-lead and clay, as little as possible of the latter. These cores are the very last to be put in the mould.

Core for the Cylinder.—While the cope of the

cylinder is progressing, the core for it is moulded somewhere near it, on the floor of the foundry, but within the sweep of the crane. The core is founded upon an iron platform, which has its snugs inside, and its diameter is six inches less than the diameter of the interior of the cope. The platform of the core is to rest upon the platform of the cope. The core is

Fig. 24.

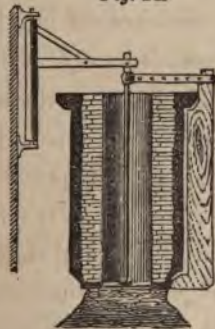

simply built of bricks, finished in loam, blackened and polished, and is then ready to be set in its cope. The core has two knees, one below and one above, which are at an angle of 45° . These two knees are necessary to keep the core in its position. In case the metal is liable to porosity, which is frequently the case with some of the anthracite iron, and generally so with charcoal iron, it is necessary to prolong the mould of the cylinder, above its flange, as shown

in the drawing, figure 24, into which the sullage rises. In cast iron which does not form holes, or raise any sullage, this precaution is not required. Upon the sullage piece, or in want of that, upon the upper edge of the cylinder, the flow-gates are set, of which there are to be at least two or three, and more if the iron is doubtful and the diameter of the cylinder large. Before the core is put in its place, two rests for the steam-way cores are cut into it. The steam-way cores are suspended only at their two ends, and liable to be lifted out at the centre core. A deep rest in that core, or an iron fastening which passes through that core, is required to secure it in its place, when the cylinder core is set and well secured, resting upon the platform of the cope, where it is secured by iron wedges. For these reasons the knees of the mould may be made to catch before the platform plates touch one another, and the space left between them can be filled up by iron wedges or scraps. The cores of the steam-ways, when put in, are well secured to the core, and then the cope of the steam-ways put in its place. The cores are after this secured in the openings left by the core-prints of the pattern, and well stopped up by moist loam, which is to be dried. In many cases, that straight part of the steam-ways cope where the cores pass through,

is covered by an iron plate, coated with loam, and the core-irons fastened to this plate. This caution is unnecessary, as the projecting cores can be well secured by dry brick-bats. The mode of fastening, however, depends very much on the size and form of the steam-box, and the form of the cores.

The burying of the mould and ramming-in of the sand is done in the usual way, but here the space below the mould is filled with sand and well secured, to prevent the hot metal entering below the core, in case the lower knee does not fit tightly, which in this case is always doubtful, and cannot be secured beforehand. The interior of the core is also filled with sand, if there is any doubt of its being strong enough and tight. It is better when there is no sand in the core, at least but very little in the bottom of it. The opening of the core at the top is covered by an iron plate which is well secured, leaving but a small opening for the escape of the gases; which opening is, as in any other instance, covered by a piece of wire gauze and burning straw. The whole mould is covered, as well as the core-plate, with a load of iron or screws, to prevent any motion of the core or cope by the static pressure of the fluid metal, for the least lifting will inevitably

destroy the cast. The cast-gate is at the lower flange, and the metal is to rise gradually from below.

The cores of the steam-ways are often of such forms as not so easily to be secured in their places, which is particularly the case with the middle, or exhaust core. In this, the assumed case, there is no difficulty; for we have two strong core-prints, and the core cannot be large, as the steam-chest is but small. If a core-print can be given on each side of the chest, there will be no difficulty at all, for then the core has three points to rest upon, and can be made safe enough. If the other two cores are strong enough to take strong core-irons, there is no danger of their failing. Where such advantages cannot be had, and where the cores are in danger of being lifted off their seats, it is necessary to secure the cores by chaplets, which are put between the cores and the cope of the steam-ways, for there are none applicable to the core of the cylinder.

The use of chaplets in the steam-ways cannot be recommended, if it can be avoided by any means. The chaplets must be strong and of good wrought iron, or the fluid iron will melt or dissolve the chaplets, and the effect is worse than if they had not been used; for the moulder depended upon a support which failed, and would have done better without

supports. If chaplets are not made of good and very pure wrought iron, they are liable to melt, or are dissolved in the mass of cast iron. The greater the amount of the latter and the longer it keeps fluid, and the hotter it is, the greater is the danger of the chaplet being destroyed. Impure iron, or iron which contains much cinder, or thick scales of hammer-slag, is apt to produce holes in the casting, for the oxygen of the scales, or cinder, will combine with the carbon of the cast iron and form carbonic oxide, which cannot escape, as it is in the interior of the casting, and the iron next to the mould is generally chilled before such gas appears.

General Remarks on Loam-Moulding.—Precautions which are to be taken in loam-moulding in general, are to be particularly observed in moulding steam cylinders, for here the object is to make a smooth, well finished casting, and one of compact sound metal, free of pores or holes. To accomplish this, particular attention must be given to the following requisites: A strong but still a porous loam; drying in coats; a well smoothed facing before the blackening is put on; well burnt cores for the steam-ways, and the air-holes in these so small and so arranged, as to prevent any possible entrance of hot iron into these air channels; the absence of all chaplets if

possible; and every part of the mould well dried. The bearing down of the mould, and the stamping in, are operations which are in all cases the same.

If there are any square or unusual forms on a cylinder, as, for example, if one or both flanges are square, or if there are extra steam-ways, or ornaments, all such forms are made in wood or in metal (the latter is preferable), buried in the mould, and removed before the finishing of the mould.

Irregular Forms.—Where forms are to be moulded which do not permit the use of the spindle, a loam-mould is made either by hand, or over a wood pattern. There are also cases where both instances happen in one mould. We will illustrate this by giving an instance of the first and an instance of the latter case. In figure 25, a bent pipe is represented, which cannot well be moulded in sand, and for which

Fig. 25.



a loam-core is to be made in every instance. It may be moulded in sand or in loam. This pipe forming a knee, is bent in such a way as to make the moulding over a wood pattern and in sand almost out of the question. The first step taken is to make a drawing of the actual size of the object upon a board, and in drawing two or three sections of it, giving sufficient length for the core-prints. This board is given to the blacksmith, and one or more bars of iron bent in the shape of the core, and these bars united to form the core-iron. If the pipe is more than eight inches in diameter, these bars are to be laid around small rings, forming in this way an open channel in the centre of the core. These iron bars are covered with hay-rope as usual, and then by loam, which latter is laid on by hand, referring repeatedly to the drawing. The last loam coating is thin and well smoothed off, before the parting-blackwash is given. In such cases as this, it is all important to have the flanges at the right distance and in correct angles; and as such castings generally are designed to fill a space or form a connexion between two pipes, it is necessary to form a skeleton pipe of two boards, of which each fits to the flange of the corresponding pipe. Such a skeleton is easily formed by nailing boards together in

that place where the pipe is to be. Figure 26 will show how it is performed. The boards are fitted and nailed together, stayed by some lath, and the place of the flanges marked by scribing around them. Over

Fig. 26.



this another skeleton of boards is made, so as to have the dimensions of the pipe inside which are here outside, with the addition of one-eighth of an inch for each foot in the length of the pipe, for shrinkage. In this latter skeleton the inner diameter of the pipes is marked and cut out, the newly made core laid in this board skeleton, in the exact position in which the new pipe is to be attached to the other pipes. The core is fastened in this position to the skeleton, and the "thickness," which of course includes the flanges, is laid on the core, and gently dried. When the thickness is so far dried as to be secure against warping, it is removed from the skeleton boards, dried, blackened, and the cope put on. If the pipe

is heavy the cope is to be fastened with iron, taking care to have the parting free. Moulds for light pipes may be secured by a succession of wire fastenings which are laid at certain distances around the cope. The parting of the cope is done as usual, by cutting two grooves along the pipe in such a direction as to divide the cope into two halves, but so that each half may be lifted off the core. If the flanges or the thickness break off in removing the cope there is no harm done, if the core is not damaged in this operation. After the usual finish of the facing, the mould may be put together, and rammed in sand as usual. In this case the core cannot be kept in its place without chaplets, and a liberal number of them is to be distributed between the core and the cope. This pipe is rammed in and cast in the usual manner.

When the object to be moulded presents more complicated forms than the one represented, the experience of the moulder must be his guide in forming the plan of the mould. Analogous processes are here everywhere, but it is the sagacity of the moulder which gives to the most complicated forms tangibility, which analyzes a pattern, and finds a mode of execution in cases where success at first sight appears to be impossible. If the form of a

pattern does not happen to be divisible into two parts, or permit a mould of two parts, there is no objection to dividing it into three, four, and more parts, but it is a rule to make as few partings as possible. In every mould, it is to be a standard rule to provide liberally for the escape of the gases. If forms are to be moulded which require more than two platforms, there is no objection to taking as many as may secure the greatest advantage and security to the mould.

Oval Forms.—Oval, curved, or triangular forms must be traced by corresponding platform-plates, for no application of the spindle is possible in these cases. For example, to mould an oval bathing-tub, without a pattern, a foundation plate in the form of the upper side of the tub is cast in open sand. There is no need of its being solid—it may be an oval ring. Figure 27 represents the

Fig. 27.



moulding of such a tub. The loam-board A is guided by hand around the platform, and if kept in close

contact with the edge of the plate, there is no difficulty in obtaining a correct mould. If there are any projections, or departures from the regular form, they are made by hand. Curved forms are made in a way similar to the above. A core, or a mould to an elbow pipe, is moulded on a platform which has the form of the curved pipe, as shown in figure 28.

Fig. 28.




The loam-board A can make only the current part of the mould, also a mouth or bell-shaped widening; but if there are any flanges, for these a wood pattern is to be made. In this instance two halves of a pipe-core are made; and these joined by moist loam and wire. In most instances of this kind a wood pattern of the object is made, and this moulded in sand; but as the core of such forms cannot well be moulded in sand, it is made in loam and applied in the usual way. Square forms of objects which are to be moulded without patterns, are made in a similar

manner as those of an oval or irregular form; such moulds, however, require more strength than the moulds of round forms, for the pressure of the fluid metal upon a plain surface, tends to drive the core and mould apart, with more energy than it does in round forms. To guard against this pressure in flat or straight forms, is an object which requires some judgment on the part of the moulder.

If complicated forms are to be moulded, the best plan always is, first to make a pattern in wood of the object. Even if the pattern is not used in moulding directly, it is of great service to the moulder, in having a form to imitate, which is more plastic to his mind than a mere drawing. All heavy and complicated castings, such as heavy bed-plates for steam engines, housings, and rollers for iron works, are moulded in loam, if good work is expected. The heat and pressure of a mass of hot iron like that poured into the mould for the bed-plate for the engines of the Collins Atlantic steamers, being forty tons or more, will destroy any sand mould, no matter how carefully made. Complicated forms of this kind are partly made to drawings and partly over wood or metallic patterns. We will illustrate this subject by an instance which is not complicated, but sufficiently so to show the principle upon which

a mould of this kind is constructed. In figure 29 a screw-propeller is shown, such as are now frequently used to propel steamboats. These propellers are cast in iron, copper, brass, or bronze; this, however, does not cause an essential difference to be made in constructing the mould. The four wings of this

Fig. 29.

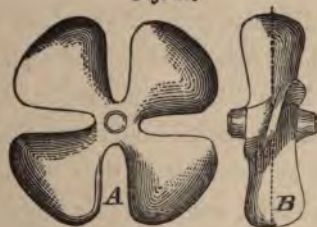

pattern are twisted as shown in B. It is advisable to make a wood pattern of this propeller, dividing it at the dotted line in B into two halves. An experienced moulder will prefer to make the mould by hand, but generally the pattern is buried in the loam, and kept there until the mould is nearly dry. There is little difficulty in moulding this object in the latter way. As the pattern is divided, the one half is moulded upon an iron platform, the larger spaces filled by brick, and over these the usual coating of loam. The four wings of the pattern are fastened by wood-screws to the nave, which may be

drawn and the pattern removed in parts; this forms the lower part of the mould. The other half of the pattern is moulded in parts, upon quadrant plates, with its dividing side downwards. The mould of this half is taken apart, each quarter resting upon its quadrant platform. These four quarters are set upon the first half of the mould which is whole, and has a solid platform. The edges of the four wings or paddles are generally sharpened out, so that there is little difficulty in hitting the thickness of the paddles. A better mould than that described may be made by hand; it is then divided into two halves as the above, but it affords a better opportunity of having the facings of the mould correct and uniform in texture. Many screw-propellers are moulded by dividing the pattern at the nave, and making a cope over each paddle, which is fitted and fastened to the cope of the nave. The first way of moulding is preferable to the latter; it is perfectly safe, and makes a more correct and smooth casting.

Moulding of Bronze Ornaments.—The art of casting bronze statues has been traced to remote antiquity, and, to all appearance, the ancients were more skilful than the moderns in this art. Bronze statues were so plentiful in Greece at the time of Alexander the Great, that Pliny calls them the moh

of Alexander. It is recorded that the Romans found 3000 bronze statues in Athens, and as many in Rhodes. The Temple of Solomon was adorned with heavy and richly ornamented bronze castings. The pillars of Jachin and Boaz at the portal were of bronze; the molten sea of the priests to wash in, was cast of bronze, and the metal basins at the entrance were of the same metal. The world-renowned Colossus of Rhodes was a bronze statue of 130 feet high; it was broken by an earthquake fifty-six years after its erection, and its remains lay scattered over the ground for nearly nine hundred years, when they were sold by a king to a Jew, who carried at that time 360 tons of metal away. More recently, in the middle ages, bronze was extensively used for doors and gates of churches and cities. The doors at the Battisterio in Florence were of such exquisite workmanship, that Michael Angelo, the great architect of St. Peter's at Rome, declared that these gates were worthy to be the gates of heaven. More recently, in our own times, this beautiful art has been degraded to the manufacture of implements of war, and in other cases to celebrate the memory of military heroes—an application no better than the other. The ancients were not acquainted with a definite alloy, to make their bronze

castings of. Their mixtures were accidental; but we will speak of this hereafter.

Moulding of Statues.—The mode of forming the moulds for bronze castings of large size, as statues and bas-reliefs, was never reduced to a systematic art. There is satisfactory evidence to show that the knowledge of this art lay dormant for centuries. The ancient Greeks were the most skilful in the execution of statues of this kind, not only so far as form is concerned, but also in their preparation of the moulds and the casting of the statue. Their plan of making a mould, was to make a skeleton of plastic clay, which was to form the core. This skeleton was kept wet—just as the sculptors of the present day mould a figure in clay—and made into an exact mould of the figure to be produced. Over this wet clay pattern the cope was made, and so far dried as to admit of removal, after which core and cope were finally dried and burned. The space resulting from the shrinking of the core, formed here the thickness for the metal. The way in which such a mould was made is an evidence of the high skill of the artists of that time; for in case the casting fails, all the labour of the artist and the moulder is lost, for pattern and mould are destroyed at each cast. It requires

great experience and skill to succeed in this mode of casting statues and larger ornaments.

French Mode of Moulding Statues.—A more safe, but very expensive plan of making moulds, was practised in the seventeenth and eighteenth centuries. The pattern for larger statues was made of plaster of paris, instead of clay, because the latter shrinks a great deal in large masses. This plaster was laid on and fastened to a skeleton of iron. Over this pattern, which might be either an original or a pattern at hand, a cast of plaster is made, and this plaster mould divided so as to remove it conveniently. Over parts of this plaster mould coats of wax are laid, which form the "thickness." The wax is a compound of six parts of wax and one of white pitch, with which a little tallow or oil is mixed. The plaster mould receives a film of oil before the wax is put on, and the first coating of wax is laid on warm by means of a paint brush. A skeleton of iron bars is now made, composed of heavy and small iron, also iron wire and wire gauze, having, as near as possible, the form of the object to be cast. The segments of wax are fastened to this iron skeleton, and finally the whole surrounded by the plaster cope. Into this hollow mould, which is composed of the cope of plaster, a thickness of wax, and an iron

skeleton in the interior, the cement forming the core is cast. This cement is composed of two parts of plaster of paris, and one of brick-dust, or ground bricks, cast through an opening made in a convenient place as high as possible on the mould. When this core is hardened, which takes but a short time, the plaster cope is removed, the damages in the wax mould repaired, and a number of small gits for conducting the metal, and other gates for letting out the gases, are fastened around the figure. These gates are made of wax, from half an inch to one inch thick, and fastened to the figure in such places where the least injury will be done. None are to be on the face, hands, or other delicate parts. Small wire is used to keep these gates in their places. The final cope is then made in the usual way of sand-loam, mixed with cow-hair, or horse-dung. The first coating on the wax figure, however, consists of finely ground brick-dust, mixed with the white of egg or glue, forming a kind of paint. This is painted twenty times and more over the pattern. After this first coat follows a coating of hair-loam, and finally horse-dung loam. This loam-cope is to be provided with iron fastenings, and at last receives a brick enclosure, which is also secured by iron binders. Below and around this mould fire-places are erected,

which are so distributed as, when fire is made in them, to make the mould uniformly warm outside and inside, and heat it to an almost red heat. The wax forming the thickness is the first that flows out, and leaves a space in the mould of the same thickness as the cast is to be. The quantity of metal needed to fill the mould is exactly that space occupied by the wax. This process of moulding is complicated, but it is safe and insures good castings. It has the advantage over the Grecian mode, that the original pattern, the plaster cope, is never lost.

By skill and dexterity the artist may shorten the above process. One way is to build the plaster cope directly over the iron skeleton for the core, cast the mould full of core-cement, remove the plaster cope, and shave the "thickness" off the core. Then put the plaster cope again around this core, and cast the thickness space full of wax. Over this wax cast, the loam cope is made, as described above.

At the present time there is no settled system in the casting of bronze statues: the artists follow their own individual inclinations and experience. In many instances cores are built up first, covered by hand with loam, and burned; then the wax is put on, and the pattern made upon the core; over this pattern the loam cope is moulded, the wax melted out, and

the mould filled with metal in the usual way. In this way the pattern is lost. In other cases they make a core as above, cover it by wax plates made in the plaster mould, and proceed as described before. All the difference from that described in the past pages is here the making of the core, which, if made in the latter way, is more perfect, and more certain to secure success.

Iron Statues require more metal than bronze statues, and also strongly burnt moulds. Here the core is built up first, and the "thickness" laid on in fine clay. The pattern is made by the sculptor upon the core. The cope is made and divided as in common loam-moulding, the thickness removed, and the mould put together with that caution required to make the operation successful. The pattern of course is lost, and if the casting fails it is to be made anew. A mould over a pattern at hand, may be made over that pattern, but the core is to be made by hand. In all cases core as well as cope are to be well provided with iron stays, and chaplets, and are to be perfectly dry. If such cautions are taken, there will be no failure in casting.

Bas-reliefs.—Flat bronze castings, as ornamented pannels, facings, and single ornaments, are cast in the usual way in iron flasks, in new sand, and dried.

If the patterns are too complicated, or underworked, so as to make many cores necessary, the facing of the mould is made in fine strong sand, entirely composed of cores, and over these cores, as a parting, the whole of the cores are covered with common moulding sand and dried all together. The parting between the cores and the sand is made by common parting-sand. To avoid the division of the mould, the patterns are frequently cut in such places and directions as to remove the pattern in parts. This latter mode of moulding, because it is the cheapest, is practised in the manufacture of articles which are in common use.

Moulding of Bells.—Small bells are generally moulded in sand, from a metal or wood pattern, and the sand mould is dried in a stove, as before described. We shall give no description of the manufacture of small bells, to which class bells of from one hundred to two hundred pounds' weight belong, but confine ourselves to a description of the moulding of the larger kinds. The most important part of this art, is the construction or the form of the bell. Another equally interesting is the composition of bell-metal. In this place we shall only speak of the moulding of a large bell. In figure 80, a mould is represented as it is sunk in the pit

for casting. There is no essential difference between moulding a bell and a cast-iron kettle. The core is built in brick upon an iron platform, which is to

Fig. 30.



have snugs, in case the mould is made above ground. This brick core is covered with three-fourths of an inch or one inch thick of hair-loam, and the last surface-washing is given by a finely ground composition of clay and brick-dust. This latter is mixed with an extract of horse-dung, to which is added a little sal-ammonia. Upon the core the "thickness" is laid in loam-sand, but the thickness is again washed with fine clay to give it a smooth surface. Ornaments which have been previously moulded, either in wax, wood, or metal, are now pasted on by means of wax, glue, or any other kind of cement. If the ornaments are of such a nature as to prevent the lifting of the cope without them—for the cope cannot be divided—the ornaments are fastened to

the thickness by tallow, or a mixture of tallow and wax. A little heat given to the mould will melt the tallow, after which the ornaments adhere to the cope, from which they may be removed when the cope is lifted off the core. The thickness is to be well polished; and, as no coal can be used for parting, the whole is slightly dusted over with wood-ashes. The parting between the core and the thickness is also made with ashes. The cope is laid on at first by means of a paint-brush, the paint consisting of clay and ground bricks, made thin by horse-dung water. This coating is to be thin and fine; upon it hair-loam, and finally straw-loam is laid.

The crown of the bell is moulded over a wood pattern, after the spindle is removed. The iron or steel staple for the hammer is set in the core, into the hollow left by the spindle. It projects into the thickness, so as to be cast into the metal. The facing of the mould ought to be finished when the cope is lifted off. Small defects may occur, and are, if not very large, left as they are; the excess of metal in those places is chiselled off after the bell is cast. All that can be done in polishing the facing of the mould is to give it a uniform dusting of ashes. When the mould is perfectly dry, it is put together for casting. The core may be filled with sand, if

preferred, but there is no harm done if it is left open; for bell-metal does not generate much gas, and there is no danger of an explosion. The cope is in some measure secured by iron, but its chief security is in the strong, well rammed sand of the pit. The cast-gate is on the top of the bell, either on the crown, or, if the latter is ornamented, on one side of it. Flow-gates are of no use here, the metal is to be clean before it enters the mould: there is no danger of sillage.

Moulds consisting partly of loam or sand, and partly of metal, are in frequent use in iron foundries. Small car-wheels, boshes for cart-wheels, and car-wheels for mining establishments, receive their bore by being cast over an iron or steel core. Such a core-iron is a little tapered, to admit of its being freed from the casting by a smart stroke of the hammer. The casting is never left to cool entirely before the core is removed. It is generally removed when the casting is hot, but so far cooled as to resist the drawing out of the core-iron.

Chilled railroad-car wheels are another article where iron is employed as a part of the mould. The cast and chilled railroad wheels now in general use, are cast in a mould composed of green sand and iron. In figure 31 is shown a mould in which a chilled

wheel is cast. It consists of three boxes. The lower is a box of common round form, merely to hold the sand and give support to the centre core

Fig. 31.




and the middle box. The upper box is of a similar form, also round. The middle box is a solid ring cast of strong gray or mottled iron, and bored out upon a turning lathe, giving it the reverse of the exact form of the rim of the wheel. This middle box ought to be at least as heavy as the wheel is to be after casting, and it is preferable if it has two or three times that weight. All the three boxes are joined by ears and pins as usual, and the latter ought to fit well without being too tight. The chief difficulty in casting these chilled wheels is to make the cast of a uniform strain to prevent the wheels from breaking. Wheels with spokes or arms are very liable to this evil, and are to be cast with their hubs divided into three or more segments, which are afterwards banded by wrought-iron tires before fastening them to the car axles. At present, most

of these wheels are cast with corrugated discs or plates; in this way the hub may be cast solid, and the wheel is not so liable to be subjected to an unequal strain in the metal as when cast with spokes. In such plate-wheels the whole space between the rim and the hub is filled by metal, which, however, in most cases is not more than three-quarters of an inch or one inch thick. The rim of a good wheel is to be as hard as hardened steel at its periphery, but soft and gray in its central parts. The first requisite is more safely attained by having a heavy chill; but if the chill is too heavy, the inner parts are apt to suffer the cooling qualities of the chill. Success in this branch of founding depends very much on the quality of the iron of which the wheels are cast; but of this we shall speak again in another place. Soon after casting such wheels it is advisable to open the mould, and remove the sand from the central parts, so as to make it cool faster; this precaution saves many castings, not only in this particular case, but in many other instances. Uniformity in cooling is as necessary to success as good moulding. The thinnest parts of castings which cool first, will invariably break; but if a casting cools uniformly, there is no danger of strain in the metal.

Chilled Rollers.—One of the most important cases

of this kind of moulding and casting in iron moulds, is the casting of chilled rollers. There are some good chilled rollers manufactured in the Western foundries, particularly at Pittsburgh. We will not allude to any particular case, but describe the process of making chilled rollers, generally. The mould for a chilled roller consists of three parts, as shown in figure 32. The lower box of iron or wood is

Fig. 32.

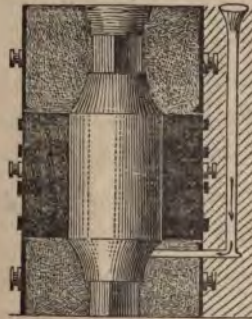


filled with "new sand" or a cement, a strong composition of clay and sand, in which a wood pattern is moulded which forms the coupling and the neck of the roller. The middle part of the mould is the chill, a heavy iron cylinder well bored. The upper part of the mould consists again of a box, but is higher than the lower box, so as to make room for the head in which the impurities of the iron, "sullage,"

are to be gathered. The two boxes with their contents of sand are to be well dried. In many establishments the two ends of the roller are moulded in loam, over the chill, to secure concentricity of roller and coupling; but this can be quite as safely arrived at by fitting the ears and pins of the boxes well to the chill. The chill is the important part in this mould: it ought to be at least three times as heavy as the roller which is to be cast in it, and provided with wrought-iron hoops to prevent its falling to pieces, for it will invariably crack if not made of very strong cast iron. The iron of which a chill is cast is to be strong, fine-grained, and not too gray. Gray iron is too bad a conductor of heat; it is liable to melt with the cast. Iron that makes a good roller will make a good chill. The facing of the mould is blackened like any other mould, but the blackening is to be stronger than in other cases, to resist more the abrasive motion of the fluid metal. The chill is blackened with a thin coating of very fine black-lead, mixed with the purest kind of clay; this coating is to be very thin, or it will scale off before it is of service. The most important point in making chilled rollers is the mode of casting them, and the quality of iron used. Of the latter we shall speak in another place. To cast a roller, whether a

chilled roller or any other, from above, would cause a failure, for the roller will be useless. All rollers are to be cast from below. It is not sufficient to conduct the iron in below; there is a particular way in which the best roller may be cast, for almost every kind of iron. The general mode is represented in figure 33, which shows the upper

Fig. 33.

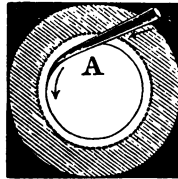

side of the lower box. In A is represented the cast-gate and channel, as it is seen from above. The gate is conducted to the lower journal of the roller, and its channel continues to a certain distance around it; it touches the mould in a tangential direction. In casting fluid metal in this gate the metal will assume a rotary motion around the axis of the roller, or, which is the same, the axis of the mould. This motion will carry all the heavy and pure iron towards the periphery or the face of the mould, and the sillage will concentrate in the centre. It is a bad plan to lead the current of hot iron upon the chill, for it would burn a hole into it,

and melt chill and roller in that place together. The gate must be in the lower box, in the sand or the loam-mould. The quality of the melted iron modifies in some measure the form of the gate, for stiff or cold iron requires a rapid circular motion, while fluid, thin iron is to have less motion, or it is liable to melt to the chill. The roller is kept in the mould until perfectly cool, but the cooling may be accelerated by digging up the sand around the chill.

Casting Iron to Steel.—One branch of moulding and casting we have to mention before we leave this subject: it is the casting together of iron and steel. At present many anvils, vices, and other articles are made of cast iron, mounted with steel, which are in a fair way of driving all the wrought iron articles of this kind out of the market. The welding together of steel and cast iron is not difficult, if the steel is not too refractory. This process will not succeed at all with German or shear steel, and hardly so with blistered steel, but it is easily performed with cast steel, by soldering it to cast iron by means of cast-iron filings and borax. Of the manufacture of these cast-iron articles with steel faces we can give but the outlines, having had no opportunity of becoming thoroughly acquainted with this branch. The cast-steel plates to be welded to the faces

of anvils, are generally from a half to five-eighths of an inch thick, and as wide as the face itself. These are ground or filed white on one side, and then covered on that side with a coating of calcined borax. The plate, with the borax on it, is heated gently until the borax melts, which covers it with a fusible transparent glaze. The plate in this condition is laid quite hot in the mould, which latter is made of dry and strong sand. The iron is poured in and rises from below; the steel plate being the lowest part of the mould, it will have the hottest iron. The heat to be given to the iron will depend in some measure on the quality of the steel; shear steel requires hotter iron than cast steel. The cast iron used for these purposes, is to be strong and gray, but not too gray, or the union of the iron and steel is not strong. White cast iron will not answer in this case, partly because the casting would be too weak, but chiefly because the cast iron would fly or crack, in hardening the steel. The hardening is done under a considerable heat, with an access of water falling from an elevation of ten feet or more.

Moulds for Lead, Tin, &c. &c.—Besides these moulds of sand, loam, and partly iron, there are moulds which are entirely constructed of metal, either of iron, copper, brass, or bronze. Such

154 MOULDER'S AND FOUNDER'S POCKET GUIDE.

moulds are used for casting tin, lead, pewter, Britannia metal, zinc, types, and other articles of economy and ornament. Brass or bronze moulds are generally preferred to iron moulds, because they do not corrode as iron moulds do, and retain a more perfect polish. Such moulds are constructed on the same principle as sand or loam-moulds. If a metal mould is divided into two, three, or more parts, each part is provided with a handle sufficiently long to protect the hands against the heat of the mould. The parts of such a mould must be nicely fitted together, and kept in their position by ears and pins, or in many instances by wedges. The mould is gently heated before any metal is poured into it, to secure the filling of the space in the mould, for many of the most fusible metals and alloys cannot lose much heat from melting to congealing. The moulds must be well polished after each cast, and are then rubbed over with a rag containing oil or tallow, and which spreads a thin film of oil or tallow over the facing of the mould. In many cases a covering or film of pounce-powder—sandarach—beaten up with the white of an egg, is preferred, particularly for alloys. Single metals work better with oil or fat.

Moulds for Copper and Brass, if it is intended to

make sheets of these metals, are for the first metal simply cast-iron boxes, in which the iron is from one and a half to two inches thick. These boxes are formed so as to be taken apart, for the copper will adhere to the iron if it is very hot. These iron moulds are to be very clean, or the cast of copper, which is from two to three inches thick, is apt to have holes, which makes it useless for sheets. Brass may be cast in the same way as copper, but it is more safe to cast brass plates for sheets between two stone-plates. These stones may be of granite, freestone, or any other kind of hard fine-grained quartz stone. They are to be from six to twelve inches thick, and secured against falling to pieces, in case they crack, by iron hoops. The space between the stones for making the thickness, is formed by iron rods. Such a mould is to be in the sweep of a strong crane, and is in the whole a somewhat complicated operation, foreign to our subject.

Stereotyping.—*Plaster of Paris* moulds are used for many articles cast of fusible metal, but particularly for stereotyping plates used in printing books. Fine plaster of paris is first cast over a page of letter composition, and this thin coating strengthened by coarse plaster. This plaster mould is dried at a boiling heat in appropriate stoves, and then dipped

in a kettle filled with melted type metal. When the mould is cooled the plaster is broken off, and, according to the skill of the operator, a more or less true copy of the letters which served as a pattern is obtained.

There was a kind of stereotype process formerly practised, which deserves, on account of the principles involved, not to be forgotten. Before the invention of the present mode of casting stereotypes under the influence of pressure in a metallic bath, they were made simply by pressing the pattern,—which might be a wood cut, or a composed form,—upon the liquid metal, just when at the point of congelation. It was a process which required skill and dexterity, but made better casts than the present mode of stereotyping. The fine stereotyped prints made at the end of the last and the first part of this century were stereotyped in this way. The beautiful stereotypes of Firmin Didot in Paris were done in this manner. The metal used for making the mould was lead with a little tin; this was melted and cast in a paper-box as large as the cast was to be. The fluid metal was but one-eighth of an inch thick and resting upon a level table, cooled very uniformly. The moment when the metal was going to crystallize (assume its solid form) was the time to

put the wood engraving or form of types down upon it, with a certain force. This process, performed with skill, made better and more correct impressions than the present plaster of paris mould. This first or lead impression served as a mould for the next cast. The next cast was made of type metal, or an alloy still more fusible. This metal was cast like the first, in a low paper box, and the moment when it was going to congeal, the lead mould was with force put down upon it. This latter cast was the true copy of the pattern. The paper boxes were surrounded by a screen of sheet iron, to protect the operator against the flying hot metal. The thin film of oxide, covering the melted metal, was the means of preventing the adherence of one metal to the other. Machines have been in operation to perfect this process, and make it less dependent upon the operator; still, the present mode of casting stereotypes has prevailed over the old method, as it is supposed to be more advantageous. If there is no advantage in stereotyping letter-press in the old way, it is certain that engravings are made more perfect in that manner. The composition of the metal for this art, may be varied from the melting point of lead to the melting of an alloy which requires but the boiling heat of water.

Impressions and Castings.—Before we proceed to the consideration of metals, we will speak of some interesting operations connected with the fine arts. We allude here only to relief impressions, not to those in ink or colours. The materials in which impressions may be made, are wax, paper, whalebone, horn, glass, sulphur, and many other materials to be mentioned in the course of this chapter. Impressions are made in many materials, and a variety of operations in the useful arts depend upon this manipulation. The operations in the mint, and stamping of medals and utensils, as spoons, forks, and pans, are parts of this branch of art; reliefs in copper, brass, and silver sheets, the pressing of wooden snuff or other boxes, of handles for canes and umbrellas, of leather, cloth, and paper, all belong to a different branch from that we are investigating. Most of this work is performed by stamping-machines and dies, where the relief part of the die is stationary, and the counterpart or intaglio moveable. Some of these operations are closely connected with our art, and for these reasons we will describe a few of them. Impressions of small objects are easily taken: the difficulty in making large impressions increases rapidly with the size of the impression. The use of impressions in this case, is

to obtain moulds from patterns which will not bear a cast or mould, as coins, gems, &c.

Wax is one of the best materials to take impressions with; yellow wax is particularly qualified for this purpose. Before using it, it is to be gently warmed and worked between the fingers, after which it is more uniform in composition, less adherent to other matter, and stronger in itself. The only objection to it is, that it is not very durable, and is to be kept with caution to save the sharp impressions of the original. Such impressions in wax are made where the original pattern will not bear heat or water. Their use is to make plaster coats over them, and prepare the plaster cast for patterns to be moulded in sand.

Bread in crumbs, is another material for taking impressions. If this is well worked between the fingers before the impression is taken, it can be dried without cracking, and casts of sulphur, plaster, or other matter may be made in it with success.

Impressions in *sealing-wax* can only be made in cases where the pattern is not liable to injury from the heat of melted sealing-wax. In this operation sealing-wax of the best quality is required; it is to be melted in a thin layer in a metallic capsule over the flame of a lamp, and the pattern, as lapidary or seals, is impressed upon it when near the point of

congelation. Impressions in sealing-wax are very useful for taking casts in clay or plaster, and if enclosed in a metal capsule they may be moulded in sand. The melted wax must be free of blisters, and the pattern which gives the impression very clean.

Sulphur, is a material very useful in taking impressions, but it is somewhat difficult to succeed with it. There are two ways in which it can be done: we will mention both. If sulphur is melted to nearly its boiling point, it assumes a pasty appearance. If in this condition it is quickly cast into a large vessel of cold water, it will retain that pasty form. The detached parts may be united under water, without injury to the condition of the sulphur. This putty sulphur will take fine impressions, and regain in a few days its natural hardness. A less difficult operation is the following. In melting sulphur it first assumes a watery appearance, is clear and liquid, but by increased heat becomes brown and tough, and at last it burns with a blue flame. In this state it is cast upon a plate, where, in gradually cooling, it becomes liquid, and after this congeals all at once. When the sulphur is just beginning to harden, the pattern is pressed firmly upon it, and a good sharp impression is thus obtained.

Glass impressions are very durable, but are not so easily made. To copy a coin, cameo, or medal in glass, an iron welded ring about a half or three-fourths of an inch high, a little larger than the pattern, is laid around it. In this iron ring upon the pattern, damp tripoli of Corfu,—other kinds of rotten stone cannot be recommended, because the chemical composition of this tripoli is the chief condition of success—is rammed on just as in sand moulding. The facing is to be the finest part of the tripoli, and worked through a fine silk sieve. When the pattern is removed, this mould is at first gently dried and gradually exposed to a stronger heat, to expel every particle of moisture. Upon the face of this mould a round piece of fusible glass is laid a little larger than the pattern, and the whole exposed to the heat of a cupola or muffle, such as assayers use for refining and assaying. The glass will soften by degrees and fill the mould, the refractory character of the silicious tripoli preventing it from melting together with it. Coloured impressions may be made simply by melting the coloured glass first down into those parts which are to be coloured, and then covering the whole with such glass as we intend the body of the impression to consist of. This latter process, however, requires two moulds, and two opera-

tions; the first mould makes but one colour of glass, which is to be ground on its reverse, before the second or body plate can be melted to it. The glass used in this art is that of which pastes or artificial gems and precious stones are made.

Clay is an excellent material for taking impressions, but its shrinking, and consequent cracking, make it less useful as a material for taking impressions. It is most extensively employed as a means of raising ornaments upon porcelain. If coloured ornaments are wanted, the white clay is coloured by a fire-proof colour, pressed into a bronze mould, made flush with the mould by a bone spatula. The ground mass is laid over it, to which it will adhere. The contraction incident to clay impressions may be brought to useful account. By repeated moulding and drying a diminution of the original pattern may be obtained, true in all particulars, but somewhat less sharp.

Artificial-wood impressions may be made by mixing saw-dust with a solution of glue 5 parts and isinglass 1 part. The moulds for this mass may be made of metal, wood, sulphur, or even plaster of paris, covered with a film of oil. The mass is pressed into the mould by hand. Impressions of this kind are never sharp, but answer for many purposes.

instead of wood-carvings. They may be varnished and gilded like wood, but cannot be used in damp places. Saw-dust of willow, maple, gum, and similar kinds of wood, is preferable to that of hard wood, as mahogany, or pine wood. An addition of finely powdered chalk, rotten-stone, or fine sand, improves the sharpness of the impression. Clay does not answer in this composition, on account of its affinity for water.

Castings of other materials than metals are not extensively in use, but are of importance as means of making patterns.

Plaster of Paris is the most important in this range of materials. It is made by calcining pounded or ground gypsum gently in an oven: a common bake-oven is sufficient for a small quantity, for there is no other ingredient in the composition of the gypsum to be driven off but the water of crystallization. Too much heat deadens the plaster, and too little heat makes it work slow and absorb less water of crystallization. Plaster of paris exposed to atmospheric air loses its quality of hardening with water: gentle heat in an iron kettle and stirring, restores the lost capacity for water. To work successfully in plaster, experience and skill are required, but we

will try to give as good practical information as is in our power.

One of the first requisites to success in this work is a thorough acquaintance with the nature of the plaster. If the material is a strange one, it is advisable to calcine it in an iron kettle under repeated stirring to a red heat, or so far as the kettle will admit of, before running the risk of a cast. The quantity of water with which any kind of plaster will assume its greatest hardness, is to be tried by experiments. Some qualities absorb more water than others. The hardest casts are made with the least water, but it requires dexterity to make sharp castings of a stiff pasty plaster. The casts are also harder if warm water is used. To prevent large pores, and blisters in the cast, the solution is to be constantly stirred, and kept in motion until the plaster is hardened in the mould. The best plaster casts are made if a very thin solution is first spread over the face of the mould, and upon this, while wet yet, a stronger cast is made. This will unite strength and beauty in the same cast. Foreign matter ought not to be mixed with plaster: it invariably impairs the strength of the cast. If plaster is to be used for making patterns, one-third of slack-ed lime may be mixed with it. This keeps the plas-

ter for a long time in a pasty condition, and offers an opportunity to alter the form of it so long as it is in that state. A little lime mixed with pure plaster, makes it more useful for moulds, particularly where metals are to be cast in it. The best mixture for making moulds of plaster for metal, is to mix it with one-third of finely ground pumice-stone, and a little clay. All other admixtures to improve the hardness or strength of plaster are useless. The strongest casts are casts of fresh, well burnt plaster, which was not too thin when cast. A mould of plaster may be made over any pattern which is impervious to water; therefore all patterns which absorb water are to be covered by a varnish which excludes water. In varnishing a pattern the varnish is to be laid on thin, and uniform, not to mutilate the pattern, or fill up fine cavities. As an illustration of this subject, we will give a description of some practical cases. To cast a mould of a coin, or of a wood engraving, the pattern is first brushed over with oil or soap-water, and then laid on a level place upon a board or table. It is now surrounded with an enclosure of varnished pasteboard, tin-plate, or anything light and flexible, which is to be fastened tightly around the pattern. This is to project above the face of the pattern the proposed thickness of the plaster cast—if

it is higher there is no harm done. Plaster of paris is now mixed with an excess of water, in a common water pitcher, well stirred, and after remaining a moment at rest, the coarse plaster will settle at the bottom, and the finer portion be suspended in the water. The lighter part of this liquid is gently cast over the pattern, while the latter is constantly and gently struck, so as to settle the particles of plaster in the finest crevices of the pattern, and make air bubbles rise, which often pertinaciously adhere to the pattern. The coarse sediment of the plaster is thrown away, or saved and exposed to another fire before being used again. After five or ten minutes' standing, the fine plaster is settled in the mould, and clear water stands over it. This water is cast off as dry as possible, and some fresh plaster, mixed very stiff, is cast over the first thin facing to strengthen it. The first cast is made very thin merely to cover the pattern, for it will be too weak and porous for any practical purpose, even if cast thicker. The two casts will unite firmly, and form a useful whole, giving a very minute impression and being strong besides. Such a plaster mould is dried, to expel all the water from it, and may then be used to cast fusible metal, wax, or sulphur in. If this mould is to be used for making plaster casts, it is varnished

first, which is done by a gum-shellac varnish, or by soaking the mould in wax. The first is the preferable plan. The first coating or facing of plaster may be put on by a fine camel's-hair brush, but this way is not so sure of making perfect impressions as that described. There is a certain time for removing the cast from the pattern; if this is done too soon the cast is too soft, and will break, and if done too late it will adhere to the pattern. For small objects, and strong plaster, from ten to fifteen minutes is sufficient; for larger ones, from fifteen minutes to one hour will be required, before the cast can be separated from the pattern. The patterns are to be covered by a film of oil, as remarked before; this subject requires more attention than at first sight appears necessary. Pure oil is liable to fill the finer parts of the pattern and prevent the access of the plaster; it has, besides, the evil influence upon the cast that it prevents the hardening of it, and if, therefore, the cast is sharp at first, the least rubbing will abrade the facing, at least the finer parts of it. A solution of white hard soap brushed over the pattern is preferable, but if the pattern is not very well smoothed or well varnished, if of wood, the cast is apt to adhere to the pattern. In most cases a mixture of a strong solution of soap

and a little oil, is found to be the best parting material. Oil generally gives a colouring to the white plaster, white hard soap does not.

The Moulding of Statues in plaster of paris is not an object of general interest, and for this reason is hardly worth the pains of describing and reading an essay on it; but as it affords the best illustration of moulding busts and statues, we will give this subject more attention than we otherwise should do. There are three different ways of moulding a complicated statue. The first is to make the mould and the cast in parts, and screw or cement these parts together. This is an imperfect mode of forming statues, which never makes correct work, for it depends not only on the moulder, but also on the finisher who puts the parts of the statue together, how far the cast may be true to the original pattern. The parts of metal statues are screwed together; if plaster they are cemented together by plaster, and the joints smoothed. Statues of this kind are weak, nor can they be correct, as it is almost impossible to destroy all traces of the joints.

The second manner of forming statues is to cover the original with a thin coating of plaster, one-fourth to one-half of an inch thick, and paint this coat black,

giving it a very thin film of charcoal-powder, strengthened with glue, and over this coating a thick coat of gypsum, two or three and more inches thick, according to the size of the pattern. This is laid on with the trowel. When this last coat is sufficiently dry to admit working at it, the cope is divided by black chalk into so many parts as are necessary to secure the separation of the cope from the pattern. The moulder of course is to be well acquainted with the pattern, or he could not with any certainty mark the parting-lines on the cope, having no means of ascertaining and tracing the lines on the pattern. To make this operation less difficult, a part of the pattern may be left uncovered, say the back (of a statue); this makes the tracing of the partings more safe. The omitted part is covered in a second operation, where the joining is formed by that line, and those parts of the cope which enclosed the covered space. The partings are effected by cutting down with a chisel or saw through the cope to the black stratum, and breaking the first covering of the pattern. The black paint forms here a uniform stratum interlining the cope; it gives warning to the operator to stop cutting, for the pattern is near. This mode of operating is easy and safe, as it makes a good and correct mould; but the broken edges which form

the parting are very soon injured, and show unsightly joints on the casts. For plaster this method is imperfect, because it does not make many good casts. One cast may be made very correctly, but the following casts are not certain. The parts of the mould are held together by winding tape or twine around the mould.

The third plan of making a plaster mould is tedious and slow, but is the safest and most correct, and by good treatment of the mould may admit of sixty and more castings being made in it. The manner of forming such a mould is the following, which, with unimportant modifications, is practised in making moulds for metal casts. The surface of the pattern is marked by a lead pencil with such divisions as will secure the lifting of that part of the mould from off the pattern, as is enclosed by such marks. The operation of making the mould commences on a convenient place, by enclosing one division with fine plastic clay, and giving the borders towards the enclosed space that form which will cause the plaster to have the shape desired for that particular spot. The space enclosed by the clay is then filled by plaster, and when the latter is settled, and so far dried as to admit its removal, the clay enclosure is first removed. This leaves a part of the mould to

be made, or the plaster cast standing. This cast may be one, two, or three inches thick, according to circumstances, it being the object to equalize the surface of the mould, so as to have less abrupt reliefs. This first part of the mould is taken off the pattern, and the edges cut smooth by a knife. The taper of the edges is so calculated as to form the joints of an arch, so that when all parts of the mould are laid together without the pattern, no part of it can move or fall off from the others. To secure the relations of the parts of the mould still more perfectly, each part is provided with warts in the joints, fitting into opposite hollows of the next part. These warts are made with the point of a knife, by turning it backward and forward, and are set in the middle of the joints, or in such places as are considered more convenient than the middle. When the first part is dressed, it is again put in its place, and one side of it joined by clay enclosures. If the space now to be covered is square, the plaster will form one side of it, and the three other sides are formed with clay. This second space is again filled by plaster, and it forms part No. 2 of the mould. One side of No. 2 fits to one side of No. 1, and three are to be dressed and provided with hollows for warts. In this way the whole pattern is covered

with small parts of the mould, which in many cases require fifty or more cores or parts. The last part of course is cast without any clay to form the enclosure, and is generally without warts to form the starting point in separating the mould. When the pattern is perfectly covered with this mould, the surface of the mould is dressed and cut smooth, to remove all sharp angles and abrupt reliefs. Over this first cope is made a second cope, but the first ought to be in such a condition that the second divides only into two, or at most into three parts. The divisions of the first cope of course fit exactly into the second, and if there is any doubt or danger that one of the parts of the first cope would fall out from the others in turning the mould, that part is to be provided with a wire staple to which a string is fastened. This string passes through the second cope and is secured outside. The second cope may also be provided with warts which fit in corresponding holes in the first cope, if found necessary, which, however, is not often the case. The whole mould, forming a comparatively heavy mass of plaster, is held together as in other cases by means of tape.

Large Plaster Castings are made hollow. This is done by casting first a small quantity of fine plaster in the mould, and in turning, the mould is led into

all parts of it, and gives a thin covering to the whole face of the mould. A second cast of coarse plaster follows the first soon after, and this is equally distributed over the mould. A succession of such casts will give any thickness desired. Parts which require extra strength are laid on by hand or the trowel. Statues and busts generally require no cast-gate, because they are open below and are cast from that side.

Patterns and moulds in which plaster casts are to be made, are coated with a film of oil or soap ; but valuable pieces of art, as marble statues or busts, do not admit of oil or soap without injury, and these means cannot be employed. In such cases the pattern is covered by tea-chest-tin or tin foil, but so as not to show the joints of the foil. The tin-foil is pressed on by a cloth-brush in such a manner as to secure the perfectly close covering in the undulations

The face of a living or dead person may be copied in plaster by making a plaster cast over the face. The limits of the mask are marked by laying a wet cloth around the face. The hair and eyebrows are covered by pasting some tin-foil over them. Living persons are to have two paper or tin-plate pipes in the nose, to admit of breathing while the plaster is put on the face. Such

masks are generally used as patterns for making busts of those persons from whom they are taken. The hair, ears, and the back part of the head, are to be supplied by the artist.

Sulphur is, next to plaster of paris, the most valuable material for sharp castings; but its application is limited to very small castings, on account of its brittleness. It can be cast over metals and many other materials without oil, and gives for these reasons very sharp impressions. Sulphur may be cast over a coin by surrounding the coin with a ring of paper; the melted sulphur will not kindle the paper if it has the proper heat. In melting sulphur for casting, it is not to be overheated; at first heat it melts to a transparent clear fluid, and that is the time to cast it. More heat transforms it into a pasty mass, which cannot be used. The kindling of the sulphur should be prevented, by all means, for it will impart a dirty gray colour to the sulphur. Sulphur may be mixed with foreign matter to augment its strength. One part of plaster of paris, and two of sulphur, improve the tenacity of sulphur without diminishing its capacity for fine impression. Next to the above, fine Spanish brown, fine chalk, or clay in powder, may be mixed with it. Three parts

of sulphur, and one of silver, is a good composition for sharp and durable impressions.

Wax in its pure state, as well as mixed with other matter, is a useful material for castings, but it shrinks considerably. It requires skill not to cast it too warm, or too cold. In the first case its castings will be defaced, in the latter they will not take sharp impressions. Wax may be mixed and successfully used with plumbago, cinnabar, white-lead, plaster of paris, and other substances. The mould wherein wax is to be cast, is to be very cold or wet, if the material admits of the absorption of moisture. When the face of the mould is covered by a thin coating of wax, the surplus fluid wax may be cast back into the ladle. A thin cast will not shrink so much as a thick cast.

Sealing-wax, isinglass, and glue, are also materials for making casts of, and are frequently used for small articles. There is one composition to which we have to allude more particularly; it is a composition used in making elastic moulds, for casting in plaster of paris—eight parts of glue, four parts of molasses, mixed and boiled together, and to this gradually added one part of varnish or boiled linseed-oil. This mass is cast hot over a pattern, and when cooled may be easily removed. It forms a gelatinous

mass, and makes an excellent mould for plaster casts, having the great advantage of admitting of under-carving the pattern. Such a mould will not make more than six or eight sharp casts; but as the making of the mould is no object, it is the cheapest and quickest way of forming a mould for casting plaster in.

Alum cautiously melted, so as not to expel its water of crystallization, will assume a very fluid appearance, and may be cast in small moulds with success. Thirty parts of alum and one of saltpetre is still better; it makes opaque castings of a beautiful white. Five parts of alum and one of common salt melted together, makes transparent sharp castings. Melted saltpetre by itself, may be cast in hot metallic moulds, and makes castings of a fine alabaster appearance.

Moulding Natural Objects.—A mould over an object of nature, as over a small animal, a flower, or leaves, may be made in the following way. The dead animal, say a fly, or a bug of any kind, is put with its feet upon a ring of wax, so as to place the feet and everything else in such a position as we want it in the cast. This wax ring will form the channel or gate for the fluid metal. The object—animal or leaf—is painted with a very thin solution

of gum-shellac in alcohol; and, after being dried, is placed in a small pasteboard box, and so fixed by means of small wires as to secure it in a permanent position. These wires, after being withdrawn, form air channels through the mould. A small tapered pin of wood is fastened in some convenient place for making a cast-gate. A mixture of three parts of fine plaster of paris, and one part of fine brick-dust, formed by an adequate amount of water, to which a little alum and an equal portion of sal-ammonia is added, into a thin pap, is now gently cast over the pattern, under continued shaking of the mould, or if that cannot be done because the pattern is too delicate, the pattern may be first covered by means of a fine camel's-hair brush, with a thin coating of the above mixture, and then the remainder cast over it. When this cast is hardened, the pasteboard enclosure is removed, and the cast gently but very strongly dried. After all the water is expelled, the mould is brought slowly and gradually to a cherry-red heat, to expel and burn all the animal and vegetable matter. A mould of pure plaster would not resist such a heat without falling to pieces, but an addition of brick-dust and alum gives it that resistance to heat which is needed. The sal-ammonia is added to facilitate the destruction of the natural pattern, the animal or plant. The

cooling of the burnt mould is to be performed equally as slowly as the burning itself, to prevent its breaking. In the cooled mould some mercury is cast and gently shaken. By gradually adding more quicksilver, the remains of the pattern which may be left in the mould will float on the mercury, and may be brought out. By repeating the latter operation, all impurities may be effectually removed. Before casting any metal in this mould it ought to be heated to a certain degree, which degree will depend in some measure on the mass of the pattern, and the metal to be cast in it. Very thin fine patterns, and metals which congeal quickly, require a hotter mould than the reverse qualities. Silver is the best qualified for such casts: after this, type metal, tin-solder, and fusible alloys. A cast made in this way may be prepared to form a pattern for the current business of the foundry. If the mould has been hot and the metal also, the casts are generally so perfect as to show the finest nerves of the pattern. Larger objects may be moulded quite as successfully as small ones, but it requires more experience to succeed as well.

CHAPTER II

FOUNDING.

MELTING OF METALS.

Iron.—It is impossible to qualify the various kinds of pig-iron brought into the market by local terms and marks. It would, after all, not be of any use, because the produce of one and the same furnace may change in one week's time from No. 1 iron to No. 2 or even No. 3, which certainly makes a great difference in its application in the foundry. There are, however, distinctions in the quality of iron caused by the ore, or by the fuel which has been used in its manufacture, as charcoal or anthracite; as well as by manipulation. We will allude to these local and practical differences when pointing out the specific qualities of metal for certain purposes, and confine our demonstrations at present to general remarks. Taking no notice of the difference between charcoal, anthracite, and coke or stone-coal iron, we have three distinct qualities, known as No. 1, No. 2, and No. 3 iron.

No. 1, or Dark Gray Pig-Iron, is the foundry iron.

This pig-iron is, if anthracite and charcoal, mostly of a coarse-grained, apparently crystalline fracture. There are, however, no crystals; the form of the fracture is an aggregation of leaves. Iron, and the black graphite with which it is intermixed, appear to assume the same crystal form; they are so closely united that no distinction can be made of the difference in the form of the crystals, if there is any. Coke-pig, No. 1 stone-coal iron, and hot-blast iron, are generally finer in the grain than the above-mentioned qualities. Pennsylvania anthracite pig No. 1, and Pittsburgh or Hanging Rock No. 1, are generally very coarse and black in the grain fracture. Charcoal iron No. 1 from the Eastern States, Maryland, Allegheny river, and Ohio river, Tennessee and Kentucky, is generally hot-blast, and finer in the grain than the above. Scottish pig, is of a fine-grained fracture.

The pig-iron of this class is soft, and often tender: most of our own manufactured iron is strong. It melts very fluid, and cools very slowly, which qualifies it particularly for castings. This iron, if very gray, may be remelted once or twice, but the fine-grained kinds, and those which contain less carbon, or are exposed to too much fresh air in melting, turn into the following, or

No. 2 Iron.—This contains less carbon than the above, is more gray in appearance, and of a finer grain. If approaching near to No. 1, it is the best foundry iron, for it is stronger than No. 1. If this iron assumes a more gray colour, it is not qualified for small castings, but is very excellent for large castings in dry moulds. It melts fluid, fills the mould well, makes less sullage than No. 1, and does not burn the mould so much as the above. It is tenacious, may be filed, turned, planed, and polished; it is close, and more certain to be free from impurities than No. 1.

No. 3, is white pig-iron. By remelting No. 1 and No. 2 under the influence of a liberal access of air, they will be converted into No. 3. This iron is white, and most of it of a bright crystalline fracture. It is of no use in the foundry.

The quality of foundry-pig in our Atlantic cities, also in Pittsburgh, Cincinnati, and other cities along the western rivers, is no doubt of such perfection that there is no difficulty in making any quality and kind of castings in any of these places. There is hardly a limit to the variety of good foundry-pig in these markets. Some general remarks on the characteristics of pig-iron for foundry purposes will however be in place.

Dark Gray pig-iron, with large leaves of plumbago

is qualified for small castings, as hollow-ware and small machinery, but would not answer so well for heavy castings, which require strength. There are, however, exceptions to this rule. The pig-iron most useful for the very finest kind of castings, is to be fine-grained. Coarse-grained pig will not fill a fine mould, at least will give but dull impressions. If pig-iron contains a little phosphorus, it may be fine-grained and still be an excellent foundry iron, particularly for hollow-ware and stoves. Hollow-ware made of gray iron which contains much carbon or plumbago, is liable to cooking black; this evil is not so apparent where pig-iron of lighter colour, containing a little phosphorus, is used. Black iron is not qualified for large or heavy castings, as it is generally too spongy.

Hot-blast and cold-blast iron are simultaneously brought into the market, and the former is frequently sold for the latter. For foundry-pig it makes but little difference whether made with hot or cold-blast, and we may say, generally speaking, that hot-blast iron is preferable to cold-blast, because the grain is finer, the iron more uniform, and it runs more fluid than the latter. In anthracite and stone-coal pig there is but one kind, and that is hot-blast. A difference is often found in charcoal-pig, but then it

is generally marked cold or hot-blast, when made at an establishment of reputation. To distinguish cold-blast from hot-blast iron, is almost impossible. The only permanent difference is a finer grain in hot than in cold-blast, provided the amount of carbon in both kinds of iron is the same, and the iron is made from the same kind of ore. This mark of distinction is, however, very doubtful, and may lead to errors. A more certain criterion is the colour and lustre of the pig, in a fresh fracture. Provided all other things—as ore, coal, manufacture—are equal, the fracture of hot-blast iron is duller than that of cold-blast; the latter shows more life than the first, and a freshness of colour, which is not so clearly expressed in hot-blast iron. Hot-blast iron is frequently found to be of a fine grain, interspersed with clusters of coarse grains, the fine parts of a dull appearance. These distinctions of colour are a safer criterion than the size of the grain, but both together may afford some means of distinguishing between the two. It would be of little value to know whether a specimen of iron was smelted by hot or by cold-blast; but as the cold-blast iron contains less carbon and impurities, if of the same colour as hot-blast, and as a mixture of cold-blast and hot-blast iron

makes the strongest castings, it is desirable to have the two qualities separated.

The mixing of different kinds of iron is an object of considerable interest, and all foundries ought to make their own experiments to ascertain the strength of the material they are working. In making ornamental casts, strength is of secondary consideration, but in machinery, and beams for architecture, it is of the first importance. In foundries where machinery is cast, or water pipes or beams for bridges or architecture, there should be means of testing the strength of their cast-iron. The safest and best way of doing this, is to have a standard pattern, say a prism of two feet long, one inch thick, and two inches wide. This pattern is to be moulded in a particular flask, with uniformly dry sand, and cast inclined at a particular degree. The mixture of iron is made in a crucible melted in an air furnace. This trial or proof-bar is fastened with one end in a vice, and at the other end a platform is suspended, upon which so much weight is piled as to break the bar. In the mean time the deviation from the straight line, or from its original position, is measured. In this way the relative strength as well as the degree of elasticity may be measured, and the relations of the strength of one

mixture of iron to the other, decided on with great certainty. This is not to be considered a scientific experiment—it is a mere matter of local, practical interest. Under all conditions, a mixture of iron melted together is stronger than the average strength of the whole, each measured by itself. Hot-blast iron has the advantage of being of a more uniform texture than cold-blast iron, and being more firmly united with carbon. A mixture of hot-blast iron may therefore be made which supersedes any cold-blast iron, in respect to strength, provided hot and cold-blast are made of the same materials, and in the same manufactory. The kinds of pig-iron which are to be mixed together to form the strongest compound, are difficult to decide upon here. It depends very much upon the experience of the founder, and also on circumstances which are beyond his control. Few of our blast-furnaces have yet settled upon a definite quality and mixture of ore, shape of the furnace, and other matters which influence the quality of the iron smelted. So long as such matters are not definitely settled, no brand of pig-iron can be depended upon for its quality. In purchasing, the buyer is to depend upon his own experience and chance. If pig-iron is too gray, or too spongy, it may be improved by adding No. 3

iron, or in most cases scraps of old castings are preferable. Very black-gray iron will bear an addition of 30 per cent. of No. 3 pig or scrap. Iron which contains too little carbon is successfully improved by adding No. 1 until the wished-for strength and texture are obtained. In all cases iron from different furnaces ought to be mixed together, and if there is any possibility of obtaining iron from different localities and different ores, it is to be preferred. An anthracite pig of the Schuylkill region is stronger if some Scottish pig is added to it; charcoal iron from the State of New York, or from Baltimore, is still better for that purpose. The superior qualities of Ohio iron may be made still stronger by mixing it with some kinds of Allegheny or Tennessee iron. In all cases, however, it is better to mix No. 1 of one kind with No. 2 or No. 3, or scraps of another kind. And if possible, mix cold-blast with hot-blast iron. The strength of iron depends a great deal upon the mode of melting it, but we shall speak of this hereafter.

Besides the consideration of strength, economy in many instances decides the qualities of iron to be worked in a foundry. True economy, however, is that which secures the best castings, and gives most security in avoiding scraps. A mixture which

makes a close and compact soft gray iron, is the best in all these instances.

An important influence in mixing iron is due to the kind of casting, its size, and its purposes. Iron of which beams and rolls for iron mills are cast would make poor hollow-ware or ornaments, and iron which makes sharp impressions on small articles, is generally not qualified for heavy articles. Heavy machinery is best made of No. 2 anthracite iron, or a mixture of No. 1 anthracite, and No. 3 charcoal. The variety of anthracite iron is not indifferent in this question, for there is some very weak, also some very superior iron. Hanging Rock pig of good quality is no doubt the strongest cast iron in the world, and it would be an advantage to western enterprise if scientific experiments were made to decide the value in numbers of its superiority over other pig-iron. Small castings and ornamental castings require a fusible iron which coagulates soon and is not too gray, so as to assume sharp impressions. Iron containing a little phosphorus, being a little cold-short, is preferable for these purposes; that smelted of bog-ores is the proper kind for small castings. Railings and ornaments which require strength to resist sudden jerks, are to be cast of a fine-grained, pure iron, free from phosphorus or

any such admixture. Chilled rollers or chilled wheels require a very strong No. 2 iron, but it is preferable to make No. 2 of No. 1 and scraps or No. 3 charcoal. In hard rollers a little phosphorus does no harm, but in wheels any pig-iron made of bog-ore is to be rejected.

The kind of mould in which iron is cast has a decided influence upon the strength of the cast. Machine frames, beams, rollers, and all castings which require strength, are to be cast in dry sand or loam, for green sand will cool the cast too rapidly, and cause it to chill, or become hard and brittle. Castings which ought to have a good smooth surface, to be perfect, require a green-sand mould. A mould well dusted by blackening will make smooth and good-looking castings. Thin castings, that is, castings which soon cool, are always more smooth than those where heavy masses of metal are confined to a small space. Castings which require strength are to be cast upright, or at least inclined, having the cast-gate to enter from below, and a flow-gate at the highest part of the mould.

MELTING OF CAST IRON.

Iron in the Blast-Furnace.—Iron is in some few instances used directly from the blast-furnace to make castings of. It is done in those places where


fusible ores, as bog-ores and hematites, are smelted by charcoal in small blast-furnaces. There are but few establishments where this is practised; some are along the Atlantic sea-coast, a few in the interior of the Eastern States, and but very few in the Western States. The whole business done in this way does not amount to much. There is really no advantage in casting directly from the blast-furnace, for the iron is never of such uniform quality as to secure good castings. It is on the whole disadvantageous, and more expensive than remelting the cast iron, and giving it a proper quality by mixing it with other kinds of iron. There are, however, instances where casting from the blast-furnace is not only excusable but necessary. Where bog-ores are smelted which make cold-short iron, it is advisable to transform the iron directly from the blast-furnace into castings. Iron, cold-short of phosphorus, is generally not used in forges, and it has too little carbon to admit of remelting. There is hardly any other way left but to make castings of such iron. It is not qualified, however, for machine frames, or castings which ought to be strong. The only and best purpose it is adapted to, is for casting hollow-ware and stoves; it will form fine and sharp castings, and cooking pots made of such cold-short iron can

not be surpassed in quality. It makes enamel superfluous. The usual way of casting from the blast-furnace is to prepare a stopper of slag, just fitting in below the timp of the furnace. This stopper will separate the interior slag and that in the forehearth of the furnace, provided the stopper reaches down into the liquid iron, the blast at the furnace of course being stopped. The surface of the iron in the forehearth, after being cleared of its slag, is clear and will keep so, provided the stopper is thick enough and remains in its place. The iron is dipped, with dippers or ladles of cast or wrought iron, as far as this can be accomplished ; after this the stopper is removed, the cinder from the back of the hearth drawn forward, and the furnace put into blast again. A more perfect way of taking iron from the blast-furnace is to make a dip-pool in one of the tuyere arches, provided for that purpose, and where there is no blast-pipe. If the back arch, opposite the work arch, is chosen, the moulding and casting may be carried on very conveniently, without coming in contact with the smelter and his operations. A hole like a tap-hole is here pierced through the back stone, or one of the flanks of the hearth, down at the bottom or near the bottom, and around this hole a round basin is walled up in fire-brick, and well secu-

red in its place by iron binders. This basin need not be larger than to admit a ladle. The hole which puts this basin in connexion with the interior of the furnace-hearth is to be of such a height over the bottom of the hearth as to leave a cover of fluid iron always on it. This pool is filled with some burning charcoal to keep it warm, and as the iron rises in the hearth it will rise in the pool, from which the moulders may dip and take it at any time they choose. When the pool is once thoroughly hot, it requires no charcoal to keep it so.

In figure 34 are represented two ladles. The one is made of cast iron, the other of wrought iron. The latter is preferable for dipping, because there is less danger of its being burned. These ladles are covered with a thin coating of loam, indicated by the dotted lines. A, the cast-iron ladle, receives a

Fig. 34.

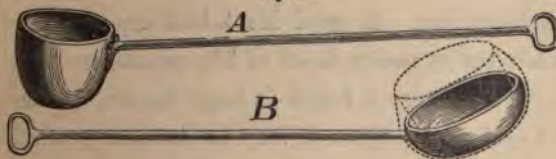


strong washing of loam; B, the wrought-iron one, forms merely the bottom to a clay ladle. The well worked clay is set upon the edge of the ladle and forms a

dipper as large as the moulder may choose it to have. The clay is put on every day, or every cast, anew, and it is to be well burned before it is dipped into the iron, or dangerous explosions may be the consequence of such neglect.

Melting Iron in Crucibles.—This mode of melting is not now practised, but it was formerly in use, and is still so for some particular purposes. All the fine iron castings, as trinkets and similar objects, are cast from crucibles. The iron melted in a crucible is very quiet, and generally not so hot as to burn the sand; it makes smoother and more solid castings than iron melted in a different way. Compositions of iron may be made and melted in a crucible, which would not retain their quality in any other mode of melting. The melting in crucibles is expensive, because of the cost of crucibles, coal, and labour; but there are instances where these are secondary considerations. A good black-lead crucible ought to last ten or twelve heats of fifty pounds each, and as the plumbago is found in large masses, is cheap, and coal is no object, it may be found a profitable way of making small castings for carpenters and knife-manufacturers. The air furnace for melting iron in crucibles is the same as that used for melting brass, bronze, and similar metals; it is represented

in figure 35. This figure explains itself; the furnace is put below ground to a chimney whose lower interior part is built of fire-brick, as well as the interior of the furnace. The furnace is covered by

Fig. 35.

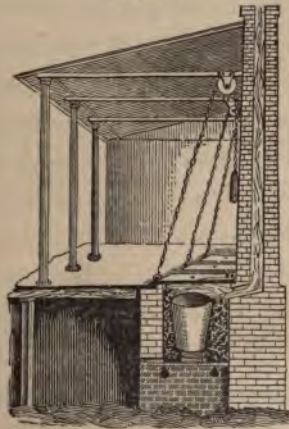

a cast-iron plate, a kind of trap-door, which is balanced by a weight and an iron chain passing over a roller; or in any other convenient way. The grate bars are simply square inch-rods of wrought or cast iron, and may be pulled out one after the other, to drop coal and cinders at once, or to clean the furnace. The crucible is set upon a piece of fire-brick which rests upon the grate. The bottom of a broken crucible inverted, is preferable to brick as a

sole-piece. The crucible is to be raised from three to six inches above the grate, according to the fuel employed. Charcoal requires the highest elevation, coke less, and anthracite the least. The best form for the furnace pit is a square: the four corners resulting from this arrangement are very useful to charge fresh fuel in, which, if the furnace is round, requires more room than can be advantageously given. The crucibles are to be perfectly dry before they are put in the furnace; the least moisture will destroy a crucible if not removed before exposing it to the heat of a furnace. The iron, or other metal, is to be heated before it is charged, and the fuel must be dry and warm, before being laid around the crucible. The mode of operation is simply as follows. The grate is put in the furnace, and upon it the brick-bat or broken crucible, which is to form the pedestal—sole-piece—of the crucible. The fire is then kindled and made to burn briskly, while the crucible and metal are heated on the door-plate. When the interior of the furnace is red hot, and the fuel burnt as low down as the sole-piece in the centre, the empty crucible is put upon it, and then the metal in pieces gradually charged, until the crucible is filled. When the metal is partially melted, there will be room for more, which is


piled upon the other, and the whole covered with a few scraps of glass, which, when melted, will form a film on the surface of the iron to protect it against the access of air. A moveable cover of crucible clay will serve the same purpose as glass, but it is more troublesome than the latter. In fifteen minutes the first portions of iron are melted, and the addition may be charged. In three-quarters of an hour the whole of the iron is melted, if properly attended to, and is ready for casting. The fuel is always kept as high as the crucible, and from the first somewhat higher, but the last fuel is given when the metal is not entirely melted, so as not to cool the fire after that by fresh fuel. The fuel is burned down at last so far as to free the crucible of it to a certain depth, and to admit the access of the tongs for removing the crucible. The tongs are made of strong bars of iron, three-quarters or seven eighths square, and and from four to six feet long, one end provided with prongs bent in such a manner as to form a basket to catch the crucible as low down as possible. These tongs are suspended in a chain and a crane, or, the chain very long and fastened to the ceiling of the building. The first operation is to move the crucible from the fire and at the same time put it into a pot-handle for casting. This handle is the

same as those on iron pots, to be described hereafter. It is to be heated previously, to prevent injury by cold to the crucible. Two men carry the crucible to the mould and cast, and return the crucible directly to the furnace, into which it is set without delay. Gradual charges of metal are now given, and the melting goes on as before. In case no more metal is to be melted, the crucible is put inversely in the fire to let it cool slowly. In all instances a hot crucible is to be put inversely in case it is set down anywhere; the heated bottom of a crucible never is to come in contact with anything colder than itself. Four or more furnaces may be put at one stack, and as many may be put in a row as is considered necessary. Charcoal may be used in these furnaces, coke is better, but the best fuel is anthracite coal. The danger from the latter is its being too severe upon the crucibles, on account of the great heat it evolves.

Melting in Reverberatory Furnaces.—The best melting furnaces on the large scale are the reverberatories. They are in use in some foundries where the proprietors are desirous of making good castings, but are in a great measure replaced by cupola furnaces. The reverberatory is next to the crucible in making good foundry metal: it gives uniformity

to the various qualities of pig-iron charged, and the melted iron is quite free from air-holes, and flows like lead into the mould. All founders and engineers agree that castings made from the reverberatory are stronger than those from the cupola, if made of the same iron. In figure 36 a reverberatory furnace is repre-

Fig. 36.

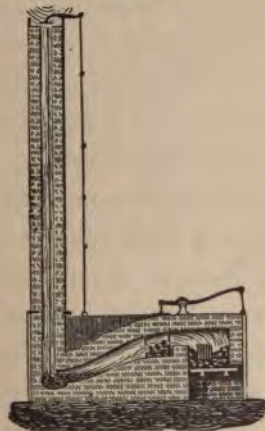

sented in section. The whole interior is constructed of fire-bricks, and cemented by fire-proof clay. The enclosure is generally made of cast-iron plates, but we also find furnaces which are enclosed in common bricks, bound together by iron cross ties or binders. The stack is generally 40 and more feet high, even as high as 80 feet; but there is no need of that, as 40

feet makes sufficient draft. The grate is $3\frac{1}{2}$ feet long and from 5 to 6 feet wide, or as wide as the interior of the furnace. The hearth is from 5 to 8 feet long and equally as wide; it slopes gradually towards the chimney, and forms a basin for the accumulation of the melted metal. The fire-bridge, which separates the fireplace from the hearth, is from 10 to 15 inches high, according to the capacity of the furnace. One side of the furnace is provided with a large iron sliding-door for charging iron and repairing the hearth; this door is at the highest part of the hearth, near the fire-bridge. In the lowest part of the hearth, in the centre of the basin, is the tap-hole. This may be at one side of the furnace, or behind the stack at the flue. A damper on the top of the stack is a useful fixture to regulate the draft. A furnace of this kind is to be very thick in the walls, so as to be as bad a conductor of heat as possible. Too much attention cannot be paid to close joints in the brickwork; open crevices which admit air are to be carefully stopped up, or the iron is liable to a loss of carbon, and will make, in consequence, hard and brittle castings. There are various forms of reverberatory furnaces in use, but the most general is that represented above. There are furnaces with double arches; that is, where iron is

melted at the fire and at the flue-bridge, and the melted metal concentrates in the centre of the hearth where the arch is drawn down. There are also furnaces where the cold pig is charged in the centre of the basin, which is the centre of the hearth; but none of all these various forms is superior to the above. The pig-iron is here charged behind the fire-bridge, and, as it melts, flows down into the basin. The impure matter adhering to the pig-iron, and which does not melt, as sand and coal, will remain behind the bridge, and may be removed at any time after the heat. In this way, the melted iron is not in contact with any impurities which can injure it. The heat of the furnace is generally greatest near the flue, and the melted metal is in this case exposed to the strongest heat of the furnace. The manipulation at this furnace is very simple. When a cast is to be made at a certain time, the furnace is heated some five or six hours before, and a brisk fire kept all the time; for it will take from three to four hours before the furnace is sufficiently hot to charge iron. The furnace is to be white hot before pig-iron is charged. The large door is then opened and the pig-iron charged, one ton or more at once; in fact, as much iron as is required to make the cast desired; for it is not con


sidered advantageous to charge cold iron while a part is already melted. All the iron contained in a liquid form in the basin, is to be tapped before any fresh pig can be charged. When all the iron contained in the furnace is melted, the tap-hole is opened with a sharp crowbar, and the liquid iron either let into pots or directly into the mould. The tap-hole is stopped with damp sand, or a mixture of loam and coal-dust. When the furnace is charged with iron, all the crevices and joints at the door and in the brick-work are to be cautiously stopped with moist loam, to prevent the access of any air upon the hearth. The firegrate is also to be well attended to, and kept well filled with coal, but not too high, so as to impair the draft of air through the fuel. The grate should be kept free from clinkers, and the formation of holes where the air could pass through unburnt, is to be prevented.

The reverberatory furnace is not only used for melting iron, but is also employed for the melting of large quantities of brass, bronze, tin, lead, and other alloys and metals. Large bells, statues, machine-frames, and similar objects, are cast from the reverberatory furnace. All metals, except very gray, fusible iron, which may be cast from a pot, are to be run in dry sand-ditches, directly from the furnace into the

mould. The best fuel for the reverberatory is bituminous coal. Hard coal or coke may be used, but is not so well adapted as the first. The disqualification of the latter arises partly from their incombustible nature, but chiefly on account of the mass of fine ashes which is carried over from the fireplace to the hearth, covering the melted iron and preventing its absorption of heat. This evil is more apparent in the use of anthracite than of coke. Wood, particularly green wood, is not at all qualified for use in the reverberatory; if no mineral coal can be obtained, *charcoal is to be substituted for it*. For the general character and quality of castings, it is to be regretted that the reverberatory furnace for the melting of iron is fast disappearing. Machine frames of large size, rollers for iron mills, and even chilled rolls, are cast from the cupola. Machine, engine, and iron manufacturers, bridge builders, and architects, ought to insist on having their castings done from iron melted in the reverberatory furnace. Casts from the blast-furnace directly, are the very weakest, and, next to it, ranges the iron of the cupola. The reverberatory and the crucible make the strongest, closest, and safest castings.

The Cupola, has the advantage of melting iron cheaper than any other furnace. Besides this, it is a

very convenient apparatus, because a small amount of iron, say fifty pounds, or as large a quantity as five or six tons, may be melted in a short time, with comparatively a small amount of fuel, and in furnaces showing but little difference in size as well as form. In casting small objects, as hollow-ware, agricultural implements, architectural ornaments, and similar forms, and, in fact, in all cases where the strength of the metal is a secondary consideration, there is no question but the cupola is the best form of melting-furnace. There is a great variety in the form of cupolas, but only in minor points; all cupolas generally agree with the form represented in Fig. 37. In A, a section of the cupola-furnace

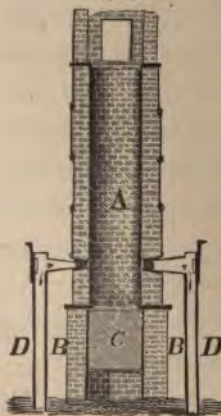Fig. 37.

is shown, with another section to represent the sloping bottom. It consists of a cylindrical cloak or enclosure of boiler-plate or cast-iron, of from three to six feet in diameter. This rests upon two brick walls, B B, which are overlaid by a square iron plate, having a round orifice as large as the interior of the furnace. This orifice is closed when the furnace is in operation, by an iron door, C, shut and held close by means of an iron bar propped against it. When the furnace is going out of blast, and is to be emptied of its contents, this door is let down, and with it the slag and hot coal of the interior will drop. The inside of the furnace is lined with fire-brick, or it may be lined with a mixture of fire-clay and river-sand, firmly rammed in and gently dried. A good lining for a cupola may be made of turnpike-mud, where the road is macadamised with flint or hard sand-stone; but, where iron or lime is contained to some extent in such mud, it should be rejected. Some cupolas are but four feet in height, while others are made from eight to nine feet high. We consider five feet as too great a height; there is no other advantage in it than having a larger body of fuel at once on fire, which may be effected to more advantage by a greater diameter. Low furnaces, even as low as three feet, use less

fuel than the higher ones. The width of cupolas is quite as variable as the height; there are furnaces of eighteen inches in diameter, and some are four feet. With charcoal, eighteen inches wide and one tuyere will make hot iron, but coke requires at least twenty-four inches and two tuyeres, and anthracite thirty inches or more to produce the same result. A cupola is generally overbuilt by a spacious chimney, to lead the hot gases over the roof of the building; but a sheet-iron pipe will serve quite as well as a brick chimney. The lining of a cupola should be at least nine inches thick, and may be still thicker, if made of fire-brick. These bricks are to be laid in fire-clay mortar, a mixture of refractory sand, and as much fire-clay as is needed to hold the sand together. The tuyeres are generally from ten to fifteen inches above the iron bottom of the furnace, and are simply round orifices, of the size of the nozzle, cut through the in-wall. For small furnaces, but one tuyere is used at the back of the furnace; for larger furnaces, at least two tuyeres are needed; and for still larger, and particularly hard-coal furnaces, we frequently find six or eight tuyeres, cut in the same horizontal plane, in one furnace. If the diameter of the furnace is large, the tuyeres are multiplied, in order to generate

a uniform heat at all points in the furnace. Where a large quantity of iron is to be melted at once, tuyeres are cut one above the other; if the melted iron is raised to the height of the lowest tuyeres, these are stopped with fire-clay, and the next above opened, and if the iron is raised to the second, it is also stopped up, and the next higher put in operation. This process is continued until all the iron required for the cast is in the furnace. The vertical distance between the tuyeres is generally six inches. The nozzles of the tuyeres are simply sheet-iron conical pipes, of from three to five inches in width at the narrowest part. The conducting-pipe from the fan to the furnace ought to be at least twice the diameter of the nozzle, or four times as large as the area of all the nozzles. Where more than two tuyeres are used in one furnace, we frequently see a square cast-iron pipe surrounding the furnace; in this pipe are as many orifices, directed towards the centre of the furnace, as there are tuyeres; the nozzles are attached to these orifices.

The operation in a cupola is simple. If iron is to be melted, the first thing to be done, is to lock the iron door at the bottom, then fill in a bottom of sand: moulding-sand is generally used in cases where but a small quantity of iron is to be melted. If a large

quantity of melted metal is required, a more refractory sand is used. The fire is kindled by laying a few chips of wood on the bottom, and placing upon them some coke, stone-coal, charcoal, or anthracite. The fire is kindled through the tap-hole, which is at least six or eight inches wide. The tap-hole is left open to admit fresh air for promoting the combustion. The tuyeres are also left open. The furnace is now filled to its mouth with fuel, which is kept at a brisk combustion. It generally requires two or three hours to heat or prepare the furnace for blast, which is not put on until the flame appears on the top of the fuel. When the furnace is thoroughly heated, the nozzles are laid in and the blast-machine is put in operation. Previous to this, however, the large tap-hole is stopped up with moulding-sand, or with a more fire-proof sand mixed with clay, leaving a small orifice at the bottom, which forms the tap-hole for the iron. This tap-hole is $1\frac{1}{2}$ or 2 inches wide, and is formed by placing a tapered round iron bar in the place where the hole is to be, ramming the sand tightly around it, and removing it as soon as the hole is filled up. The blast, when put on, will drive a flame through the small tap-hole as well as out of the top of the furnace. The small tap-hole is kept open to dry

the fresh loam or sand more perfectly, and also to glaze the tap-hole so as to resist the abrading friction of the tapping-bar. The flame, also, helps to glaze the lining of the furnace, which is more or less injured after every smelting, and requires mending with fresh fire-clay. When the furnace is to hold a large quantity of metal, the large tap-hole is covered by an iron plate, which is fastened by wedges to the iron enclosure, leaving only the small tap-hole free. The iron is charged as soon as the lower parts of the furnace show a white heat, which is best known by the colour of the flame that issues from the tap-hole, it being at first a light blue, but, with increasing heat, assumes a whitish colour, and apparently a higher heat. In about ten minutes after charging the iron the melted metal appears at the tap-hole, which is now closed by a stopper made of loam, which is worked in the hand until it assumes a certain degree of tenacity; a round ball of it is then fastened on the end of a stick of wood, provided with a disc of iron, which, being previously wet, is then pressed into the tap-hole. A charge of iron never consists of less than two hundred pounds, and, in most cases, of four or five hundred pounds. Pig-iron is broken into pieces of from ten to fifteen inches in length before it is charged. From ten to

twelve pounds of fuel are consumed and charged with every hundred pounds of iron in good furnaces. Small furnaces, and those which are driven slowly, use more fuel, and the amount often rises to twenty pounds of fuel to one hundred pounds of iron. Along with the charges of coal and iron, a little limestone, broken into two-inch pieces, or oyster shells, is charged, to about two, or three, and often five per cent. to the weight of the iron. Too much limestone, as well as too little, causes the iron to become white, lose some of its carbon, and in most cases, its strength and softness. The furnace should be kept full while in blast, or at least so long as iron is melted, by alternate charges of iron and coal. Coal is generally put on first, then iron, and on the top of these the limestone is laid. When all the iron needed for the occasion is melted, the charges are stopped. The blast, however, is urged on, until all the iron has been tapped. The sand bottom of the furnace is made sloping, so as to admit of discharging the last portions of the iron. A well-constructed cupola furnace will melt one ton of iron every hour; some furnaces as much as three tons per hour; small ones, frequently not more than half a ton in an hour. Most furnaces are wider at the bottom than at the top; they

therefore work hotter than those with parallel sides, and also have the advantage of lasting longer, as the melted iron, which is apt to cut the fire-brick, does not run down along the brick. The taper to be given to a lining is dependent upon the size of the cupola; a large furnace will bear more taper than a narrow, or small furnace. If different kinds of iron are to be melted in the same heat, a thick layer of fuel is interposed between the various qualities, so as to admit of the extraction of all the iron which was first charged before the second appears at the bottom. In such cases, it is advisable to melt the gray iron, or that iron which is to make soft castings first, and the white or hard iron last. When as much iron is melted as is needed for filling one or more moulds, the clay plug of the tap-hole is pierced by a sharp, steel-pointed bar, and the metal run into pots, which are carried by hand or with a crane, or it is run directly into the mould by means of gutters moulded in the sand of the floor. Between each successive tapping of the iron, the tap-hole is closed, and more iron gathered. Where more iron than the furnace will hold is required for one cast, a portion of it is tapped into a large pot, which process may be carried so far, as to make castings of five or more tons from a small furnace.

Pots in which iron is carried from the furnaces to the moulds are represented in figures 38 and 39.

Fig. 38.



Fig. 39.



The first is generally of a capacity sufficient to hold from two to three hundred pounds of melted iron. It can be carried by three or more men; the forked part of the handle is used for tipping the pot, so as to pour the iron gradually into the mould. Figure 39 is designed to be raised by means of a crane, and emptied therefrom into the mould. The cupola or reverberatory at which such a pot is used, as well as the mould, should be within the sweep of the crane. Pots of this description are of various sizes; we



find some which will hold five hundred pounds, and others will hold two tons and more. The swivels on such pots are generally strong, and their ends square, with a key-hole to fasten one or two forks to them, for the purpose of tilting the pot and pouring its contents into the mould. These pots are always made of boiler-plate, as it would be dangerous to make them of cast-iron. Before each cast, the pots receive a wash of strong clay-water, to prevent corrosion by the hot iron.

The foregoing are the most important means of melting metal; in the cupola, no metal but iron is melted. Copper, bronze, brass, German-silver, silver, gold, and the alloys of these metals, are either melted in crucibles, or, if large quantities are to be smelted, in the reverberatory furnace. The furnaces, crucibles, and other tools, are essentially the same for other metals as those described for melting iron. Slight variations in the form of melting apparatus are often advised, but there is no essential difference, no alteration in the principle. Fusible metals, such as lead, tin, zinc, antimony, and the alloys of those metals, may be melted in iron pots, kettles, crucibles, and iron ladles, and also in clay crucibles. The heat required to melt these metals is not so high as the melting-heat of iron.

BLAST-MACHINES.

Formerly, cylinder blast-machines were used to supply the cupola with air for combustion, and in some few establishments they are still retained for fanning the furnaces; the impression being, that iron melted by cylinder blast is stronger and less injured than that melted by other blast-machines. There is no doubt that the cylinder blast is preferable to the blast generated in machines where water is in contact with the compressed air; in all other respects the impression is erroneous, as there is evidence sufficient to satisfy the most sceptical. In the present case, only, a blast is required for the cupola; in other furnaces it is not needed. To nourish a cupola, no better or more perfect blast can be generated than that made by the fan, or the centrifugal blast-machine. Practice has proved that the fan makes the cheapest blast, and also saves fuel; it has no deteriorating influence upon the iron, provided the quantity of blast sent into the furnace is sufficient to generate a strong heat. In figures 40 and 41, a common fan is represented. It is an iron box, consisting of two cast-iron sides, with a rim of sheet-iron between them. In the centre of the box is a hori-

zontal shaft, with four fans or wings, which move with great rapidity, drawing in the air at the centres on each side, and driving it towards the periphery.

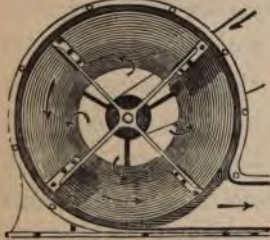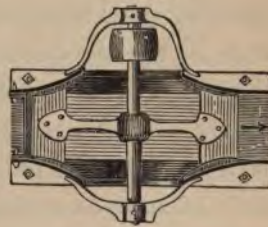Fig. 40.*Fig. 41.*

thus imparting to the particles of air a momentum, by the centrifugal motion, which presses them against the circumference, and if there is any opening at the circumference, the air will escape with a speed proportionate to that pressure. These fans have been constructed of various sizes and forms; their depth is varied according to the quantity of air to be derived from them; the wings are from four to twenty-four inches wide; eight inches wide is sufficient to supply a well-sized cupola. The diameter is as various as the width of the fan, but it is generally admitted that three feet in diameter is the most profitable and practical size. The wings are often placed in the direction of the diameter, as is shown in the engraving; sometimes in an

inclined position to the diameter; and also have been curved in a spiral line, but without any appreciable difference in effect. The latter form of the wings does not cause as much noise as the radial vanes. The chief object in constructing a fan is to form it so as to do the greatest amount of work. The case should be strong and solid, and for these reasons wood is not the proper material for its construction. The shaft and vanes are to be as light as possible; the shaft, of steel, hardened at both ends, where it runs in brass, steel, or cast-iron pans. The vanes of the fan are to be of thin sheet-iron or sheet-copper, and the arms to them of wrought iron. One of the most important conditions of a fan, is the equal weight, and the equal distance from each other of the vanes; and each arm supporting them is to be exactly of the same weight as the other. If these conditions are not complied with, the machine will shake, and soon be out of order. A mere adjustment of the axis, and the vanes attached to it, is not sufficient; it is absolutely necessary, for a good machine, that all the parts around the shaft should be of an equal thickness. In a fan of three feet diameter, the centre openings are generally one foot; in larger fans the openings are larger. Very large apertures will not answer; the air is conducted too quickly to

the periphery of the vanes, and there is not sufficient time to impart to the particles the momentum requisite to produce a good effect.

The chief difficulty in constructing a fan is, in the close fitting of the vanes to the sides of the case. The latter cannot be made very straight without incurring much labour, and, on the other hand, it would be very difficult to adjust the axle so perfectly in the centre of the case as not to touch it, which, considering the great speed of the vanes, is almost impossible. It is also easily perceived that the loss in pressure is in the space between the vanes and the cast-iron sides of the case. To diminish this loss, fans are now constructed in which the vanes are covered on both sides with two concentric plane rings, so that the axle with the vanes, forms a hollow drum, open in the centre and at the periphery. The vanes are fastened to these two bottoms or rings, and also to the arms, radiating from the centre. The two bottoms move round with the axis, and parallel with, and close to the sides of the case. In the centre, where the air is drawn in, the case is turned perfectly round, as well as the rim on the centre of the bottoms; both fit closely, but do not touch each other. Where these join there is but from eight to twelve inches diameter, which may

be kept tighter than the larger surface and circumference at the vanes. By these means the loss in pressure is greatly diminished, and it is an established fact that these fans require less power, and make stronger blast than fans of other descriptions. Fans of this construction are now most commonly used. The bottoms and vanes in these fans are made of thin sheet copper. The effect of a fan does not depend so much upon its size, as upon its speed and the size of the nozzle. It does not require large vanes to make strong blast; it is sufficient if the surface of each is one-and-a-half times the area of the nozzle, or, if there are more nozzles than one, of the sum of the areas of all the nozzles. More than four vanes in one fan are useless. In the conducting-pipes from the fan to the furnace, there is to be a throttle-valve at each nozzle to shut off the blast at each without disturbing the others. The speed of the axle of a fan is from seven to twelve hundred revolutions per minute. It is driven by a belt and pulley on one side of its axle. To melt a ton of iron in an hour's time, requires about seven hundred cubic feet of air per minute, or, by a three-foot fan, eighteen hundred revolutions, and two three-inch nozzles. Six horses

power is needed to drive a fan with the above speed and size of nozzles.

Hot blast has been tried in various instances, but not with such results as to induce a continuance of it. In this instance, hot blast has no other advantage than a small saving of fuel, and as the fuel consumed is not to be considered expensive, the getting up of the apparatus, repair, and disturbances caused by it, amount to more than the gain of fuel.

Drying Stoves are simply brick chambers, one side of which is entirely open. Three sides are formed by a nine or twelve-inch brick wall. In one of the sides is a fire-place, which can be supplied with fuel from the outside of the stove, and may be shut by a close-fitting iron door. In the opposite side of the fire-place is a flue which leads to a chimney; this flue is also low down, almost below the ground. The three sides are covered by a brick arch. The fourth side is provided with iron doors, which open to both sides, and leave the whole fourth side open to any piece of moulding which may be put in. Iron shelves are generally put up along the walls towards the roof, for drying small cores and boxes on. A railroad, which is within the sweep of a crane, leads into the stove, and any heavy mould which is to be

dried may be laid upon a car running on this track, and both car and mould are shoved into the stove, the doors closed, and fire put in the furnace. The size of a drying-stove is varied according to the size of the castings commonly made in a foundry. A stove of twelve feet in all directions, and seven feet high, is a good-sized stove. Foundries which make large castings have to be provided with drying-stoves of the proper size. There are frequently more than one drying-stove in a foundry, often as many as five or six, small and large. If there is no occasion for using a large stove, a small one is selected, because it works faster, and with less fuel. In figure 43 a drying-stove is represented.

Fig. 42.



GENERAL REMARKS.

Cleansing of castings.—When the metal of a cast is so far cooled as to adhere together, and strong enough to bear removal, the moulds are taken apart

and the sand or loam is removed from the casting. Small castings require but a few minutes to cool, while heavier casts take hours and days. A massive casting, such as a forge-hammer of five tons weight, will take twenty-four hours cooling in a green, and forty-eight hours in a dry mould. A bed-plate for the engine of one of the New York line of Atlantic steamers, weighing thirty-five tons, took a week for cooling and the removal from its mould. Heavy castings are chained to a crane and hoisted by it. Very heavy castings require the united strength of two and more cranes. Small castings are removed from their moulds by tongs; one, two, or more persons taking hold of it at the same time, carry it to a place designed for the reception of such hot castings. The excrescences which may happen to have been formed in the partings or core-joints are broken off as soon as the cast is removed to the general deposit of hot castings. The gates are, at the same time, broken off by the moulder; it requires some degree of skill to break a gate off smooth. Gates and accidental excrescences which cannot be removed in the foundry, are chiselled and chipped off in the yard or in the cleansing-shop. Heavy cores, and particularly hard cores, are removed in the foundry before the casting is entirely cold.

Time of casting.—The casting in iron foundries is generally performed in the afternoon after three o'clock, so as to make it the last business of the day. This time is chiefly selected to escape the heat of the hot sand after casting, which will then cool during the night. After casting, the castings are removed, and the moulding-boxes piled in a corner of the building, so as to be handy for the next day's work; the sand, after receiving some water, is shovelled over, mixed, and thrown in heaps, where it remains during the night. If the latter work has been properly performed, the sand will be of a proper and uniform dampness the next morning. Each moulder takes charge of his own sand, and but little practice is required to learn the proper amount of water to be used in damping the sand.

The cleansing of castings is a simple operation in an iron foundry where common castings are made: any workman is fit to trim a coarse casting, or scour it. The first is done by means of chisels or sharp hammers; the latter, with dull, coarse files, which have been used and rejected by machinists. Cast-iron files are also used for the latter purpose. The trimming and cleansing of valuable castings, such as statues or ornaments of art, is not so easily performed. An unskilful workman could undo almost

the whole casting, and all the labour spent upon it, by trimming off a channel or gate. This kind of work is done by an artist skilled in the performance of such labour; and, on valuable statues, it is performed by the original designer of the work, at least so far as particular parts, such as the face, or characteristic elements, are concerned. The trimming of fine castings is an art in itself, which requires more explanation than our limited means allow us to give.

The expenses of moulding and casting are very variable. Moulding of common articles of commerce and machinery in iron, is done by the ton, at prices varying from two to twelve dollars per ton, and even at higher prices. Dry-sand moulding is paid higher than moulding in green-sand, and loam-moulding higher than either of them. The moulding of brass, bronze, or other metals, for monuments of art, is of such variety, and so different are the expenses, that no standard price can be assigned to it. The expenses incurred in melting metal are not very great, —the loss in the metal which is melted is greater than the labour and fuel in melting it. In the cupola, twenty-five per cent. of fuel is consumed in melting iron, including all the fuel used in warming the furnace, the drying stoves, and other incidental uses

of fuel. Besides fuel, there are two labourers at the cupola, one smelter, and one filler. The reverberatory takes from seventy-five to one hundred pounds of fuel to each hundred pounds of iron, including the heating of the furnace. Exclusive of warming, the reverberatory will take but fifty pounds of fuel. One workman can do the work at the reverberatory, but there are generally two. The melting of iron in the crucible is the most expensive: it consumes from fifty to two hundred pounds of coal to one hundred pounds of iron. The greatest expenses are, however, in the crucibles: a good crucible, well-managed, will not last more than twelve heats, and if each heat is fifty pounds, it will melt six hundred pounds of iron. A crucible of this kind will cost fifty cents; but very few crucibles will melt six hundred pounds, and, on an average, not more than three hundred pounds can be calculated upon.

The loss in iron is invariably from five to six per cent. in every case of the different forms of melting; the reverberatory furnace consuming most iron. Each casting always requires more metal than it will finally contain; this surplus iron, consisting of gates, channels, and false seams, increases the above loss; and as small castings make more scrap iron than large ones, it is obvious that the actual loss

will be larger on small casts than on large ones. Machine castings make, on an average, thirty-three per cent. of refuse or scrap in a well-conducted foundry. Commercial articles twenty-five per cent., and large castings less ; very small articles frequently make more scrap than ware. The remelting of these scraps costs fuel, and causes a waste of metal, which increases the expense of melting.

Other metals than iron are generally less expensive in melting, being more fusible ; and, as far as copper is concerned, there is but little waste if the copper is pure. Bronze will waste a little ; the waste in volatile metals, as tin and zinc, can be prevented in some measure, if the surface of the melted metal is covered with a mixture of equal parts of potash and soda, mixed with some charcoal powder. To melt and make bronze in the reverberatory, the copper is melted first, and if there is any bronze on hand, in scraps or other forms, it is added as soon as the copper is melted down ; after this, the tin is laid near the liquid copper, upon the hearth, and if any zinc or antimony is to be used, it is added last. Before casting bronze, it is to be well stirred by previously heated iron bars. The amount of potash and soda used to protect the metal, is two pounds to one ton of metal ; it is added when all the metals

are melted and a white scum is visible on the surface of the metal. Bronze metal designed for strong castings, particularly bells, ought to be exposed to the fire in a fluid state for at least eight or ten hours; this will give it a more homogeneous texture and less crystallization. If any zinc is to be added to such an alloy, it is advisable to add it in the form of brass, calculating, of course, the quantity of copper it contains. The relative quantity of the metals forming the alloy can be calculated and mixed according to this arrangement; but the melting operation has an influence upon the strength of the metal. Tin or zinc may be evaporated, and the alloy would not be of the quality intended; the founder, therefore, takes proofs before casting, and if they are not satisfactory, either copper or tin is added to the melted mass. It requires some experience to judge of the quality of an alloy by appearances. Proof is taken by a small iron ladle, the little metal in it is broken after it has cooled, and the form of crystallization and the tenacity of the metal is decisive of the quality of the composition.

Lead, tin, and antimony may be melted in a reverberatory furnace; brass, however, is to be melted in crucibles. Brass is sometimes made by melting copper, and adding, after it is melted, as

much zinc as is needed to form the alloy. A cheaper method is to melt a mixture of copper scraps and zinc ore together with some charcoal powder; or, melt both copper and zinc ore together with carbon. In both cases, however, the brass is to be remelted, because the first smelting does not produce strong and pure brass.

APPENDIX.

RECEIPTS AND TABLES.

Alloys of Iron.—All admixtures added to iron **make it more fusible than it originally is**; these may be metals or metalloids.

Sulphur causes iron to be more fusible if melted together, but this mixture is more liable to corrosion than pure iron. A little sulphur does not injure cast iron, but more than one per cent. makes it brittle when cold. If there is any sulphur in iron when hot, it causes the iron to be brittle.

Carbon is contained in all cast iron from two to six per cent.; it makes the iron fusible; if the amount contained is too large, it renders it brittle. A little carbon makes cast iron brittle and hard. Hard cast iron assumes as beautiful a polish as hardened steel.

Phosphorus makes iron brittle when cold. It imparts a brilliancy and white colour to iron more perfectly than any other matter. Phosphorus makes iron very hard, but renders it liable to corrosion; one-half or one per cent. causes a great alteration in the quality of iron.

Silicon is a constant companion of cast iron; hot-blast iron contains more of it than cold-blast; it also contains more sulphur and phosphorus if any is present in the ore or coal. Silicon makes iron brittle and hard, and has a similar effect on it as phosphorus.

Arsenic imparts a fine white colour to iron, but makes it brittle.

Chromium causes iron to be as hard as diamond, but it is difficult to make this combination.

Gold combines very readily with iron; it serves as a solder for small iron castings, as breast-pins and similar articles.

Silver does not unite well with iron, but a little may be alloyed with it; it causes iron to be very hard and brittle. The alloy is very liable to corrosion.

Copper, if alloyed with iron, causes it to be brittle when hot, but increases its strength considerably when cold, if the amount of copper is not more than one-fourth of 1 per cent.; more copper than this causes cold-short.

Tin, with iron, makes a hard, but beautiful alloy, which, if nearly half-and-half, assumes a fine white colour, with the hardness and lustre of steel.

Lead combines with iron, but, like silver, in a small proportion; it causes iron to be soft and tough.

Alloys of iron are very little in use at present, but we call attention to such alloys, because the easy method by which, at present, iron is gilded, silvered, or coated with other metals, and also the covering of iron with glass, enamel, and varnish, may, and undoubtedly will lead to the use of iron alloys with greater advantage than the common cast iron is used.

Alloys of Precious Metals.—There are but few which claim our attention. The gold coin of the United States is composed of 90 parts of gold, 2.5 silver, and 7.5 copper; 75 parts of gold, 25 of copper, and often a little silver, is the composition for most trinkets; 66.6 gold, 16.7 silver, and 16.7 copper, forms the solder for gold and iron. Fine silver plate and medals are generally composed of 95 parts silver and 5 copper. Silver solder is 66.6 silver, 30.4 copper, and 3.4 brass.

Alloys of Copper are the most numerous and useful. *Bronze*, or bell-metal, is one of the most beautiful of these alloys.

72 parts copper, $26\frac{1}{2}$ parts tin, and $1\frac{1}{2}$ parts of iron is said to be a superior bell-metal. Iron, tin, and copper do not unite well if each is added separately to the other, but if tin-plate scraps are melted in a crucible together with tin, and then this tin

and iron alloy added to the melted copper, it will unite readily.

Common Bell-metal consists of 100 parts copper and 30 or 40 tin; it is more brittle and of not so good a tone as the other. Another receipt prescribes 78 parts of copper and 22 of tin as a first rate bell-metal. Another highly recommended composition is 80 copper, 10.1 tin, 5.6 zinc, and 4.3 lead. The latter composition is of a good sonorous sound, even if the mould has not been quite dry. The silver bell of Rouen, France, consists of 80 copper, 10 tin, 6 zinc, 4 lead. Too much tin causes the composition to be very brittle. Some bell-founders recommend the addition of a small portion of silver to the composition, but it appears there is no particular necessity for it.

Bronze of great tenacity is composed of 9, 10, or 11 parts of copper to 1 of tin. If this alloy is cast in large masses, it has the peculiarity of separating into parts which contain more or less tin or copper. The tin is generally found on the higher parts of the cast, the copper predominating in the lower parts. This composition, besides being strong, is very hard, and resists abrasion very effectually; it also is very little acted upon by the atmosphere. The ancients used to make their weapons

and edged tools of a similar composition,—to which, however, a little phosphorus appears to have been added,—before the invention of steel. If bronze is suddenly cooled, by heating and plunging it in cold water, it becomes less dense and hard, and increases its malleability; but this is not the case in the same degree with all compositions, but the tone of the metal is decidedly impaired, and bells ought never to be cast in damp moulds. Bronze made of the last composition is improved by being tempered, while the tenacity of bell-metal, by the same process, is reduced to one-third of its original strength. The alloy of 80 copper and 20 tin bears tempering best, and increases in strength. The gongs or cymbals, and tamtams of the Chinese, are composed of 80 copper and 20 tin. To give these musical instruments their sonorous property, they are plunged in cold water after being cast; a reheating to ignition, however, is to precede the refrigeration. After this latter process, which deprives the metal of almost all its sound, it is tempered, and very slowly cooled, which imparts to it the capacity of emitting that peculiarly powerful sound.

Bronze for Statues is of a great variety of composition. We also find alloys for this purpose composed like bell-metal, and also of almost pure copper

Modern statues are composed of a composition of 80 copper and 20 tin. The present state of the art of making valuable bronze castings is, however, so imperfect, that our age cannot be considered competent to give a standard of metal compositions for that purpose. The French artists, in the first part of this century, were so ignorant in this peculiar art, that some parts of the Vendome column are an alloy of 94 copper and 6 tin, while other parts contained but $\frac{1}{5}$ of alloy to 99 $\frac{1}{5}$ of copper. These defects caused bad castings, so that the chisellers had to cut off seventy tons of protuberances on this one monument. At the time of Louis XIV., a period when the art of casting statues was more cultivated in France, statues were cast of an alloy consisting of 91.3 copper, 1 to 2 tin, 5 to 6 zinc, and 1 to 1.5 lead. The statue of Louis XV. is cast of copper 82.4, zinc 10.3, tin 4, and lead 3.2.

The Bronze of the Ancient Greeks consisted chiefly of copper and tin, but was frequently alloyed with gold, silver, lead, zinc, and arsenic. The Greeks not only made statues, tripods, lamps, and other articles of art of bronze, but also their weapons, shields, coin, nails, kitchen utensils, and surgical instruments. The ancients understood the art of hardening and tempering bronze to perfection, so

that the want of steel was not so severely felt as we may be inclined to believe at the present time.

The Ancient Mexicans—Aztecs—understood the art of converting bronze into edged instruments in a high degree. To small castings, an addition of iron, in the form of tin-plate scraps, appears to be advantageous: large articles are liable to crystallize by the addition of that metal.

Speculum Metal is generally composed of $66\frac{1}{2}$ copper and $33\frac{3}{8}$ tin, it is white, and has a brilliant lustre, and is susceptible of a high polish. An ancient mirror was found to consist of 62 copper, 32 tin, and 6 lead. In France, 2 parts of copper and 1 part of tin are used, which are melted separately in crucibles, and mixed just before casting. The addition of a little arsenic, one or two per cent., makes the metal more compact, and gives it a greater lustre and hardness, but renders it liable to be tarnished by the air. *The speculum metal* of Lord Rosse's large telescope is composed of 126.4 copper and 58.9 tin. This alloy is of a brilliant white lustre, and has a specific gravity of 8.811; it is nearly as hard as steel, and as brittle as sealing-wax. The speculum is cast 6 feet in diameter and $5\frac{1}{4}$ inches thick, and weighs upwards of three tons. The casting of this mirror was an interesting process. After repeated

failures and experiments, a mould was made whose bottom consisted of a wrought-iron ring, packed full of hoop-iron laid edgeways, so close that air, but no metal, could escape through the crevices. This bottom was turned convex on a turning-lathe, true to the concavity of the speculum; it was then placed upon a level floor and enclosed by a sand-dam, left open from above. The metal was melted in cast-iron crucibles, because wrought iron or clay would have injured the alloy. The cast was carried while red hot into the annealing oven, which was previously heated to a red heat, and left there sixteen weeks to cool.

Bronze for Medals generally contains least tin. 100 copper with 4.17 tin has been proposed, but this alloy is so hard, that it has been found necessary to cast the coin. Bronze medals are, however, stamped when composed of 92 copper and 8 tin, a little zinc being added in a form of brass.

Bronze in imitation of Gold, consists of 90.5 copper, 6.5 tin, and 3 zinc.

If bronze is to be gilt, it should be of easy fusion, and take perfect impressions of the mould. A combination of copper, tin, zinc, and lead, as previously noticed for statues, is the best in this case. An alloy which is said to possess the best properties for

being gilt, was composed of 82.25 copper, 17.45 zinc, .23 tin, .02 lead. An alloy for gilding is to be compact and of close grain. It absorbs gold and mercury in proportion to its porosity.

Brass is a composition of copper and zinc; 2 parts of copper and 1 of zinc—or more correctly 63½ copper and 32.3 zinc—form common brass. Two parts of brass and one of zinc form hard solder; to this a little tin may be added. If the solder is to be tough, as for pipes or kettles, which are to be drawn or beaten, but $\frac{3}{8}$ of zinc are to be added to 2 of brass. *Button-brass* consists of 8 parts of brass and 5 of zinc. *Red-brass* or tombak is made of 8 or 10 copper, and 1 zinc, or, as in some German works, of 11 copper and 2 zinc. *Princes metal*, Similor, Nurnberg gold, or Manheim gold, are different compositions, varying between 3 copper and 1 zinc, and 2 copper and 1 zinc. These elements are separately melted, and mixed together by constant stirring. Brass containing a little lead, from one to two per cent., is more easily turned than common brass, but is more brittle. Brass which is best adapted for hammering consists of 70 copper and 30 zinc. Tempering and sudden refrigeration has a similar effect on brass as upon bronze; the first renders it hard and more tenacious, and the latter

soft. A little zinc makes a reddish brass, and imparts a golden hue; larger quantities make it a greenish yellow, and more than fifty per cent. of zinc causes brass to be of a bluish gray colour. *Brass for ship nails* consists of 10 copper, 8 zinc, and 1 iron. Brass for pans and steps to run machine shafts in, is to contain less zinc than common brass; an addition of bronze to brass increases its applicability for such purposes. It is said that 16 copper, 1 zinc, and 7 platinum is almost equal to gold. If melted red-brass is stirred with an iron or steel rod, so as to impart a little iron to it, its strength is sensibly augmented. The variety of brass compositions is so numerous, as to make it impossible to note all the known compounds. In the above, the most useful alloys are enumerated.

German-silver, *Argentan*, or *Chinese Packfong*, is one of the most valuable alloys; it nearly combines the durability of silver and the utility of iron, steel, and copper. Common *German-silver* is composed of 60 copper, 25 zinc, and 15 nickel. A better quality is 50 copper, 25 zinc, and 25 nickel. *Chinese packfong* consists of 55 copper, 17 zinc, 23 nickel, and 3 iron. A highly sonorous, tenacious *Argentan*, which can be hammered and rolled, resembling silver more than any other compound, is composed of

10.4 copper, 25.4 zinc, 31.5 nickel, 2.6 iron. At present, a fine argentan, and one the best qualified to be plated with silver by the galvanic process, is made of 62 copper, 19 zinc, 13 nickel, and 4 to 5 cobalt and iron. This argentan is very close, strong, and cheap, and may be covered by one or two per cent. of silver, forming a good fine plate. A very tenacious, ductile, and hard argentan may be made of 57.4 copper, 25 zinc, 13 nickel, and 9 iron. This alloy can be substituted for steel in many of the common uses of steel, particularly where corroding influences upon steel are strong, because this alloy is not affected by atmospheric air. *Electron*, a fine quality of argentan, is composed of 8 copper, 4 nickel, and 3.5 zinc. *Solder for German silver* is made by adding 4 parts of zinc to this composition, then laminate and pound it to a coarse powder.

Before we part with copper alloys it will be proper to allude to some combinations of copper with other matters which are useful to know. *Copper and platinum* form a yellow alloy hardly distinguishable from gold. *Copper and silver* do not form any distinguished amalgam; the addition of a little arsenic to such an alloy makes it whiter and more like silver. A little copper and antimony make a fine rose-coloured alloy; if the copper is increased, it assumes

a darker hue; equal quantities make a violet compound, and more copper increases the dark shade. This alloy is brittle in all proportions; 90 parts of copper, 5 antimony, and 5 zinc, are used for plumber-blocks, and pans and steps for steel and iron gudgeons to run in. *Carbon* makes copper very brittle. *Phosphorus* makes copper as hard as steel, so that it can be used for knives and edge-tools; it, however, renders copper more liable to corrosion. The appearance of this compound when newly polished is like pure copper, but it is very soon covered or tarnished with a greenish-black covering. This greenish black being the colour of ancient weapons, renders it probable that the ancients hardened their copper or bronze tools by means of phosphorus. *Copper and arsenic* form a bright white alloy, which is used for candlesticks, buttons, dials, and similar articles, but as this compound is easily soluble and highly poisonous, it cannot be used where food is brought in contact with it. This alloy is made by melting copper scraps and white arsenic—arsenious acid—in a crucible, covering it with a layer of common salt. It has almost the colour and density of pure silver, but is very liable to corrosion.

Lead and its alloys are very extensively used; the alloys are usually harder and less tough than lead. A

small amount of arsenic is added to the lead to make shot; arsenic is more fusible and more brittle than lead; for fine shot, three pounds of arsenic, and for coarse eight pounds, to one thousand pounds of lead, are generally used. To alloy lead with arsenic, nothing more is needed than to melt white arsenic together with metallic lead; half the weight of the arsenic employed will be absorbed by the lead. 5 *lead* and 1 *antimony*, to which frequently a little zinc and bismuth are added, forms type metal. A good French type metal is said to consist of 2 lead, 1 antimony, and 1 copper. Common type metal is 80 lead and 20 antimony; a more fusible stereotype metal is 77 lead, 15 antimony, and 8 bismuth. Some stereotype founders add tin to the above, that is, add to lead, antimony, and bismuth, tin; or leave the bismuth out and supply its place by tin. If much tin is used it renders the metal rather soft, but fusible and fit for fine impressions. A superior alloy is said to consist of 9 lead, 2 antimony, and 1 bismuth. To alloy lead with these metals, the lead is first melted, and the other metals added to the fluid lead. *Fusible metal* may be compounded of various degrees of fusibility; 31 lead, 19 tin, and 50 bismuth may be fused at 203° . An alloy which fuses at 149° , and which is used for plugging teeth, consists of 28.5

lead, 45.5 bismuth, 17 tin, and 9 mercury. 8 of bismuth, 5 of lead, and 3 of tin, will melt at the boiling heat of water, or 212° . Bismuth makes lead stronger if the amount of bismuth does not exceed that of the lead; two parts of bismuth and three parts of lead is said to be ten times stronger than lead, and as the durability of bismuth is equal to lead, it forms a good alloy for making pipes and wire.

Tin forms a range of very useful alloys. *Tin and lead* melt together in all proportions. Most of the tin vessels which are called pure tin are alloyed with lead. Soft solder is 33 tin to 67 lead, and in all proportions from that to 67 tin to 33 lead; half-and-half is common soft solder. *Plate pewter* is composed of 89 tin, 2 bismuth, 7 antimony, and 2 copper. *Queen's metal*, of 75 tin, 9 lead, 8 bismuth, 8 antimony. *Britannia metal*, of 89 tin, 2 copper, 6 antimony, 2 brass, and 1 iron. *Common pewter*, or German tin, is composed of 4 tin and 1 lead. The best plate pewter is 100 tin, 8 antimony, 2 bismuth, and 2 copper. *Music metal* is 80 tin and 20 antimony. *Spurious silver leaf* is 50 tin and 50 zinc. Antifriction metal is a variable compound of lead, antimony, tin, and copper. *Organ pipes* are made of a composition of 9 tin and 1 lead; these proportions

are varied by different artists. 29 tin and 19 lead form a fusible compound, of which imitations of diamonds and precious brilliants are made. To make such imitations, a glass rod is ground at one end in the form which is to be represented, whether a brilliant or rose-diamond. The melted metal is skimmed by a paper card, and the ground faceted end of the glass rod dipped in the clear metal; on withdrawing the rod a thin film of metal will adhere to the cold rod, which, when taken off, will show a hollow capsule having the lustre of a diamond. We find such diamonds at present used to make sign-boards in show windows. This metal forms excellent reflectors, which may easily be made by dipping a round bottle or the bottom of a retort in the metal; but the metal is tarnished by anything coming in contact with it. 1 part tin, 1 lead, 2 bismuth, and 10 mercury is very fusible; with this compound glass pipes and glass globes are coated with a thin film, by placing some of this metal in the article to be coated, and allowing it to flow round, thus giving it the brilliancy of silver. *Tin foil*, if designed for mirrors, is pure tin, but common tin-foil is lead and tin—often tin, zinc, and lead; it has so great a variety of composition, that no standard can be assigned it. Tin-foil is made either by hammering

or rolling, but most of it is made by casting the hot metal over an inclined plane, made of a frame covered with cotton or linen canvas. It requires some skill to perform the latter operation.

Zinc, alloyed with other metals, has already been enumerated. In its pure state it forms fine sharp castings, good for ornamental purposes; but as these castings have no strength, they are not much used for other purposes. A composition of lead and zinc is used for patterns, but with little advantage; it is soft and flexible, and the patterns soon lose their shape.

BRONZING.

When bronze metal has been exposed to the atmospheric air for a long time, it assumes a dark green colour. This colour, a rich hue, may be imitated by chemical agencies, or by paint. Bronze metal, after being cleaned, is bronzed by being painted or immersed in a solution of two parts of verdigris and one part of sal-ammonia, dissolved in vinegar, boiled and filtered, and used very dilute. It is left in this solution or brushed over until the desired hue is obtained. *The colour of antique bronze* is obtained by painting the bronze cast with a solution of one part of sal-ammonia, three parts cream of tartar, six parts of common salt, the whole dissolved in twelve parts of hot

water; with this are to be mixed eight parts of a solution of nitrate of copper. This solution should be laid on in a damp place. The first mixture will give a more reddish dark green colour to bronze than the latter. Different tints may be imparted to bronze and brass, from red to bright yellow, and from dark to light green. *Boiling bronze* in muriatic acid will give it a red colour; and soaking it in ammonia renders it whiter than it already is. Bronze painted with a thin solution of equal parts of sal-ammonia and oxalate of potash, in a warm room, or in the heat of the sun, gives it a fine green colour, particularly if rubbed with it. If a dark blackish bronze colour is required, the foregoing solution is laid on in a room where some liver of sulphur—sulphuret of potassium—is dissolved in water, and set out in flat dishes to generate sulphuretted hydrogen, which will cause a uniform blackish brown colour on bronze or brass. The foregoing receipts answer for brass as well as bronze. When the desired colour is obtained, the object is washed in clean water, dried, and then rubbed with a brush and wax. The bronze for the latter operation is heated, but not so much so as to burn the wax.

Bronze colour is imparted to other castings besides brass and bronze, by paint. Cast iron may be bronzed

by dipping it in a thin solution of sulphate of copper, or muriate of copper, and when sufficiently covered with copper, it is washed and painted with oil varnish. All objects to be bronzed may, however, be painted of any colour, either a shade of green, from the faintest to an almost black green, or of a blue or bluish green. The paint cover should be coated with pure varnish, and when that is nearly dry, a metallic powder is dusted over it by a dusting-bag, or rubbed on by the fingers, a linen pad, or a paint-brush. The metallic powder is generally mosaic gold, which is made of almost every shade, and is of great beauty; or it may be copper in powder, gold leaf, silver leaf, and similar articles; dry paint of a convenient shade may also be used. The highest parts of the articles are generally bronzed so as to appear as if rubbed and worn by use. Over the whole of these, a last coating of spirit varnish is laid on.

The gilding of bronze and brass castings is performed, in the dry way, by making the surface perfectly smooth, then brushing it over with an amalgam of gold, and dissipating the mercury by heat, which leaves a durable film of gold over the surface. This surface may be burnished or deadened. The amalgam is made by heating one part of gold, in

thin laminæ, in a crucible, and when it becomes faintly red, pour over it eight parts of mercury, pour the combined gold and mercury into cold water, and squeeze the surplus mercury out. The amalgam is then enclosed in canvas or chamois leather, and some more mercury pressed out; the remainder will contain one part of gold to two parts of mercury. This amalgam is rubbed over the objects to be gilded: it may be had in its true composition from the gold mines of Virginia, and of the best quality from North Carolina. It is advisable to brush the brass over with a thin solution of nitrate of mercury and some free nitric acid, as this facilitates the adherence of the amalgam. The gilt and burnished articles may be coloured by a simple process to any shade from a bright and crimson red to a violet and deep blue, by being submerged in a bath of caustic potash in which some metallic oxide is dissolved, but, as a galvanic process is to be applied here, it is beyond our province to describe it. There are other methods of gilding which, for the same reason, must be excluded.

Iron may be gilded by brushing it over with a solution of gold in sulphuric ether. The iron is to be bright and polished, and the gold rubbed on by the burnisher. This is not very durable gilding.

Tinning of brass, bronze, and copper, is done by washing the surface of the cast with very diluted sulphuric acid, after which, wash in water, and scour with sand. The object is then heated to the melting point of tin, and the tin, having been previously melted, is rubbed over the surface by means of a damp rag or piece of oakum, first covered with rosin, to protect the tin against oxydation. Cast iron must be turned or filed, so as to offer a clean surface, before it can be tinned. A solution of tin, as muriate of tin, mixed with an equal part of sal-ammonia, if brushed over the metal, will highly facilitate the operation of tinning. A more convenient mode of tinning than the above, is to plunge the object to be tinned in a solution of tin and caustic potash, which solution is to be as hot as it can possibly be made. Such a solution of tin is made by dissolving oxyde of tin—putty of tin—in potash ley, adding to the saturated solution some metallic tin, in the form of filings or shavings of tin. A few minutes are sufficient to cover brass or copper with tin.

Zinking of copper or bronze may be done by exposing the objects to the fumes of zinc. On copper castings, it is often desirable to have some parts of a golden or yellow hue, which may be done by

exposing those parts to the fumes of zinc. A very perfect coating of zinc may be obtained by placing the objects, well cleaned, in a solution of chloride of zinc, in which a surplus of metallic zinc is present. Chloride of zinc is made by dissolving zinc in muriatic acid, always having so much zinc in the acid, that some of it will remain undissolved. Zinc dissolved in sal-ammonia is as efficacious as the foregoing.

Glazing of metal castings, or coating with enamel, is very little practised, and will hardly ever amount to a lucrative operation. Iron to be coated with an enamel is first well cleansed by means of acid and scouring with sand. It is then uniformly covered with the enamel, which has been previously prepared or melted, finely ground, and mixed with water for the purpose of laying it on. This operation is very little practised, as it is very expensive and the product is not durable. It has been, and still is used for covering the interior of cooking utensils to prevent their cooking black. A better means to accomplish this object in a cheaper way, is the application of cast iron, which contains a little phosphorus, and not too much carbon, as has been previously remarked. More recently, a new invention, that of covering iron with transparent glass, and also with coloured

glass, has made its appearance in England. Serious doubts, however, may be entertained as to its ultimate success. Iron coated with enamel or glass can never be brought to a successful competition with porcelain either in beauty or price.

Blackening of iron casts is either done with black-lead, moistened with alcohol, or, in many instances, with spirits of turpentine. This is laid on by a brush, and rubbed until the blackening is dry, and assumes a metallic lustre. This is the blackening used for stoves. If the object to be blackened is a little warm, the operation works better and much more quickly.

Fine ornamental castings are heated to the blue annealing heat, and then covered with black copal varnish, and dried at the same degree of heat. The heat takes most of the gloss of the varnish off. The copal varnish is then blackened by an admixture of finely rubbed lamp-black, or printers' ink, or, still better, by finely ground pure bone-black. Larger castings are blackened with common black paint. A rich lead-colour may be imparted to castings by an oil paint, made of fine litharge gently heated in an iron pan, and, when hot, some flour of sulphur finely and uniformly sprinkled over it under constant stirring. The resulting sulphuret of lead assumes a

rich lead-colour, which is not altered by oil or the atmosphere.

Grinding of cast iron is resorted to where any smooth, polished surface is required. It is done on large, fast-revolving sand or grind stones. Cast iron is generally hard on its surface and sandy, so that it would require too much labour to file it, besides wearing out too many files. Machine castings are planed or turned by proper machinery.

Malleable cast iron, an article now very much in use for carriage and harness furniture, and various other purposes, is made of the best kind of No. 2 charcoal pig. Where the foundry scraps are of a good quality of iron, they are preferable. A good article may be made by mixing No. 2 and No. 3 iron. Any pig iron which makes good bar iron will make malleable iron. Most of the malleable iron is cast from the cupola, but the crucible makes better castings of the same material. The cast articles are tempered in an iron cylinder, and imbedded in fine fresh river sand, or finely pounded iron ore, or black manganese, or a mixture of the whole of these materials. An exposure of the hardest cast iron, if pure, from twenty-four to thirty-six hours to the fire, will render it malleable to a certain degree. When tempered, the articles are put in a revolving iron barrel

together with some sand, to be cleaned and polished, to a certain extent, by rubbing one against the other. This malleable iron is particularly qualified for being tinned, or plated with brass or silver. For the silvering of iron, a process has been lately recommended which appears to be valuable: it is performed by means of galvanism. The iron article, well cleaned and freed of all oil and grease, is immersed in a solution of silver, and connected with the zinc pole of a galvanic battery; the copper pole is connected with a platinum plate placed in the solution at some distance from the cast iron. The silver solution consists of cyanide of silver. It is made by putting cyanide of potassium in a well-corked vessel, together with freshly prepared chloride of silver; the whole is then covered with water and violently shaken. It is advisable to use an excess of chloride of silver, and if a little remains undissolved, add a few pieces of cyanide of potassium. A little chloride of silver ought to remain after all the cyanide is saturated. This solution is filtered, to render it perfectly clear, and is then ready for use. It is said that a few minutes' time is sufficient to cover a large surface of iron with silver.

250 MOULDER'S AND FOUNDER'S POCKET GUIDE.

TABLE I.

Weight of a lineal foot of cast-iron pipes in pounds.

Diameter of bore in inches.	Thickness of metal in inches.							
	$\frac{3}{8}$	$\frac{1}{2}$	$\frac{5}{8}$	1	$1\frac{1}{8}$	$1\frac{1}{4}$	$1\frac{3}{8}$	$1\frac{1}{2}$
2	8.8	12.3	16.1	20.3				
2 $\frac{1}{2}$	10.6	14.7	19.2	23.9				
3	12.4	17.2	22.2	27.6	33.3	39.3	45.6	
3 $\frac{1}{2}$		19.6	25.3	31.3	37.6	44.2	51.1	
4	14.2	22.1	28.4	35.0	41.9	49.1	56.6	64.4
4 $\frac{1}{2}$	16.1	24.5	31.4	38.7	46.2	54.0	62.1	70.6
5	18.0	27.0	34.5	42.3	50.5	58.9	67.6	76.7
5 $\frac{1}{2}$	19.8	29.5	37.6	46.0	54.8	63.8	73.2	82.8
6	21.6	31.9	40.7	49.7	59.1	68.7	78.7	88.8
6 $\frac{1}{2}$	23.5	34.4	43.7	53.4	63.4	73.4	84.2	95.1
7	25.3	36.8	46.8	56.8	67.7	78.5	89.7	101.2
7 $\frac{1}{2}$	27.3							
8	29.0	39.1	49.9	60.7	72.0	83.5	95.3	107.4
8 $\frac{1}{2}$	30.8	41.7	52.9	64.4	76.2	88.4	100.8	113.5
9	32.9	44.4	56.2	68.3	80.8	93.5	106.5	119.9
9 $\frac{1}{2}$	34.5	46.6	59.1	71.8	84.8	98.2	111.8	125.8
10	36.3	49.1	62.1	75.5	89.1	103.1	117.4	131.9
10 $\frac{1}{2}$	38.2	51.5	65.2	79.2	93.4	108.0	122.8	138.1
11		54.0	68.2	82.8	97.7	112.9	128.4	144.2
11 $\frac{1}{2}$		56.4	71.3	86.5	102.0	117.8	133.9	150.3
12		58.9	74.3	90.1	106.3	122.7	139.4	156.4
12 $\frac{1}{2}$		61.3	77.4	93.6	110.6	127.6	145.0	162.6
13			82.7	101.2	118.2	137.4	154.1	173.5
14			89.3	108.2	126.5	146.2	165.3	185.2
15			95.2	115.7	135.3	156.2	176.2	198.1
16				123.3	143.1	166.1	187.5	211.3
17				130.2	152.5	178.5	198.2	223.4
18				137.0	161.2	185.3	209.1	235.6
19					169.2	195.7	222.3	247.1
20					178.1	205.2	233.2	259.0

N. B. The two flanges of a pipe are considered equal to the weight of one foot in length.

TABLE II.

Dimensions of cylindrical columns of cast iron to sustain a given load with safety.

Diameter in inches.	Height in feet.											Weight in cwt.
	4	6	8	10	12	14	16	18	20	22	24	
2	72	60	49	40	32	26	22	18	15	13	11	}
3	178	163	145	128	111	97	84	73	64	56	49	
4	326	310	288	266	242	220	198	178	160	144	130	
5	522	501	479	452	427	394	365	337	310	285	262	
6	607	592	573	550	525	497	469	440	413	386	360	
8	1333	1315	1289	1259	1224	1185	1142	1097	1052	1005	959	

N. B. If the columns are hollow, the area to the given diameter is to be converted into the ring, or the difference of the outer and inner diameters multiplied by $\frac{3}{8}$, because hollow cast-iron columns are stronger than solid ones in that proportion.

TABLE III.

Showing the tenacities, and resistances to compression, of various simple metals and alloys.

METALS AND ALLOYS.	Tenacity. A bar of one inch square section, will be torn asun- der by	Resistance to Compression. One square inch will be crushed by	Resistance to Torsion.
	Pounds	Pounds	
Cast Iron	15,000 to 30,000	86,000 to 100,000	9.0
Copper, Wrought	33,000		4.3
Malleable Iron	56,000 to 70,000		10.0
Lead	1824		1.0
Steel	120,000 to 150,000	200,000 to 250,000	16 to 19
Tin	5000		1.4
Zinc	9000		
Common Brass	17,900	10,300	4.6
Swedish Copper 6 parts, Malacca Tin 1 part	64,000		5.0
Chili Copper 6 parts, Ma- lacca Tin 1 part	60,000		
Common Block Tin 4 parts, Lead 1 part, Zinc 1 part	13,000		
Common Block Tin 3 parts, Lead 1 part	10,200		
Common Block Tin 3 parts, Zinc 1 part	10,000		
Lead 1 part, Zinc 1 part	4500		

TABLE IV.
Specific gravities of metals and alloys. Water 1000.

METALS AND ALLOYS.	Specific Gravity.	The weight of a cubic inch is in pounds	Number of cubic inches in one pound.	The weight of a cubic foot is in pounds	Melting point in degrees.
Platinum	19.500			1208	
Gold	19.258		1.435	1203	2010°
Mercury	13.500		2.038	843	
Lead	11.352	.4103	2.435	708	612°
Silver	10.474		2.638	662	1873°
Bismuth	9.823		2.814	613	470°
Copper, Cast	8.788	.3185	3.146	560	1990°
" Wrought	8.910	.3225	3.103	555	
Iron, Cast	7.264	.2630	3.806	450	2780°
Steel	7.816		3.530	489	
Tin, Cast	7.291	.2636	3.790	456	442°
Zinc, Cast	7.190	.2800	3.545	449	773°
Gold 90, Silver 2.5, Copper 7.5	17.40				
Gold 66.6, Silver 16.7, Copper 16.7 (Solder for Gold.)	12.40				
Zinc 10.0, Silver 66.6, Copper 23.4 (Solder for Silver.)	9.84				
Bronze	8.48 to 8.94			537	
German Silver	8.48 to 8.57				
Brass	8.4 to 8.5		3.538	537	1900°
Type Metal	9.854			615	
Soft Solder	9.56				
Muscle Metal	7.1				
Water	1.000			62.5	

SUPPLEMENT.

STATUARY AND ORNAMENTAL MOULDING, ORDNANCE,
MALLEABLE IRON CASTINGS, ETC.

By A. A. FESQUET,
CHEMIST AND ENGINEER.

THE various methods for moulding statuary, ornaments, etc., explained in previous pages of this book, have since been considerably modified, especially in large statuary work.

THE WAX PROCESS.

In the so-called "wax process," a true mould is required for taking the wax impressions, if the work is to be done by the men of the foundry. If it be desired to avoid the expense of this mould (generally of plaster of Paris), then the artist himself must be there to model the wax upon the core, or at least to repair the work which may have been made by a skilled assistant.

Although inconvenient and expensive, this is the least disadvantage of the process. Let us now suppose that the core and its supporting irons and air-

ducts have received their finished wax covering. This in its turn is covered with a cope of loam, in which are left the necessary channels and gates for running the metal. Drying is the next operation, not only for separating the wax, most of which is absorbed by the material of the mould, but also for thoroughly drying all parts of the mould and core. This heating is always very difficult, especially when the work is large and has an awkward shape, like many equestrian statues. An unequal heat will have the tendency to twist the core irons, and, the core having moved, the thickness of metal will not be the same as was calculated, and it has happened quite often that there have been places entirely bare of metal. Moreover, during the drying of such an unwieldy mass, it is always to be feared that some portion of the cope or core will fall and clog the air passages or the gates for the metal.

When the metal is run into the mould, always supposing a large piece of work, the great weight of fluid matter produces an enormous pressure, and to provide against loss a large excess of metal is to be ready for use.

Even if every thing goes on properly, we have a statue heavier in metal than is necessary, which has cost considerable in moulding, drying and wax, and which is far from being perfect, and therefore requires a great deal of labor for finishing. Indeed, very few are the large statues cast in one piece which have been entirely satisfactory, and which have not been pieced out, plugged, and otherwise carefully mended. An excess of metal is not an advantage, except to the founder when he sells his

work by weight. A thinner metal produces sharper casts. On the other hand, there must be sufficient metal to resist the shocks incident to transportation, to support its own weight, and to stand for ages the exposure to the atmosphere

ACCIDENTS.

In case of accident, it may happen that the injury is partial only, and may be remedied. But, as generally the pattern has been destroyed, the aid of the sculptor is needed. If the failure be complete, then we have to begin anew—sculptor, moulder and founder alike.

FINISHING.

The finishing of the casting is also difficult, since there is no pattern to guide the operator in reproducing faithfully the artistic inspiration of the sculptor. In olden times, the sculptor was also the moulder, founder and finisher. In our time, all these operations have become specialties, and a pattern must remain constantly at hand until the work is finished. Thus, in this manner, a sculptor may remain at Rome, and, after having sent his plaster pattern, the subsequent operations of moulding, casting and finishing, may be performed at any place where there are the skill and the implements necessary to reproduce the idea of the artist as represented by his pattern.

PHILADELPHIA BRONZE STATUARY.

Philadelphia, for several years past, has been foremost on this continent in the manufacture of large bronze statuary, and the work begun by Messrs Robert Wood & Co., is now continued by Messrs. Bureau

Brothers & Heaton, who were formerly with Messrs. Wood & Co.

THE NEW OR FRENCH SYSTEM.

The new system, also called "the French system," is not entirely new, since it is followed nearly everywhere with but slight modifications. It is based on the following principles: To keep the pattern, whether it be made of metal, plaster, wood, terra cotta, wax, or of any material able to bear the handling, during the whole operation; to cast in flasks and in sand, this material being substituted for the loam of the core and cope; and to cast a statue, for instance, in as many pieces as is needed, and to unite them afterwards to make up the whole.

OBJECTIONS AND ADVANTAGES.

A great many objections have been made to this mode of piecing, and we will indicate some of them in order to refute them. It has been said that no such skill is needed for casting part of a statue as for a whole one. That is true; but what is the advantage of a more skillful and difficult operation, if the results are not superior, and the costs and risks are greater? In the old process by wax, the castings were generally inferior in soundness to those made by the new method, and an accident to a portion of the work was often sufficient to cause the loss of the whole, and, moreover, no pattern was left. In the new process, an accident to the part is more easily repaired by burning or otherwise; and, if no repairs can be made, that part only is begun anew, with the preserved pattern.

The other great objections are the numerous

seams to be seen at the junctions of the different parts, the difficulty of making these parts agree when brought together, the supposed lack of strength at the joints, and the greater labor in finishing. To this we answer, that with the precautions which we shall indicate further on, these seams can be made invisible. The parts will agree when brought together, if there is no giving way of mould or core, and this is more readily obtained with small than with larger pieces. The joints are not so strong if pinned or screwed, as if they were a solid casting; but we will show, in explaining the process, that they can be made strong enough, and more, for all purposes. As for greater labor in mounting and finishing, it has not been proven so. The time spent in pinning and screwing the pieces together is more than counter-balanced by the gain in general repairs, since the different pieces are generally sounder than if the whole statue, for instance, had been cast without joints.

There are some other advantages in the new process: The casting in sand gives better impressions, the flasks and cores are more easily dried and repaired, if need be; the transportation of an equestrian or large statue is more easy in pieces than in whole; the thickness of the metal may be regulated to a nicety, so much so that a prancing steed, with or without a rider, may be made to stand on its hind legs, without the necessity of impaling it upon a stump for support. It is quite sufficient to put most metal where the strain is greatest.

PRACTICAL PROCESS.

We now pass to an explanation of the practical

THE MOLDER'S AND FOUNDER'S POCKET GUIDE.

process said, and we will suppose that we have to make a small cast in brass.

The pattern sent to the foundry is generally of plaster of Paris. It may be reproduced whole in metal, but the working will be difficult, and the casting will be liable to be made in parts. Moreover, the flasks and cores will need to be of such dimensions, that few founders will be able to bear the expense of such a job. We have then to divide the pattern in the most convenient manner for moulding and finishing.

There are no general rules; but, if practicable, the joints will be made at the junction of the flesh with the flange, or at a seam, a belt, etc. If, on the contrary, the dimensions of the flasks, a better distribution of the cores, or any other reason requires the joint to be made elsewhere, it is made there, and the junction will be hidden afterwards when mounting the pattern.

SEPARATING THE PARTS OF THE PLASTER PATTERN.

When the founder, after a thorough examination of the pattern, has determined the places of separation, he cuts the plaster with small saws resembling those named "key-hole" saws, or with a very handy instrument made of two brass or iron wires twisted together in long twists. This twisted wire has no frame to support it, and it is simply held by the hands, and a to-and-fro motion given. The pliability of the wire makes it adapt itself to curved surfaces, and the cutting away of the plaster is quite rapid.

TENONS AND MORTISES.

The next operation consists in providing the portions of the pattern thus cut, with the different tenons

and mortises needed for fastening the various castings together. Thus, the pattern, if not hollow already, is hollowed out for the mortise, and a plaster tenon added to the corresponding piece, a neck or an arm, for instance. The joint of the tenons and mortises need not be made as tight and perfect as a corresponding work in joinery; a certain amount of "play" or looseness being desirable. Where the plaster pattern is large and hollow, like the body of a horse or the trunk of a man, it is well for the preservation of the pattern, and for the facility of handling, to support it internally with cross pieces of wood, which are fastened with plaster of Paris.

THE FLASKS.

The flasks used in statuary work are generally of large dimensions, are made of cast iron, and have a very near resemblance to those used in cast iron foundries. The metal is perhaps thicker, the joints are planed, and the pins and fastenings are also made with more care, for the sake of greater accuracy. Unless the flasks are small, no cast snugs or swivels are employed, but, instead, movable wrought iron bars are passed or bolted through thick projecting ears cast with the flask at the corners. The traverses are also movable, and various holes are left on the sides for screwing or bolting irons of various lengths for the purpose of sustaining the sand.

THE COPES.

In this kind of work, it is difficult to preserve the difference between the drag and the cope, since both flasks are alternately the one and the other; we shall therefore call both of them copes, since the outside

reproduction of the pattern is made in them. The core will be, as usual, the representation of the hollow *inside* of the pattern, and by contradistinction, we shall call "false cores" the separate pieces beaten or rammed into the hollows *outside* of the pattern.

THE MOULDING.

For beginning the moulding work, we bury about one-half of the pattern in the sand of a flask, work the sand well into the cavities with the fingers, and fill the remainder of the flask with sand, which need not be of any particular quality. The ramming is not hard; all that is needed is to obtain a basis sufficiently firm to prevent any motion of the pattern and to bear the moulding operations above it. The only rule for the disposition of the pattern in the flask is to give it that position which is the most advantageous for the ramming in and withdrawal of the false cores, and for the subsequent removal and fastening of the real core. For instance, if we are moulding the trunk of the body of a man, it may happen that the disposition of the draperies or of the arms will make it more advantageous to dispose the pattern slantingly or sideways, instead of flat upon its back or its chest.

The supporting body of sand need not terminate in a plane surface, flush with the top of the flask; on the contrary, it is raised or depressed to follow the configuration of the pattern in the direction most suitable to the work. The only condition required of this unequal surface is that there should be no undercut portions to prevent the smooth union or separation of the two flasks.

When this surface is equally smooth and pressed, it is well dusted with charcoal and parting sand to prevent the adhesion of the pieces moulded above it. Now begins the real work. The rule is to begin by the hollows on the surface of the pattern, and, when the work allows it, to start from the surface of the flask around and up the pattern, like a bricklayer or mason building an arch over an irregular shaped vault.

THE FALSE CORES.

This covering up of the pattern by a greater or less number of false cores, is sometimes very difficult when the recesses are deep and do not deliver. For instance, let us suppose that the fold of a drapery resembles about one-half of the figure 8. The sand rammed into it cannot be removed from the contracted part. If the curve enlarges sufficiently above or below, it may be possible to slide the false core out. The best plan is to lay a piece of paper or muslin against one-half of the curve, and ram a false core against it, thin enough to pass through the opening. After dusting with charcoal, and using another piece of paper or muslin over that partial core, fill the cavity by ramming in a new quantity of sand.

We have thus two different false cores, one over the other, and we are still in about the same predicament as before. But in this case we may cut where the opening is largest a small portion of one of the superposed false cores, and withdraw it between the ends of two spatulæ or with steel wires, pointed or hooked. This leaves an opening through which the other portions of the same false core may be

slidden out, whole or in parts; and by at the same time pulling at the paper or muslin upon which they rest, their withdrawal is considerably facilitated. The removal of the other false core is now comparatively easy, especially with the aid of the paper or muslin.

If the plaster partition forming this awkward shape is thin, it may be sometimes more advantageous to knock it off before removing the false core. The plaster removed may be afterwards cemented again upon the pattern with a diluted magma of fresh plaster of Paris.

These small false cores are often so small and so thin that they require the greatest care and delicacy in handling. As soon as they are removed from the pattern, they are glued together with a small smooth brush dipped in flour paste, and pinned with iron wires to their backing of sand. Thus, each one of the various false cores covering the pattern is composed of portions more or less indented, strengthened with a thick backing of sand. The thin portions, if slender, and projecting considerably, are united to the thick ones by wire and flour paste, and when the latter is used, the union is better insured by scraping off carefully the charcoal dust. Slight repairs are made with paste and sand pressed down with a spatula. As the false cores have to be lifted out several times during the operation, the backing itself is strengthened with iron wires buried in them, and which have generally the shape of the letter S. Lifting hooks are also inserted in those false cores, which form the keystones of the arch above the pat-

tern. These hooks are made flush with the surface of the false cores, and in order to reach them some sand is scooped around them. It is needless to say that all these false cores are separated one from the other by a parting of charcoal dust. Their upper surfaces may be very irregular in shape, although care is taken that it presents no undercut parts.

THE OPENINGS OR GATES FOR THE ENTRANCE OF THE METAL.

While these false cores are being built up, the founder disposes the openings or gates for the entrance of the metal. This operation requires a great deal of judgment and practice on the part of the founder, as it is considerably influenced by the shape of the pattern. However, as a rule, it is preferable to have small and numerous gates than a less number of a large size. The gates may be three or four times as wide as they are thick, and this thickness should not be much over that of the intended casting. The main troughs for running in the metal and furnishing it to the gates are, of course, larger, and are generally built outside of the false cores; for instance, in the parting surfaces of the two flasks. Branches often go around the pattern.

For facilitating the finding of the proper places of the various false cores, when after being removed, they are again put in position, some of them are marked with warts or hollows, which reproduce afterwards corresponding hollows or warts in the sand filling of the upper flask.

THE SANDS USED, ETC.

In the making of these false cores, the sand is ap

plied as follows: Finely sifted fresh sand is pressed with the fingers against the pattern, and afterwards rammed with wooden mallets of various sizes, and having the shape of a truncated cone. The backing need not be of so fine a texture. The fresh sand applied next to the surface of the pattern is at Philadelphia, a mixture of $\frac{1}{2}$ Fontenay aux Roses, $\frac{1}{4}$ Richmond, and $\frac{1}{4}$ Lumberton sands. The Fontenay aux Roses (near Paris) sand, is of such a peculiar open nature, that however fine and well-rammed it may be, it still remains porous; and we must observe that all the false cores in statuary are rammed considerably harder than is usual in ordinary foundry work. On the other hand, the Fontenay sand is not sufficiently refractory by itself to stand the heat of a large body of molten metal, and it becomes necessary to associate it with other sands richer in silica. Richmond (Philadelphia) sand comes next in fineness, and the Lumberton, N. J., sand is the coarsest of the three.

We omitted to say that before ramming the false cores upon the pattern, the extremities of the latter are closed by heavy core prints of sand, which will furnish a solid basis for the ends of the true cores, when these are formed.

We have left the upper one-half of the pattern entirely covered with its false cores. The upper flask is now put in place, parting sand or charcoal dust is sifted upon the work done, and the flask is filled flush with ordinary foundry sand, rammed in, and maintained by iron jiggers suspended from the traverse bars, and by other irons screwed on to the sides of the flask.

TURNING THE FLASKS OVER.

The two joined flasks are then turned over, the upper flask becoming the lower one, and conversely. The comparatively loose sand which has been used for steadying the other half of the pattern is removed, and also the flask. This second half of the pattern is treated in exactly the same manner as we have explained for the first half, and the upper flask is again put in place, filled with rammed sand, etc., etc.

REMOVING THE PATTERN, ETC.

The moulding proper is now finished, and we have to remove the pattern, and make things ready for the preparation of the real core. We shall call flask No. 1, the upper one, and flask No. 2, the lower one; both of them are copes. Flask No. 1 is now raised gently and turned over in some convenient place in the foundry. Nothing comes with it except the last filling of sand bearing the impressions and marks left by the false cores. These in their turn are lifted one by one, and carefully placed in their respective places in flask No. 1, which becomes a hollow mould for beginning the real core.

This hollow mould in flask No. 1 is carefully examined to see that everything is right, and it is painted over with a smooth brush dipped in a dilute solution of flour paste, holding fine charcoal in suspension. It would be difficult to apply dry charcoal dust in deeply undercut parts. The openings of the gates are plugged with cotton wadding, and those cavities which are too narrow for the introduction of a real core are filled with sand, simply pressed by the

fingers, and a parting of charcoal put upon them. This preparatory filling of small cavities is not absolutely necessary, since, if filled at once with the sand of the real core, they may be separated when the latter is pared down and removed.

REQUIREMENTS FOR AN INSIDE OR REAL CORE.

It is required of a good inside (real) core that it should be sufficiently porous to allow for the escape of the air and gases. It should be firm enough to resist the pressure of the fluid metal, and at the same time yield somewhat to the contracting effort of the metal when it hardens and cools off. These conditions are fulfilled with a somewhat coarse sand and no hard ramming. The Philadelphia practice is to use a mixture of Lumberton and Richmond (Philadelphia) sands for the outside of the core, and coarse Lumberton for the inside. The first layer of sand is applied with the hands, and with a gentle pressure; and before filling with the coarser sand, the supporting irons are to be put in place. The sizes and dispositions of these irons vary with the dimensions and shape of each pattern. Rods and bars are bent to shape, and are fastened by means of wires. For a large pattern, the binding with wires is not sufficiently strong, and the welding of large bars is too troublesome. For instance, we have to prepare the true core of the lower part of a man's body. Each leg will need a stout iron bar, and each bar may have a different bent, but they will meet somewhere at an angle, and a firm union must be made there. We may operate as follows: The two bars are connected with wire, and a kind of hollow well is built of core

sand all around where the union is to be. This well is then filled with molten zinc, which, in cooling, firmly unites the two bars. Lead, or ordinary tin solder, is too soft and yielding for this purpose.

AIR AND GAS PASSAGES.

While the core is building, air and gas passages are provided, and are filled with tallow candles. This prevents the crumbling in of the sand, and the tallow will be melted during the drying process. The connection of these air passages with the outside of the flask is made by means of brass tubes, or wrought iron gas pipes.

FINISHING THE TRUE CORE.

When the true core has filled flask No. 1, we go to flask No. 2, and cover it with a new flask, No. 3. The latter is filled with sand, rammed no tighter than is necessary to support the second mould and the pattern when turned over. A board is put over flask No. 3, which is joined to No. 2, and the whole is turned over, so that No. 2 becomes uppermost, and is treated in the same manner as we have explained for No. 1. But, in this case, instead of making the transfer of the false cores to their respective places in flask No. 2, we take these false cores from the periphery, beginning at the base, and build them over flask No. 1. The real core is continued layer by layer, and, as it approaches completion, the sand is gently pressed with the fingers against the topmost false core.

The moulding of the real core is now finished entirely upon flask No. 1; one-half is inside of this flask, and the other half outside, but is covered with false cores belonging to flask No. 2.

TO REMOVE THE TRUE CORE.

To remove the true core, we proceed as follows: The false cores on top are transferred to their respective places in flask No. 2, and fastened there. The true core is then pared down to the desired thickness of metal, by scraping enough sand from its surface by means of a steel spatula, flat or curved. Sometimes, when great accuracy is desired, small holes are drilled at various places through the sand, by means of a drill provided with a stop adjusted to the proper thickness. These holes indicate how far the scraping off of the sand may proceed. When the upper half of the true core is thus scraped, flask No. 3 comes again into use for supporting it, when flask No. 1 is turned uppermost. The latter is afterwards removed, and the false cores are transferred to it, leaving the remaining half of the true core to be reduced or scraped down to the proper thickness, as indicated before. The true core is now ready to go into the drying-room or stove.

FASTENING THE FALSE CORES WITH WIRES.

During the last transfer of the false cores to their proper places in flasks Nos. 1 and 2, it is necessary to fasten them to the sand filling with iron wires passed through them like nails. But, as the sand of the false cores has hardened, it becomes necessary to drill the holes with long and narrow gimlets, revolved by rubbing them between the hands. The wires, heavily coated with flour paste, are then passed through these holes, and are fastened flush. In some cases, as when false cores have been formed between the legs of animals, or between a limb and outside

draperies, etc., they would prevent the placing of the true core, if they were made fast in the flask. Such false cores are therefore let loose, and are slidden into their places only when the true core is put into the mould before casting.

When the false cores are completely fastened and repaired, wherever there is a joint for two connecting pieces cast separately, we scrape off a little of the sand at the edge, so as to obtain a kind of lip all round the joint of the casting. This excess of metal will allow us afterwards, in mounting, to correct any irregularity in the casting, and to make a perfect and invisible joint.

INTERIOR COATING OF THE MOULD.

Before going to the drying room, the whole interior of the mould receives the following coats: First, one of water, holding flour paste and charcoal dust; second, one of charcoal and molasses; and third, one of whale oil. A smooth brush is used.

DIVIDING THE PATTERN.

All the moulding operations are now finished, and we will add that, although it is desirable that the moulder should be able to divide a large pattern into its separate pieces, it is still preferable that he should communicate beforehand with the artist, and that they should agree together as to the best way to cut up the model. In this manner the plaster pattern, made from the clay model, is from the start cut into its separate pieces under the supervision of the artist, who may make the necessary repairs

DRYING THE MOULDS.

The drying of the moulds and cores must be thorough, at the temperature necessary to remove all dampness. We may cast brass and bronze in green sand, which has been slightly rammed; but, in the previous operations, the moulding sand has been so tightly compressed that it must be perfectly dry, otherwise there is bodily danger. Moreover, the castings of bronze and brass are not so sharp in green as in dry sand.

The moulds, when out of the drying room, are carefully examined; all the dust is blown or brushed away, and a coat of oil is laid upon the small cracks produced while drying.

TEMPERATURE OF THE MOULDS.

For casting, the moulds should not be too cold, otherwise they will attract the dampness of the atmosphere, especially in murky weather. Neither should they be too warm, because any lurking dampness will hang as steam in the mould. Before closing the moulds, a heavy coat of flour paste is laid on the sand of the lower flask, just next to the metal of the flask; this makes a tight joint when the two flasks are fastened together.

PRESSURE.

A certain amount of pressure from fluid metal is advantageous, but not an excess. For large patterns, the flasks may be tilted or inclined from twenty to twenty-five degrees over the horizon. Smaller patterns may be inclined more. When the outside runners have begun to harden the flasks are loosened

somewhat, and if the casting is considerable, its removal is postponed until the next day.

REPAIRING ACCIDENTS.

We will now suppose that some accident has happened by which a small portion only of the casting is defective. If the position of the defect allows of it, the repair will be done by burning, that is, by placing the casting upon sand moulded to the proper shape, and by allowing a pot of hot metal to run over the defect until there is a thorough welding between the sound part and the new one. If the shape of the casting forbids this process, then the defective portion is cleanly cut off with the chisel, and a new piece is cast in a mould, taking care to form lips (as already explained) all around the outside edge of this new piece. For the smaller repairs, and the screws, pins, and plugs necessary in mounting, the founder casts rods of various diameters, and of the same metal used for the other large pieces.

MELTING THE METAL.

Small articles are cast from crucibles. Large castings may also be obtained from metal melted in a number of crucibles heated at one time, and the contents of which are united in a large pouring ladle. But, in the latter case, it is preferable to use a reverberatory furnace. A cupola has sometimes been employed for melting large quantities of brass and bronze, and it has been found that the copper alloy was improved when a few charges of cast iron had been previously passed through the furnace. The operation is cheaper in the cupola than in the rever-

beratory, but it is difficult and uncertain to obtain with the former an alloy of constant composition.

MOUNTING OR JOINING THE PARTS OF A STATUE.

The mounting or joining of the different component parts of a statue, for instance, comprises also the repairs, the finishing, and sometimes the bronzing. It is not a merely mechanical operation, and the finisher must have sufficient art education to be able to follow faithfully the sentiments of the sculptor as represented by the pattern under his eyes, and to supply what may be missing. When the casting has been separated in the foundry from its runners, core sand and irons, the oxide of its surface is removed by sulphuric or muriatic acid, to which a small proportion of nitric acid is sometimes added. As soon as the surface is clean and bright, the casting is thoroughly rinsed in water, dried, and brought to the mounting room. The excess of metal at the joints and runners is chiseled off. The small defects and pin holes are plugged with rods of the same metal, used as screws or plugs. The latter are preferable, since they may be riveted down so as to leave no joints visible. In either case, it is preferable to slightly enlarge the defect with a drill. If the hole goes through the whole thickness of the metal, the plug is made conical and is hammered down tight, with a head still left. This head is partly chiseled off and hammered again, but not so powerfully as before. When the head of the plug is but slightly above the surrounding metal, it is further condensed with a chasing tool, and the final level is given with the file or the chisel. On the other hand, should the hole penetrate a part only of

somewhat, and if the casting is considerable, its removal is postponed until the next day.

REPAIRING ACCIDENTS.

We will now suppose that some accident has happened by which a small portion only of the casting is defective. If the position of the defect allows of it, the repair will be done by burning, that is, by placing the casting upon sand moulded to the proper shape, and by allowing a pot of hot metal to run over the defect until there is a thorough welding between the sound part and the new one. If the shape of the casting forbids this process, then the defective portion is cleanly cut off with the chisel, and a new piece is cast in a mould, taking care to form lips (as already explained) all around the outside edge of this new piece. For the smaller repairs, and the screws, pins, and plugs necessary in mounting, the founder casts rods of various diameters, and of the same metal used for the other large pieces.

MELTING THE METAL.

Small articles are cast from crucibles. Large castings may also be obtained from metal melted in a number of crucibles heated at one time, and the contents of which are united in a large pouring ladle. But, in the latter case, it is preferable to use a reverberatory furnace. A cupola has sometimes been employed for melting large quantities of brass and bronze, and it has been found that the copper alloy was improved when a few charges of cast iron had been previously passed through the furnace. The operation is cheaper in the cupola than in the rever-

body. Those pins are afterwards cut off and condensed in the manner already explained, until their places cannot be seen. The lips or excess of metal cast on the outside periphery of the joints now require the attention of the finisher. The line of junction of the two pieces, which is still visible, is closed by compressing with a chasing tool the two opposite lips toward each other. A ridge is thus formed which is lowered down with the chisel. Another compression of the metal is followed by part of the excess of metal being removed with the chisel, and so on, until the metal is at the proper level, and the joint is invisible. This operation may be done so well that the joint is often made on naked parts, although it is desirable, when practicable, to choose the line of a seam, a girdle, etc. In a similar manner pieces are often put on a defective part, on the holes left by the core irons, air pipes, etc. The pieces are provided with lips for condensing the metal into the joints.

TOOLS REQUIRED.

Chisels, chasing tools, straight and bent files, scrapers, etc., are employed for finishing the casting. A description of the process would be foreign to our purpose, and what we have explained of the mounting operation is intended to show the founder what he should provide for the moulder and finisher.

PATTERNS WHICH MAY BE CAST BY THIS PROCESS.

The moulding process for statuary, which we have tried to explain in its minutæ, allows of the casting of any patterns, however complicated and undercut they may be. It is long in consumption of time, and

expensive in labor, and the work may be considerably simplified if the castings are comparatively small, and are to be repeated several times. In such cases the patterns are preferably made of metal, and of several pieces, if need be, connected with movable pins and screws. The moulding is made in the afore-said manner, but the true cores are prepared in separate boxes of metal, wood, or plaster of Paris. The latter substance is very handy for the purpose, but it is not sufficiently hard for resisting, for a long time, the wear and tear of the wet sand packed in these cores.

HARDENING THE PLASTER—ALUM PLASTER.

The hardness and wearing qualities of plaster may be considerably increased by saturating it with boiled linseed oil or wax, or still better, by using plaster of Paris combined with alum, and prepared as follows :—

First process.—Small lumps of freshly calcined plaster are thrown into water, holding in solution about 12% of alum. When these lumps have become saturated with the liquid, they are removed, dried, and calcined at a dark red heat. After pulverization and sifting, the plaster is ready for use.

Second process. — Powdered raw plaster is thoroughly mixed with about 3% of its weight of finely ground alum, and then calcined, powdered, and sifted.

The first process is more expensive than the second, but the product is better. This alum-plaster requires about 60% of water for its hydration, and the setting takes place in about one hour. This is about one-half of the water required for ordinary calcined

plaster, but the setting takes about three or four times as long. The tenacity and hardness of alum plaster (set) are about 50% greater than those of common plaster, and it takes a beautiful polish.

MOULDS FOR CASTINGS OF WHITE METALS.

When the castings are made of white metals, such as zinc, tin, lead, etc., and their alloys, and they are to be repeated often, the moulds are made of iron, brass, or bronze, and of as many pieces as are required. In order to obtain a good casting, and also to prevent the destruction of the metallic moulds, the latter have their insides smeared with a light coat of oil, or oil and ochre, or water and clay, or ochre and the white of egg, or soot.

ZINC CASTINGS.

Castings of pure zinc contract so much, that they would break if the core were not yielding. On this account the sand cores are not thoroughly dried, and the zinc is generally alloyed with a small proportion of lead and tin. The moulds must be perfectly dry.

SOLDERS.

It is said that a good solder for uniting zinc castings together, is composed of two parts tin and one part zinc. Hydrochloric acid is used for removing the oxide from the surfaces.

Solder for pewter ware.—Lead five parts, tin three, and bismuth one, with oil upon the joints.

Solder for Britannia metal.—Tin ten parts, lead three, and oil on the joints.

MOULDING IN WAX.

If moulding in wax for large pieces has been justly discarded, it may still be advantageously applied for

the reproduction of small and intricate patterns, like those found in the ornamental castings of the Chinese and Japanese. We believe, also, that these people render their metals highly fluid by the addition of a small proportion of arsenic and antimony, which latter metals should be employed very sparingly, since they render the alloys brittle and unsuitable, because dangerous, for vessels used in the kitchen.

PLASTIC CLAY FOR DEEPLY-CUT PATTERNS.

When ornaments or other kinds of castings are to be obtained of a given thickness from a pattern which is deeply cut but not undercut, plastic clay may be used with advantage. The pattern being placed upon a board or any other suitable support, is covered with a flask, and an impression of its upper surface is taken in sand. We then remove this flask, which we call cope No. 1. Another impression is taken with another flask, which becomes cope No. 2. After repairing the sand impressions, if need be, of both flasks, we press with the fingers into the hollow of cope No. 2 a sheet of clay rolled to the proper thickness. If the pattern is intricate, the rolled clay is cut into small pieces, pressed in place, one after the other, and carefully disposed as to their joints, which must be close without sticking together. This is prevented by coating these joints with oil. The clay lining is cut close and flush with the sand outside of the hollow, and for a parting one or two coats of alcohol varnish are given to the surface of the clay. A drag is then filled with sand upon cope No. 2, and the two flasks are separated. For greater security the sand of cope No. 2 is carefully removed down to

the clay, which in its turn is peeled off piece by piece. The drag is then fastened to cope No. 1 for casting. But, in this case, it will be preferable to turn the drag uppermost, in order to have the outside surface of the casting at the bottom, and more free from sullage and runner marks.

BRASS AND BRONZE ORNAMENTAL CASTINGS FOR DOOR
LOCKS, KNOBS, HINGES, ETC.

There are made at the present time of brass or bronze many ornamental castings for door locks, knobs, hinges, etc., which are sharply cast, and are put into the trade with little or no chasing. Some parts are ground and polished by machinery. Very satisfactory results may be obtained from a good pattern and fine sand perfectly dried. The whole of the sand in the flask need not be so very fine, merely that near the pattern. Perhaps the addition of some tripoli to the fine sand will improve the casting, but it will be necessary to experiment with the tripoli, since several kinds found in the trade are not well adapted to the purpose.

In order to force the fluid metal into the most minute parts of the mould, processes of compression or suction have been employed. In the method of compression, the whole mould is placed in a stout metallic vessel which can be made air-tight rapidly, and immediately after pouring the metal. The compression is produced either by an air pump or by exploding a small quantity of gunpowder. This process is too complicated and costly of plant to come into general use.

The suction or vacuum process consists in placing

the bottom flask or mould in connection with an aspirating air pump. The fluid metal is thus sucked into the smallest recesses of the mould. It is said that such moulds are made of a porous, sandy material, which is afterwards baked like bricks, and may be used several times.

OSSEPIA FOR MOULDING SMALL ARTICLES.

Another material sometimes employed for moulding small articles, such as medals, buttons, etc., is the ossepia used in bird cages for the birds to sharpen or clean their beaks upon. This substance is mostly limestone, that is, carbonate of lime, which will lose its carbonic acid if a metal melted to a high temperature is poured into it. One portion of the ossepia is hard, the other is soft, and it is the latter which is used. Its surface is made flat by rubbing it upon a marble or iron slab, and the pattern, which must not be undercut, is pressed into it with the fingers. After withdrawing the pattern, a long but narrow ingate is cut with a knife, and the mould is heated and smoked over an oil lamp. The other part of the mould is a flat fire brick, against which the ossepia is fastened with clamps or binding wires.

If both faces of a medal are to be moulded at the same time, two pieces of ossepia are employed in juxtaposition. In this case, the compression is effected by squeezing the pattern between the two pieces of ossepia until their flat and soft surfaces meet. Then, keeping everything firm, and before removing the pattern, two or three holes are bored through both bones, outside of the pattern of course,

for small wooden pins, put there to insure the proper position before pouring the metal in.

DIFFICULTY OF THE METAL REACHING THE EXTREMITIES IN SMALL CASTINGS.

In small castings it is often difficult for the metal to reach the extremities, either because it has ceased to be fluid, or because the air in the mould prevents its advance. Thus, angles become rounded, a sharp nose becomes a pug nose, fingers are minus their tips, etc. When such accidents are to be expected, the experienced moulder will, with the proper tools, remove some of the sand at such places, so as to give room for more metal; and if, after casting, the nose has a wart at its end, or the fingers have extra long nails, the excess of metal will be easily removed by the chisel and file.

NEW ALLOYS.

These are: *aluminum-bronze*, *phosphor-bronze*, *spiegeleisen*, *silicum-copper*, and *manganese-copper*.

The last two have been introduced into the arts quite recently, but there is so much contradiction in the results obtained that some time will pass before we know anything certain about their practical value.

ALUMINUM-BRONZE.

Aluminum bronze has been employed for ornaments, small statuary, machinery, and philosophical instruments. It is pleasing in color and difficult to oxidize; it can be forged, and it possesses great stiffness and wearing qualities. It would find a great many uses in the arts except for its cost, aluminum

being still an expensive metal, and unnecessarily so, as some persons believe. Several alloys have been tried, but those which have given the best results are copper 95, aluminum 5; copper 90, aluminum 10. For the bearings of very fast-revolving shafts, aluminum-bronze has been found to excel all other alloys. Hardened steel itself had to give way to aluminum-bronze for the small punches used for perforating the holes for separating postage and revenue stamps. It also gives sharp castings. Pure aluminum has also been used for small statuary.

PHOSPHOR-BRONZE.

Phosphor-bronze is also considerably used in the arts for castings, plate and wire drawings. It is generally alloyed, with zinc and tin in variable proportions to suit the wants of the trade. The alloy for statuary is quite fusible, and fills the mould well. Under the file and chasing tools, it is not superior to the ordinary bronze. When carefully prepared, it is homogeneous, and takes a satisfactory bronze color with the chemicals.

For machinery bearings, pump cylinders, etc., phosphor-bronze has acquired a just renown. Its considerable resistance to strains, and its slow oxidization, make it a valuable material for the wire ropes of mines, which are always exposed to dampness, and often to the action of acid waters.

The manufacture of the alloy of copper with phosphorus is a rather delicate operation, which is performed in special establishments. The founder buys the phosphor-bronze in ingots, and prepares his mixtures with it.

This alloy is now gaining favor for cylinder valve-faces, where high-pressure steam is used, and for bearings where heavy pressures are applied. Its component parts consist of copper, tin, and phosphorus, and it is capable of being made tough and malleable, or hard, according to the proportions of the several ingredients. It is rendered so liquid in the molten state by the addition of the phosphorus, that it forms very clean castings.

Messrs. Levi & Kingel, of the Val Benoit Nickel works, near Liege, Belgium, have, for a number of years past, been engaged in making experiments for the purpose of improving bronzes of this kind. The results of their experiments are thus summed up by M. Dumas:

"The color, when the proportion of phosphorus exceeds $\frac{1}{2}$ per cent., becomes warm and like that of gold largely mixed with copper. The grain and fracture approximate to those of steel, the elasticity is considerably increased, the absolute resistance under a fixed strain becomes more than doubled, the density is equally increased, and to such a degree that some alloys are with difficulty touched by the file. The metal when cast has great fluidity, and fills the mould perfectly. By varying the dose of phosphorus the particular characteristic of the alloy which is most desired can be varied at will."

In a series of experiments at the Royal Academy of Industry at Berlin, a bar of phosphor-bronze (proportions of components not stated), under a strain of ten tons, resisted 862,980 bends, while the best gun-metal broke after 102,650 bends.

In Austria the following comparative results have been obtained :

Absolute Resistance.

	Pounds per square inch.
Phosphor-bronze.....	81,798
Krupp cast-steel..	72,258
Ordinance bronze.....	31,792

SPIEGELEISEN.

Spiegeleisen (mirror iron) is an alloy produced in blast furnaces, and is composed of iron, with 8 to 12 % of manganese, and a greater proportion of combined carbon than is found in any ordinary cast iron. Its fracture presents large and shiny facets, which are very hard. It seems to be indispensable in the manufacture of steel by the Bessemer and Siemens-Martin processes ; but, in our case, the founder will have some opportunity in using it as an alloy with other kinds of pig-iron, when the castings require to have a smooth and hard wearing surface, as for steam cylinders, steam valves etc. The more prudent way is to try the mixtures in a crucible, and to cast the sample in the dry sand. The proper degree of hardness is when the metal is difficult to file, and, at the same time, is easily turned and planed.

SNAP FLASKS, PLATE MOULDING, ETC.

In the manufacture of small articles of cast hardware, either plain or rendered malleable, a considerable economy of space and of flasks is effected by using small flasks, which can be opened in such a manner that the moulded sand within may, without disturbance, be left on the casting floor, and the flask used again. Some of these flasks are as large as 2 feet by

2 feet 9 inches, but those most in use are small enough to be easily carried by one man. They are generally made of wood, one of the square corners has outside binges, and the opposite or diametrical corner is provided with a clic fastening which closes with a snap.

When the cube of moulded sand, inclosed within the drag and cope, is deposited on the foundry floor, it is then covered with a thick plate of cast iron, provided with several holes. The weight of the plate compresses the two parts of the mould, and one of its holes is made to correspond with the pouring one in the sand. This hole is then marked with chalk.

The small patterns of wood or metal, and always the latter if the castings are to be numerous, are laid down close to each other, and are fastened upon one or two level plates in the process of plate moulding. If one plate only is used, one-half of the pattern is on top, and the other half underneath. Therefore in moulding, the plate is put between the cope and the drag, and, after the ramming of the sand, the plate is removed, and the two flasks are linked. The objection to the process is that the plate bearing the patterns will warp, and the two surfaces of the flasks will cease to be parallel during the moulding; thence, irregularity of thickness in the castings. It is also quite difficult to fasten the one half of the pattern *exactly* underneath the other half, when they are separated by the plate. The slightest deviation from the true position is reproduced in the casting. These objections are still more evident when two plates are employed, each with one-half of the pattern. With the multiplication of pieces we are very apt to multi-

ply the errors. In fact, the real advantage of plate moulding is when the whole of the pattern is on one side of the plate, or when parts of the pattern are so slender that they would bend, if they were moulded otherwise.

We may avoid the above-mentioned difficulties by proceeding as follows: The pattern is of metal, and is stiff enough to require no backing plate. It may be separated into halves if the shape requires it, and it is provided with the necessary core prints, and the sprues connecting with the pouring hole. We need three flasks: a cope, a drag, and a third one, which we call the supporting flask. Of course the cope and the drag must correspond, and be linked together perfectly; the supporting or third flask may differ, but slightly, from the others. In fact, it is desirable that the three flasks should be so much alike that they may be used together indiscriminately. The first operation is to prepare the supporting flask. The pattern is inverted into the comparatively loose sand of the cope in the position it ought to occupy there. The sand is compressed around it with the fingers and the ramming block, and the surface is well smoothed. The supporting flask is then placed over the cope, parting sand is dusted over, and moulding sand is carefully and strongly rammed over the projecting half of the pattern. Since the sand of the supporting flask will not be used for casting, it does not matter if the ramming has been too hard. The object is to obtain a good bearing or support for the pattern, when the sand of the cope is afterwards and repeatedly rammed upon it.

PREPARATION OF THE MOULD FOR CASTING.

We are now ready for the preparation of the mould for casting. Lay the pattern in its place upon the supporting flask, place the cope upon the latter, dust with the parting sand, and ram the moulding sand to the proper degree of firmness. Sweep off the excess of sand and invert both flasks, the cope being below. Then remove the supporting flask, leaving the whole pattern in the cope. Cover the latter with the drag, dust with parting sand, ram the moulding sand, and sweep off the excess with a flat rule or board. Next, separate drag from cope, rap and remove the pattern and return it to its proper place upon the supporting flask. Before closing drag and cope, examine for defects and repair them, and see that the pouring hole is open and clean. Finally, dust with charcoal powder, link the two flasks, and deposit them on the level floor of the foundry. The flasks, if of the snap kind, are opened, removed, and used again in the same manner. The pouring hole is formed with a wooden conical plug, the smaller end of which is rested upon the sprue of the pattern, while the cope is filled with sand. For small articles, the rapping is not given directly to the pattern, but to an intermediary steel wire screwed into a hole for the purpose. The screwed wire being held in the left hand, is rapped in various directions with an iron or wooden rod. The pattern is then lifted with the same screwed wire.

DOOR HINGES AND SWIVELS OF CAST IRON.

As examples of small castings, we would name the moulding of door hinges and of swivels, made entirely of cast iron. The operation requires two mouldings

and two castings. In the first moulding one-half of the hinge is moulded, and the pattern is made so as to give a full print of the whole length of the barrel, that is to say, the cylindrical part, where the motion takes place. We will suppose that the barrel is divided into three parts, the upper and lower ones belonging to this moulded half of the hinge, and the middle one to the other half to be moulded and cast afterwards. Before closing the flasks, we insert in the middle of the print of the barrel a small sand core, the cylindrical part of which equals in length about one-third of the barrel, and with the ends in the shape of obtuse cones. After casting, the upper and the lower parts of the barrel will each have a conical hollow for fastening the portion of the barrel belonging to the other half of the hinge.

The pattern for the second moulding is larger, since it comprises the whole hinge spread open. When the print is made, the half of the hinge already cast is put into its position in the mould, and the other half is cast. It is probable that the chilling effect of the cold metal upon the new one run into the mould, will prevent adherence; nevertheless, it is more prudent to give a coat of fine parting sand with shellac varnish or drying linseed oil, upon those places of the previously cast half hinge which will come in contact with the fluid metal. Moreover, this parting allows of a more easy closing and opening of the hinge when it is completed.

We operate in a similar manner for the swivel. The smaller part, penetrating the other, is cast first. Then the whole pattern is moulded, and the first part is placed in its prints, after having been coated

with the preparation mentioned above, to prevent adherence.

UNITING OF CAST AND WROUGHT IRON.

We have just been providing against adherence. Nevertheless, it is quite difficult to obtain a complete adherence when it is needed, as, for instance, when we have to unite cast to wrought iron in ornaments, fences, small wheels, etc. The quality of both metals is impaired at the place of contact, and their adherence is by no means certain. Recently, and with some appearance of reason, it has been proposed to tin the ends of wrought iron bars inserted into cast iron. By the action of the hot metal there is produced a tin alloy, intermediary between the cast and wrought irons, and acting as a solder. How much this solder-alloy counteracts the effects of chilling and contraction we are not prepared to answer. We might trust small wheels built with wrought iron spokes, fastened to the rim and nave in this manner, but the security is insufficient for large pieces of machinery.

SMALL SAND CORES.

Small sand cores require to be carefully made, and the wooden core boxes are frequently painted with shellac varnish and lampblack, in order to facilitate the lifting of the cores. The smaller these are, the finer, generally, the sand is required to be, and enough passage for the gases is provided by burying in the sand iron wires, which are withdrawn when the core is pressed. If the shape of the core is too crooked to allow of the pulling out of the metallic wire, this is substituted by a string. The binding

material for the sand is either clay water or about 1 volume of powdered rosin to 30 or 35 volumes of sand, or 1 volume of unbolted rye meal to 12 or 15 volumes of sand. Sometimes, for coarse sand, a mixture of rosin and rye meal is employed. It has also been proposed to use potato starch, which has been previously heated to the temperature at which it is transformed into dextrin.

FITTING OF THE CORE IN ITS PLACE.

The rapping to which the pattern is subjected increases the size of the core prints; therefore, in order to insure a perfect fitting of the core in its place, either the core box should be slightly larger than the core print, or the latter should be slightly smaller than the core box, something like $\frac{1}{32}$ to $\frac{1}{64}$ of an inch, according to the dimensions and shape of the pattern. It is important that there should be no shake of the core when in the flasks.

MALLEABLE IRON CASTINGS

The manufacture of the so-called malleable iron castings, requires a metal in which all the carbon is in the combined state; that is to say, a white metal which parts easily and equally with its carbon in the subsequent annealing operation. A gray casting would be very slow in losing its carbon, and the metal would be honey-combed at those places where the uncombined or graphitic carbon was present. The metal preferred for such castings is a mottled pig, which is run with an admixture of scraps from the cupola. When a still better metal is desired, the pig iron is melted in pots, or in a reverberating furnace, and it is poured out when it has lost a certain amount

of its carbon. The proper time is ascertained by taking samples of the molten metal now and then, and casting them into small cylinders about five inches long and one inch in diameter. Two such cylinders are cast at the same time, one is allowed to cool slowly in the sand, and the other, while red hot, is cooled in water. The metal is ready for casting when the fracture of the cylinders is slightly mottled for the one cooled in sand, and nearly white for the other chilled in water.

The shrinkage of such white metal castings is greater than that of the same articles made of gray iron. A rough average is $\frac{1}{4}$ inch per foot.

CUPOLAS.

We see no change in the general description and principles of cupolas as described in previous editions of this book, although numerous inventors have brought forward modifications in the shape and dimensions of the furnace. Some give it an elliptical or conical section; others increase the number of the tuyeres or surround the cupola with a casing in which the blast may be heated, etc. It has been found in cupolas, the same as in blast furnaces, that in order to be effective, the hot blast must be very hot. Then there is a real economy of fuel. But the establishment of hot air stoves does not pay for cupolas because the work of the latter is intermittent.

BLAST.

A steam blast, similar to that employed on locomotives, has been applied to cupolas. That is to say, a jet of steam is made to escape at the top of the furnace, and the vacuum produced causes the atmos-

spheric air to enter the cupola through the tuyeres. In this process, the amount of steam used is about equal to that needed for the motor of the fan. The saving is in the fan and the machinery to move it. The pressure of the blast is weak.

A better understanding of the principles of combustion, and of the best place for the greatest temperature in the furnace, has led of late years to the introduction of blast at a greater pressure than it is possible to obtain with the ordinary centrifugal fans. These latter, no matter how fast they are revolved, cannot give more than a certain amount of pressure. Other blowers, on the contrary, have their vanes so tightly constructed, that the air imprisoned within cannot go backwards, and is forced in front to the tuyeres.

Among the first blowers built on this principle, are those manufactured by Mr. Root. More recently, the Baker blower has been introduced into many foundries, and gives satisfaction. The Baker blower, being entirely of metal, it has been possible to make the lines of junction of the vanes with great accuracy, and thus to insure against leakage of the air or loss of pressure. The vanes of the Root blower are of wood, and wear out, or warp to a small extent; but Mr. Root remedies this by covering them with a kind of stiff ointment which it is easy to put on when needed. We have seen a ten horse power Baker blower working at a regular pressure of one to one and one-quarter pounds per square inch, which could be increased to three pounds by contracting the outlet. A column of one inch of mercury corresponds very nearly to half a pound of pressure per square inch.

FONDERIE A CALEBASSE

Is the Belgian name of small cast iron foundries producing principally small articles of hardware, ornaments, and such objects as those in which the strength of the metal is of secondary importance. They may manufacture a good metal by employing a good metal, but they generally use all kinds of scraps. This is one of the advantages of the calebasse process; moreover, the cheapness of the apparatus brings it within the reach of those with little means. There is no necessity to wait until enough moulds are ready for filling with the metal of a large cupola; consequently, there is an economy of foundry floor, of flasks, and of other foundry appliances. On the other hand, the consumption of fuel is comparatively greater than in a cupola; but the fuel may be of inferior quality, such as light coke, and even bituminous coal. The metal obtained is very hot and fluid, and it is possible to make the mixtures just such as are desired.

The furnace is like a foundry ladle, with trunions to move and turn it about; the shape is a truncated cone, the larger diameter of which is on top. Over this ladle or crucible is a movable cylinder of strong sheet iron, and at the place of junction there are two corresponding half circles which form the hole through which the tuyere passes. The whole is placed against a wall and under a metallic hood.

The blowing apparatus is a fan, making from eight hundred to one thousand revolutions per minute, and connected with the tuyere by a leather sleeve, which allows of the ready removal of the tuyere, or of its inclination to various angles.

Both the crucible and the cylinder above are loam-lined like foundry ladles. The crucible rests upon rammed sand, and when the cylinder has been clay-luted on, it is surrounded by a bank of dry sand.

The start is with fuel alone and a light blast, and the charging begins when the ignition is thorough. As the operation proceeds, the blast, which was at first horizontal, is made to be more dipping. When the melting is finished, the sand is removed, and then the top cylinder; and the crucible is ready to pour its contents into the moulds, or into smaller ladles.

In about one and a half hours, from five to six hundred pounds of metal may be melted, and it is possible to make four such operations in a day.

SCAFFOLDING.

When scaffolding occurs in cupolas, it has been found advantageous to blow finely pulverized fuel with the blast through the tuyeres. The intense heat thus produced near the tuyeres is sufficient to melt the obstruction.

ORDNANCE.

In the preceding pages of this work, no mention is made of the casting of ordnance and projectiles. This omission is due perhaps to the objection Mr. Overman had to raising statues to military heroes, which objection extends, of course, to the implements of war. Perhaps, also, the author thought that it was unnecessary to repeat on this subject the already explained methods of loam, green and dry sand mouldings, which apply equally well to the manufacture of ordnance and projectiles.

BRONZE FOR ORDNANCE

Bronze ordnance is most generally a binary alloy of copper, 100 parts to 10 to 13 of tin. It is a question whether a slight percentage of zinc or lead, or both, would not improve the homogeneousness of the alloy, by preventing the liquation (separation) of the tin, especially when the metal has been poured very hot.

MOULDING.

It is customary to mould from a metallic pattern; but when there is no pattern at hand, one can be made by the process explained in pipe loam moulding. A conical iron mandrel is made to revolve on standards, and is covered with plaited straw bands and then with loam mixture or plaster of Paris swept over with a moulding board. When the last coat is dry, it is smeared with tallow or with ashes in water for a parting. The patterns of trunions and dolphins have been prepared separately, and are now fastened on. These pieces had better be of plaster instead of wax, since the latter may produce blow holes in the casting. The mould or cope is made of several layers of loam, each one being allowed to dry before a new one is put on. Loam moulds, more than those of green and dry sand, are open to the objection of being permeated by the fusible bronze, and that to the extent of requiring a dead head equal to one-third instead of one-fourth of the weight of the ordnance casting. This is remedied to a certain extent by making the first coat of loam about three-eighths of an inch thick, and following it with another coat composed of two-fifths white sand and three-fifths of

plaster of Paris, and about one-eighth of an inch in thickness.

The mould is strengthened on the outside by longitudinal iron bars, kept in place by hoops and binding wires. The drying is effected at such a temperature that the plaster of the core falls into powder when the filling is removed. It is customary to mould the breech part of the ordnance separately.

The casting is made with the mould upright in a pit, with its bottom resting in a metallic basket. The pit is filled with dry sand, which must be equally rammed, otherwise the mould may break.

MELTING AND POURING THE BRONZE.

The metal may be poured from the top, or from two-thirds of the height of the dead head, when the whole piece is cast solid; but the method by syphon is better. It is preferable to melt the bronze in reverberatory furnaces instead of in a cupola, since with the latter the copper has a tendency to become carburized, and the last runnings are so rich in tin that the alloy is white. The metal should be run hot, but not too much so, otherwise the tin will separate and the metal will not be homogeneous. When liquation takes place, an excess of tin will likely fix itself to the junction of the trunions, thus weakening them by the formation of an alloy very hard and brittle, or by a honey-combing filled with nearly pure tin.

The loam of the mould adheres strongly to the casting, and contains from two to three per cent. of metal.

SHRINKAGE.

The shrinkage of ordnance bronze is about $\frac{1}{75}$, which corresponds to about $\frac{3}{16}$ of one inch per foot.

236 Moulder's and Founder's Pocket Guide.

GEN. UCHATIUS'S EXPERIMENTS UPON INCREASING THE HARDNESS AND ELASTICITY OF BRONZE.

Some experiments made by Gen. Uchatius, director of the Arsenal at Vienna, seem to show that the hardness and elasticity of bronze may be considerably improved by compression. The metal which gave the best results is composed of copper 92 and tin 8. The bore is enlarged about two per cent. of its diameter by conical plugs forced in by hydraulic pressure. The metal thus treated is said to possess the resistance and wearing qualities of steel.

MOULDS FOR BRONZE AND CAST IRON AND STEEL ORDNANCE.

Green sand moulds have been used for cast iron ordnance; but the sand, not being rammed hard enough, does not stand the pressure of the fluid metal as well as dry sand, which may be rammed harder.

Dry sand moulding, at the present time, seems to be the method preferred for the manufacture of ordnance, either bronze, cast iron, or steel. For the facility of handling, the mould is made in parts, and the flasks are carefully planed and made to correspond to each other when they are joined one over the other in the casting pit. Sand shrinks during the drying process about $\frac{1}{20}$, and this is to be provided for, otherwise there will be an empty place at the junction of the flasks. The drying room is brought to a temperature of not over 450° F.

PIG METAL USED FOR ORDNANCE.

The pig metal used for ordnance must be tough,

close grained, gray, and free from foreign substances. In Sweden, however, a metal with a small percentage of sulphur is preferred. If the pig is melted in a reverberatory furnace, it is recommended to use cast iron bars for stirring the metal, which might become white by dissolving wrought iron tools.

MOULDING SAND.

The moulding sand should not contain too much coal, otherwise the gases would escape with difficulty. A good composition is—

New sand.....	91
Old burnt sand.....	8
Coal dust.....	1
	<hr/>
	100

In order to prevent the sullage from lodging at the trunions, these are sometimes separated from the body by a thin piece of cast iron perforated with holes. This will be melted by the fluid metal, but only when the sullage has risen above the protecting plate. The dead head is about one-quarter of the weight of the piece of ordnance.

CAST STEEL GUNS.

Cast steel guns, and some of them of enormous size, are now manufactured in large quantities. We do not know whether they require any special mode of moulding, but the experiments with puddled steel have not been entirely satisfactory. The best metal is cast steel melted in pots.

ORDNANCE CAST SOLID AND WITH CORES.

In the methods which we have just examined, the pieces of ordnance were cast solid, that is to say,

without prepared cores. There is more metal to remove afterwards, but the bore will be true instead of eccentric, as would be the case if the tool were deviated from its direction by a previous irregular hole. However, if the hole left by a core is much smaller than the required caliber, a properly built boring bit will not deviate from the axis, especially if the gun is also made to rotate in a direction inversely to that of the tool. Of course, the core must not be outside of the diameter of the caliber.

The principal advantage of cores left in casting is that the metal will be cooled from the outside and the inside at the same time, and that its crystallization will be more equal in the mass, thus insuring greater homogeneity. In the Rodman system of casting ordnance, chilling cores are employed, in which water is made to circulate. This is a dangerous process if a leak should occur, and compressed air may be substituted for water as a cooling agent.

When a core is used, it is firmly suspended from a platform above the pit, and the metal is poured from below, by means of a syphon.

Mortars are generally cast with a core.

CASTING CANNON BALLS

Solid cannon balls were formerly cast in chilled moulds, but the metal was found to be too hard, and its surface too coarse. They are now moulded in green sand with bronze or cast iron patterns, the latter metal being said to retain its shape better than bronze. The horizontal or equatorial diameter (in the flask) of the pattern is slightly greater than the

vertical or polar one. The casting is by two runners, the sprues of which reach the mould at the extremities of the greatest horizontal diameter of the pattern, that is to say, at the junction of the two flasks, since each flask contains one-half of the mould. As soon as the runners are solidified, the flasks are turned upside down, in order to retain the spherical shape of the bullet, and to bring to the centre the hollow resulting from the contraction of the metal. Should the bullets be found too large, the sand is rammed tighter; and conversely, the ramming is less, if the bullet is too small.

After cleaning the bullets of adhering sand, fins, etc., they are brought to a red heat, and then compressed in every direction under a trip hammer, the striking part of which is a hollow segment of a sphere, corresponding to the caliber of the ball. The anvil has also a similar hollow. While the hammering goes on, a small stream of water is allowed to fall upon the hot ball. This operation compresses the metal, polishes it, and, at the same time, is severe enough to cause the fracture of the imperfect castings.

HOLLOW PROJECTILES.

The manufacture of hollow projectiles requires a similar mode of pouring the metal, and of turning over the flasks after the solidification of the runners. Formerly the cores were of straw and loam; now they are of sand, compressed in core boxes made in four compartments in order to produce an equal pressure over the material. Passages for the air and gases, and irons for fastening the core under the drag, are provided. These cores are stove-dried.

In the mould, the neck and lugs of the hollow projectile are below, that is, in the drag flask.

HOLLOWNESS IN "SOLID SHOT" CAUSED BY COOLING.

We see that the so-called solid shot is, after all, hollow in the centre. The solidification of the metal begins on the outside next to the sand, and continues to the centre. By the contraction which takes place, the metal is condensed against the sides, and a hollow results somewhere inside. If, in the casting of the shot, the flasks were not turned upside down, the fluid metal, following the law of gravity, would remain in the lower part of the mould, and, by its contraction in cooling, would suck down the upper portion of the shot, which is thinner, and, therefore, less resisting. In this case, the hollow would not be in the centre of the sphere, but above, and the top of the shot would be somewhat flattened. It is to provide against these defects, that what still remains of fluid metal inside of the shot is equalized in the mass by the overturning of the mould.

In the casting of a piece of ordnance without core, a similar effect takes place. The solidification begins on the outside and proceeds to the centre, which would be hollow if the excess of fluid metal in the dead head were not there to feed or fill up the contracted parts.

CRYSTALLIZATION OF METALS IN COOLING.

We must also consider the important fact that, in cooling, the metals crystallize, and that the long axes of the crystals arrange themselves perpendicularly to the cooling surface. Thus we see that in spheres and cylinders, these crystal axes are in the direction

of the radius. Their power of resistance, that is, the resistance of the metal itself, is due to their close agglomeration. Let us now suppose that the surfaces meet at right angles: the axes of the crystals will be perpendicular to each surface, but at the angle they will deviate from each other, and their resistance to strains will be considerably less, and the angle will be a place of fracture. The thicker the casting, the more are these points to be considered; because by the slow cooling of a large mass of fluid metal, the crystals are larger and more perfect. In a thinner casting, rapidly cooled, the crystallization is more confused.

We may produce an irregular or confused crystallization by pouring in a metal already half congealed; but although very tough, the casting will be so imperfect, so full of cold drops, etc., that it is, after all, preferable to use hot metal.

PATTERNS SHOULD HAVE NO SHARP ANGLES, ETC.

We infer from the above consideration the necessity of preparing patterns in which there are no sharp angles, and in which the change from one thickness to another is gradual. For instance, the connection of the trunions to the piece of ordnance should be made by easy curves, and if more metal is put on than it is desired for the finish, this excess of metal may be removed afterwards with the tools.

In the method of casting ordnance solid, the metal in the centre of the piece, being cooled last, has more time for its crystallization. The result is that the cannon is tougher on the outside than on the inside, which is just the contrary of what is necessary to

resist the wear and tear of the powder and of the projectile. It is, we believe, to obviate this grave defect, that the Rodman cooling core has been adopted.

These observations apply not only to the manufacture of ordnance, but also to the casting of large pieces, such as pumps, hydraulic presses, etc.

CHILLED CASTINGS.

We know of no rule by which it is possible to determine *a priori* whether a certain pig iron is suitable for the manufacture of chilled castings; experience alone will settle the question for a particular brand or for a mixture of metal. Moreover, the experiments should be made frequently, since a difference in the mode of working the blast furnace may change the nature of a metal hitherto satisfactory.

In former times, when charcoal pig was more plentiful than at present, chilled castings were often obtained from pigs resulting themselves from a previous fusion of two parts of gray and one part of white or mottled iron. A certain proportion of spiegeleisen is said to be beneficial.

A. WHITNEY & SONS' CHILLED CAR WHEELS.

The car wheel works of Messrs. A. Whitney & Sons, of Philadelphia, show to what degree of perfection in disposition of workshops, in labor-saving implements, and in care of maintaining a constant quality of products, long experience and capital may arrive, especially when they are brought to bear upon a single article of manufacture, for instance, to chilled car wheels as in this case.

The foundry is provided with two railroad tracks,

each one of which serves two rows of moulds, and a space is left free in the middle of the building for the passage of the pouring ladles, also mounted on wheels. The lifting of moulds, ladles, etc., is effected by several revolving cranes set upon trucks, which have the necessary gear for running along the railroad tracks. In the centre of the casting house, and on one side, is a row of five cupolas, three large ones for the regular work, and two small ones for experimental purposes. The blast is given by two cylinders, and, in order to secure a thorough mixture of the various kinds of pig iron employed, the metal from the cupolas is run into a large pocket or ladle which holds fifteen tons of molten iron, and which is tilted by a hydraulic apparatus when the smaller movable ladles are filled. Not only should the mixture be homogeneous, but its temperature should not be too high, otherwise the casting will be chilled too deeply, or the chill mould will be melted. When the metal is too hot, it is tempered with a sprinkling of water. All the various kinds of pig iron are frequently tried separately, and several samples are also taken of every day's fabrication. A small proportion of Bessemer steel scraps has been found to toughen the cast wheels. The foundry scraps are run into ingots before being remelted for wheel castings.

For moulding, New Jersey, including Lumberton, sands are employed. The facing sand is of medium size, rather dry, open, and of medium coarseness, with some bituminous coal dust in it. The drag is rammed on the periphery, and compressed with the feet on the centre. The cope is rammed harder, and

the hub core is painted black. The thickness of the chill is about that of the wheel rim, and if its surface presents any sand holes, these are lightly brushed with oil, in order to prevent dampness from lodging in them. The casting gate is prepared in a separate ring box, with one to three pouring holes in the hub of the wheel.

When casting time arrives, the movable ladle receives its supply of metal from the central pocket, and is rolled to the swinging crane, which lifts it up and brings it over the pouring hole. The ladle is then tilted by means of a movable cross-bar fitting the trunion. The metal in the mould is pumped with an iron rod, and, as soon as the runner has set, the clamps are removed, the head of metal and the runners are knocked off, and the mould is opened. The red hot wheel, with the hub core withdrawn, is immediately carried to the annealing furnace.

This annealing operation is very important, since it prevents to a great extent the breakage which so often occurs in wheels cast in one piece, especially those with spokes. The slow cooling also equalizes the tension of the molecules of metal, and renders the wheels more able to stand the shocks of railroad travel. The annealing rooms contain rows of vertical cylinders made of sheet iron, with an inside lining of brick four inches thick. The diameter of these cylinders varies, of course, with that of the wheels. For each two rows of cylinders there is a furnace grate, which allows of the contents being brought up to a bright red heat at first, and then cooled down by degrees, until, after three days, the wheels are cold enough to be removed.

A very ingenious hydraulic apparatus takes hold of the red-hot wheels and lowers them in a horizontal position into the annealing cylinders. The wheels are separated one from the other by means of cast iron tripods or rings.

After annealing, the wheels are tried under the hammer, and those which are sound have their hubs bored in a lathe. The imperfect ones are broken and melted again.

It is generally acknowledged that chill moulds heated to about 170° F., will produce a deeper chill in the casting than perfectly cold moulds. In fact, the chill mould should be hot enough to prevent the dampness of the moulding sand from condensing on it.

It is said that the celebrated cast iron wheels manufactured by the Ganz foundry, of Buda-Pesth, Hungary, are hardened on the surface of the rim by a very hard alloy of iron and antimony. The latter metal, very finely pulverized, is mixed with charcoal dust, and then spread upon the sand of the moulds.

STEREOTYPES.

Although described already in former pages, we shall again examine the stereotype process as practiced by Messrs. Ferguson Brothers, of Philadelphia, on account of some changes in the mode of operation.

The clean type form is covered all over with a mere film of olive or sperm oil, applied with a brush. Another frame for the plaster is placed over it, and has four set screws to remove the cast slowly, and to regulate its thickness. The first coat of plaster of

Paris is of a fine and pure material, but the backing contains sifted coal ashes. Common salt is added to hasten the setting. The proportions of these foreign substances vary with the quality of the plaster employed.

The cast is removed when still tepid, and is heated directly upon the molten type metal. This sudden drying is said to give better impressions than if the plaster had been allowed to dry more slowly in the air or in stoves. Let us see the reason why this is so. Plaster, in setting, expands; if all the particles of plaster were of the same size, had been equally calcined, and had absorbed an equal amount of water, the expansion would be the same all over, and at the same time. Now, in practice, it is not so; the particles of plaster are irregular in size, their degree of calcination is different, and their action is more or less rapid in absorbing water. It results from these considerations that the portions of plaster which have absorbed their quota of water, and have set, are pushed from their position by the expansion of the plaster behind, which had not completed its hydration at the same time. Therefore, the print, which is correct and sharp immediately after removing the cast, will become blurred if the hydration is allowed to go on slowly afterwards. A sudden heating and drying will reduce to a minimum this motion of the plaster. On the other hand, there would be danger of breaking the cast if its material were not rendered very porous by the addition of ashes.

For obtaining the metallic impression, the plaster cast is put, print downwards, into a flat cast iron boat, swinging from a crane over the metallic bath,

the temperature of which is such as to slightly brown proof paper. The angles of the boat are square, and its sides are slanting. The distance from the plaster cast to the bottom of the boat, that is, the thickness of the stereotype, is regulated by metallic rules, and the plaster cast is prevented from rising by cross-bars and pressure screws. The metal is introduced slowly into the heated boat, until boat, plaster cast, and metal have acquired the same temperature, when the excess of metal is removed. The boat is then allowed to cool by placing its bottom over water or damp sand, and, as the metal contracts, enough fluid metal is added to keep the casting fast against the plaster; the plaster cast is then broken, and the stereotype is ready to be trimmed. The composition of the metal is about fifteen parts of antimony to one hundred of lead.

ELECTROTYPES.

The superior wearing qualities of copper electrotypes, and their greatly reduced cost, have considerably increased their uses of late years. A brass form is filled with compressed beeswax, and the type, engraving, or other pattern which delivers, is pressed into it. Plumbago is now laid upon the print with soft brushes of long goat hair. This substance alone is sufficient to conduct the electricity; but the deposit is slow at the beginning, and until the whole surface is covered with copper. The deposit of metal is not regular, being thicker on the sides than on the middle. By a recent process, the whole plumbago surface is covered with a film of copper, which is a much better conductor than plumbago alone, and the

further electro-deposit of copper in the bath is more rapid and regular. This starting coat of copper is obtained as follows: The surface of wax, which has been carefully covered with plumbago, is washed by pouring on a mixture of water and alcohol, then laid flat on a sink and covered with a solution of sulphate of copper. Fine iron filings are sifted over it, and are lightly moved about with a kind of swab. As soon as copper has been deposited, the iron filings are washed over, and the operation is repeated two or three times. The plate is then ready to go into the bath, where the copper deposit will acquire the proper thickness.

The finished copper shell is strengthened by soldering it to a backing of an alloy composed of only five parts of antimony to one hundred of lead. In order to obtain a good adherence, the copper shell is carefully cleaned in hot caustic lye, and its back is brushed with a solution of zinc in hydrochloric acid, before covering it with tin foil. By heating, the tin covers the copper and acts like an intermediary solder between the electrotypes and its backing. The latter is put on in a cast iron boat, in a manner similar to that explained for the preparation of stereotypes.

FLEXIBLE MOULDS.

The rotary printing presses require stereotypes curved to fit the moving drums. To produce these the flat form filled with the ordinary types is oiled, and covered with one or two thicknesses of fine tissue or bank note paper, which is pressed down upon the letters by beating it with stiff brushes.

The paper has been previously dampened by water, either outside of the form or upon it, by a covering of wet cloth. The thin paper is backed by several other layers of porous and coarser paper, also beaten in with the brush, and the last covering is of stiff paper. Sometimes a stiffening of whiting and starch in water is laid between the last two papers.

The paper mould is then allowed to dry at a moderate heat, under a slight pressure; but, if it be necessary to work rapidly, the mould is prepared upon a hot form, and its drying is completed upon a steam table and under screw pressure. In this case, cloths are interposed between the paper mould and the press. When dry, the paper moulds are thoroughly brushed over with plumbago, or talc, or finely powdered borax. Then they are fitted in an iron casting box, and the type metal is poured in. The cooling of the metal is hastened by throwing water upon the box. With proper care, the same paper mould may be used for several casts.

LOTTINOPLASTIQUE.

Lottinoplastique is the method employed by its author, Mr. Lottin de Laval, who, from 1835 to about 1846, took paper moulds of inscriptions, basso-relievos, etc., of antique monuments, in his travels in Italy, Sicily, Kurdistan, Persia, Arabia, and Egypt. His results are certainly remarkable in the fact that he was able to pack more than ten thousand square feet of paper moulds in a box about five feet long, three feet wide, and two feet high. We may surmise what would have been the volume and cost of trans-

portation of such moulds if they had been made of plaster of Paris. We will now examine Mr. Lottin's method as he describes it.

If the object to be moulded is of wood, it should receive first a light coat of linseed oil or other oil at hand, in order to prevent the gluing of the paper to the pattern, should glue or any other adhesive substance be on the wood. If the pattern be of stone, powerfully heated by the sun, it should be thoroughly wet with a sponge, in order to obtain the immediate adherence of the paper.

Two kinds of paper are employed. For the first layers upon the pattern, Mr. Lottin prefers a yellowish-gray paper with very little size in it. The second kind is coarser, and without size, for repairing the fractures. The latter paper may be cheap, but it must be composed of a felted, pliable fibre, which will bend and break under the brush.

Let us suppose that we have to mould a basso-relievo. Apply the paper, thoroughly wetted in a basin of water, upon the pattern, beginning at the highest parts, and gently press it down with the brush. The next sheet will partly overlap the former, and will be treated in the same manner. When the pattern is entirely covered, renew the operation with a second layer of paper, and, if required, with a third. Then beat down the paper again with the brush, and cover the breaks with new pieces of paper folded in two or three, and cement the whole with the second quality of paper, thoroughly damp, and which, being porous and without size, is transformed into paste under the action of the brush. The deeply cut portions of the pattern are plentifully supplied

with this paste, which may be compressed by the fingers, or spatulas, where the brush does not reach.

When the paper covering is complete, wet it with a sponge, taking care that no water penetrates between the paper and the pattern. Then, with a flat brush, lay on a coat of flour paste, thoroughly boiled in water, holding a certain quantity of sulphate of alumina.

The mould will be rendered considerably stiffer if the facilities at hand allow of the addition to the above paste of some finely powdered whiting. Lastly, put on a finishing layer of paper, and press it down thoroughly with the brush, and lay over it a coat of thin glue. The mould is finished, and it is allowed to dry, upon the pattern preferably, otherwise in the shade. As they begin to dry, the moulds separate from the pattern, and the wind may carry them away. This is prevented by applying a coat of very diluted flour paste on the periphery of the pattern. Glue may be prepared by boiling the feet of sheep, goats, etc.

When the moulds are perfectly dry and separated from the pattern, they are made waterproof, preferably with boiled linseed oil, or with raw linseed oil in which yellow wax has been melted. If these substances cannot be had, then the operator will use the oil of the country, or butter, or the fat of animals, laid on hot, and further dried before the fire or under the sun.

The moulds presenting too great a surface for packing, are cut at appropriate places, after leaving check marks.

Before using these moulds for obtaining plaster

casts, it is strongly recommended to render them still more impervious, by heating them thoroughly before a clear fire, or in an oven, and laying on the inside and outside a coat of the following hot mixture, and drying again.

Drying (boiled) linseed oil.....	50	} parts by weight.
Yellow wax.....	5	
Essence of turpentine.....	5	

The older these moulds are, the better they will stand the wear of casting plaster in them.

It may happen that the adherence of the paper sheets is not complete at some places. The repair is made only at the time of taking the cast, in the following manner: Give a light coat of raw linseed oil, with $\frac{1}{4}$ of boiled oil, to the inside of the mould, and then lift the loose portions and smear them with flour paste. Press down with the fingers, and make the plaster cast immediately.

If, from irregular drying, the mould presents any folds, it is slightly dampened with a sponge. A few minutes after, the mixture of raw with one-sixth of boiled linseed oil is laid on, the plaster cast is taken, and, after drying, the folds will have entirely disappeared.

Such light moulds will not stand the weight of a large mass of plaster, without having their backs supported by sand, ashes, or plaster itself; but this is easily managed. Other substances may be employed for the casts, such as Roman cement, gilder's paste, etc., etc.

GUTTA-PERCHA MOULDS FOR ELECTRO-PLATERS.

Gutta-percha is another substance often employed by electro platers for obtaining moulds of patterns somewhat undercut, especially if the gutta-percha is removed still warm and yielding. If allowed to become entirely cold, the separation of the undercut parts will be difficult, some portion of the mould or of the pattern will have to give way. Another property of gutta-percha is to shrink considerably when allowed to become cold naturally ; but if the mould is rapidly chilled in cold water, it will harden without much contraction.

Gutta-percha is rarely employed pure. It is mixed with one-fifth, to at most, one-third of linseed oil, or tallow, or lard, in order to impart to it enough softness to be kneaded with the fingers while tepid. It is possible to employ pure gutta, when the pattern allows of a heavy pressure being put upon it, for instance, steel and copper-plate engravings. But, as a rule, the proportion of foreign substances should increase as the practicable pressure decreases. The mixture of gutta (cut into small pieces) with oil, tallow, etc., is effected in a metallic vessel over a moderate fire. When, after stirring, the mass emits bubbles of gas, it is poured into cold water, and immediately kneaded with the hands so as to secure homogeneity.

If the pattern is not very deeply cut, and if we have the possibility of applying a considerable pressure, the sheet of gutta-percha is softened a little before a fire, and then applied upon the pattern and pressed. While still tepid, the mould is afterwards

removed and plunged into cold water, in order to set it and prevent further contraction.

We may soften gutta-percha in warm water, but there is danger of some of the water remaining between the pattern and the mould. On that account it is preferable to soften the material before a fire, or in a stove arranged for the purpose.

In the case of a more deeply-cut pattern requiring or able to bear a gentle pressure only, we soften by heat the gutta-percha to the degree at which it may be pressed within the recesses of the pattern by the fingers, which are kept oiled. After removing the still tepid gutta mould, dip it into cold water. There will be less danger of distortion by contraction if all the parts of the gutta-percha mould are of about the same thickness.

Another method is without pressure, but by fusion of the material. The pattern is laid in a tray, for instance, and a ball of gutta-percha is put in the middle and on the top. The whole being put in a stove heated to the proper point, the gutta melts by degrees and finally covers the whole pattern. The ball shape given to the material is for the purpose of pushing away the air as the melting goes on.

GELATIN FOR MOULDS.

Another material which allows of the direct moulding of quite deeply undercut patterns is gelatin, pure, or mixed with boiled linseed oil, as in printing rollers. For a single plaster cast, gelatin jelly alone is sufficient; but if several casts are necessary, an addition of linseed oil will enable the mould to stand the action of dampness better.

Good glue is covered with water, and is allowed to swell for twenty-four hours. Then it is heated upon a steam or water bath, and, if necessary, water and linseed oil are added. The proportions of these substances must be such that the glue becomes a stiff jelly as soon as cold. The patterns are slightly oiled before they are covered with the liquid glue. As soon as set, the gelatin mould is removed, and is ready for producing a new plaster cast. If the size and weight of the cast are considerable, it becomes necessary to stiffen the back of the gelatin mould by plaster of Paris, or otherwise. Should it happen that there is some difficulty in separating the mould from the cast, both may be left for some-time in a damp place, which will soften the gelatin. Dipping in water may be resorted to, if the mould has done its work and is not to be used again.

The metal moulder may ask of what use to him are such jelly-like moulds. We would answer, that he may be required to produce a curved basso-relievo or an ornament, the patterns of which are flat. We will take a gelatin mould of the flat pattern, then curve the mould to the desired degree, and from it obtain a curved plaster cast which will be his pattern for sand moulding.

He may also desire to reproduce a pattern of a reduced size. The gelatin, in drying, contracts in every direction without cracking. Therefore, the glue mould, when dry, will be smaller than the former pattern, and will give a cast reduced in size.

There are other ways of increasing the preserving qualities of glue jelly without the addition of linseed oil. (1) Dissolve two hundred parts of dry glue in

the proper proportion of water, and before pouring on the pattern, add and mix thoroughly four parts of tannic acid and four parts of powdered rock candy (2) A mould having been made with gelatin alone, a solution of water holding 10 per cent. of bichromate of potassa is poured upon it, and after draining, the mould is exposed to the action of the sun.

CONTRACTION OR SHRINKAGE OF METALS AND ALLOYS.

All metals and nearly all alloys contract in cooling, and this contraction or shrinkage varies with the temperature of the molten metal, the shape of the mould, etc. Cast iron, for instance, expands at the moment it congeals, and then shrinks in passing from the red to the black heat. The most carburized or gray pig iron shrinks the least, (less than one per cent); the most white metal contracts the most, (about two per cent). Taking the range of gray irons used in foundries for moulding, the average shrinkage is about one per cent. Large heavy pieces will contract $\frac{1}{120}$, that is $\frac{1}{10}$ of an inch per foot; the calculation for small articles is $\frac{1}{80}$ or $\frac{1}{8}$ of an inch per foot. For brass work, shrinkage varies between $\frac{3}{16}$ and $\frac{1}{4}$ inch per foot.

Patterns are therefore made larger than the article to be cast; but, for those smaller than four inches, it is not necessary to provide for the shrinkage, since the rapping to which the patterns are subjected, enlarges the mould slightly. In small castings, which must be very accurate as to size, it is even necessary to provide for the expansion of the mould by the rapping.

Shrinkage not only diminishes the size of the pattern, but may also modify its shape. A flat plate, moulded in sand equally rammed all over, and as thick in the cope as in the drag, will cool and shrink equally, and therefore will not be distorted. On the other hand, let us suppose that the thickness of sand in the cope is less than in the drag, the result will be that the upper side of the plate will cool off more rapidly than the under side. The metal of the lower part will shrink last, and bracing itself against the already set part, will, by its contraction, cause the upper surface to become convex.

Let us now pass to a plate with ribs underneath, which are thicker than the plate itself. The ribs, holding more metal, will cool last, and by their shrinkage will pull down towards them the top plate, the upper surface of which will become convex. The same result will occur, but to a less extent, when the ribs are of the same thickness as the plate. There is more thickness and more metal, where ribs and plate meet, therefore the shrinkage will take place last at that place, and there will be another pulling down of the periphery of the plate. On the other hand, should the ribs be thinner than the plate, the former will set first, and the plate by shrinking last will pull them upwards, thus producing a cavity on top of the plate. It is to obviate these defects due to shrinkage that some portions of castings are uncovered immediately after the metal is congealed, in order to cool the thicker parts as rapidly as the thinner ones.

A straight bar, wedge shape, if allowed to cool naturally in sand, will always become curved. The

thin edge sets first, and the thick one by shrinking last will bend the former convex shape, while the thick edge will be concave. The remedy, therefore, is to uncover the thick edge.

A gutter, or two plates meeting at an angle, will always become curved in their length if the greater amount of metal at the angle is not cooled more rapidly by removing the sand.

This method of uncovering is not always possible or entirely effective. In such case, the pattern is modified so as to correct the inevitable effects of shrinkage, either in size or in shape.

TABLE OF THE SHRINKAGES OF CASTINGS.

The following table gives the shrinkages of various kinds of castings:

In locomotive cylinders.....	$\frac{1}{16}$	inch in a foot
In pipes.....	$\frac{1}{8}$	" " "
Girders, beams, etc.....	$\frac{1}{16}$	inch in 15 inches
Engine beams, connecting-rods..	$\frac{1}{8}$	" " 16 "
In large cylinders, say 70 inches diameter, 10 feet stroke, the contraction of diameter is about	$\frac{3}{32}$	" at top.
contraction of diameter is about	$\frac{1}{16}$	" at bottom.
Shrinkage of length is.....	$\frac{1}{8}$	" in 16 inches.
In thin brass.....	$\frac{1}{8}$	" in 9 inches
" thick brass.....	$\frac{1}{8}$	" in 10 "
" zinc.....	$\frac{3}{16}$	" in 12 "
" lead (according to purity)	$\frac{3}{16}$ to $\frac{5}{16}$	" in 12 "
" copper " " "	$\frac{3}{16}$ to $\frac{7}{32}$	" in 12 "
" tin " " "	$\frac{1}{10}$ to $\frac{9}{32}$	" in 12 "
" silver.....	about $\frac{1}{8}$	" in 12 "

The above values vary slightly with the shape of the pattern, the amount of ramming, the fluidity and heat of the metal at pouring time, and also with the

nature of the mould, whether of dry or green sand, or loam. The practice of a foundry varies somewhat from that of another establishment. The only agreement is in the averages.

WEIGHTS OF CASTINGS FROM PATTERNS.

If it be desired to make an approximate guess of the weight of a casting from the pattern at hand, the latter may be weighed, and the corresponding weight of the casting will be found in the following tables. It is evident that account should be taken of the core prints, and battens, and other extraneous parts on the pattern, and that their weights should be deducted.

The first table is from Rose's "Pattern Maker's Assistant," and probably agrees with American practice and woods used for patterns. The second table is of European origin, and discrepancies may be accounted for by the difference of densities of the materials. European woods are generally more dense than the corresponding ones of America.

A PATTERN WEIGHING ONE POUND, MADE OF	WILL WEIGH WHEN CAST IN				
	Cast-iron...	Zinc.....	Copper.....	Yellow Brass...	Gun metal.
	lbs.	lbs.	lbs.	lbs.	lbs.
Mahogany —Nassau.....	10.7	10.4	12.8	12.2	2.5
“ Honduras	12.9	12.7	15.3	14.6	15.
“ Spanish.....	8.5	8.2	10.1	9.7	9.9
Pine —red.....	12.5	12.1	14.9	14.2	14.6
“ white	16.7	16.1	19.8	19.	19.5
“ yellow.....	14.1	13.6	16.7	16.	16.5

A PATTERN WEIGH- ING ONE POUND, MADE OF	WILL WEIGH WHEN CAST IN					
	Cast-iron	Brass...	Copper...	Bronze...	Bell or gun metal	Zinc.....
Pine or fir.....	14.	15.8	16.7	16.3	17.1	13.5
Oak.....	9.	10.1	10.4	10.3	10.9	8.6
Beech.....	9.7	10.9	11.4	11.3	11.9	9.1
Linden	13.4	15.1	15.7	15.5	16.3	12.9
Pear.	10.2	11.5	11.9	11.8	12.4	9.8
Birch.....	10.6	11.9	12.3	12.2	12.9	10.2
Alder.....	12.8	14.3	14.9	14.7	15.5	12.2
Mahogany	11.7	13.2	13.7	13.5	14.2	11.2
Brass	0.84	0.95	0.99	0.98	1.	0.81
Tin with $\frac{1}{4}$ to $\frac{1}{3}$ or lead.....	0.89	1.	1.03	1.03	1.12	0.85
Lead.....	0.64	0.72	0.74	0.74	0.78	0.61

MISCELLANEOUS PROCESSES AND RECEIPTS.

When it is desired to give a smooth surface to large castings in green sand, the dusting with charcoal dust is dispensed with. Instead of that the print is painted over by means of a brush with a mixture in water of $\frac{1}{4}$ plastic clay and $\frac{3}{4}$ charcoal dust. A further polish may be given with an iron tool.

A firm and fusible wax for ornaments and inscriptions put on loam moulds of bells, for instance, is prepared as follows: Melt at a gentle heat a mixture of 80 parts wax, 13 white pitch, 4 fat and 3 poppy oil. After a thorough stirring, filter through wool flannel.

The excess of carbon in too highly graphitic pig metal may be burned off by the oxygen of pure and rich iron ore, projected in fine powder through the tuyere of the cupola, one or two hours before tapping the metal.

Pig metal holding about 2% of copper gives sharp castings which are dense and soft, if there has been no chilling. The outside coat is frequently of nearly pure copper.

Sharp castings are also obtained from cast iron holding too much phosphorus to be good for puddling or for castings requiring strength. Such metal is very good for ornaments having no strains to bear.

When the gases arising from a charcoal dust parting are to be avoided, we may use sifted ashes instead. Sometimes soap and ashes are employed, but soap will produce gaseous products.

If very undercut plaster patterns are covered with very strongly rammed sand in metallic asks, they may be easily destroyed by calcining the whole to the point when the plaster will fall into powder.

A mastic for filling small holes in wooden patterns, is composed of 50 parts resin, 40 whiting, 7 tallow, and 3 yellow wax.

Another mixture for wax patterns, is composed of 2 parts of yellow wax and 1 of resin.

Thin castings are often chilled by the mould, entirely or in some parts only. In order to remove their brittleness, and allow them to be worked with the file and tools, they are annealed in furnaces. The oxidization of their surface is prevented by heating the castings enough to bear handling, and covering

their surfaces with coal tar, or with a mixture of lamp-black and linseed oil. They are then put in the furnace, which is gradually brought to a red heat, and slowly cooled. We have frequently annealed small castings in the coals of an ordinary kitchen fire, without previously painting them over. After half an hour of a red heat, followed by slow cooling, the oxidization was superficial only.

Of late years, emery wheels have come into considerable use for polishing and planing rough castings. The wheel is generally fixed in a horizontal or vertical position, and the work is brought up to it. In other cases, the casting is stationary, and the revolving wheel is raised, lowered, or inclined by hand in every position by means of an apparatus which is the counterpart of the rotary brush used in certain barber shops. Circular saws are also made to move on the same principle.

MALLEABLE IRON CASTINGS.

"Malleable iron" is the term employed to designate those castings, the brittleness of which has been partly or entirely removed by the operation of "annealing," which consists in burning off the whole or a part of the carbon combined with the metal from which the castings were made.

Cast iron, disregarding certain other substances combined with it, is essentially a compound of iron and carbon, in which the carbon is partly combined with the metal, and partly mixed with it; in the latter case, it is said to exist in the "graphitic state."

Combined carbon, on account of its atomic state of

division, is more easily removed from the metal, either by the action of oxidizing agents, such as metallic oxides, and the oxidizing flame of a puddling furnace, etc., or by readily combining with hydrogen and forming hydrocarbides, which we perceive when we dissolve cast iron in sulphuric or hydrochloric acid, for instance. On the other hand, graphitic carbon is very hard to burn, and requires the protracted action of oxidizing influences.

From the states in which carbon exists in cast iron, this metal has been classified into three principal subdivisions: *Gray metal*, in which the light color is, as it were, concealed by a multitude of graphitic laminæ; *White metal*, where the carbon is in the combined state and unseen; *Mottled cast iron*, in which most of the carbon is combined, whereas that in the graphitic state gives to the metal the spotted appearance of the trout. Gray metal is also called *Foundry pig*, and is generally preferred by the founders of ordinary castings, because it retains its carbon and fusibility longer than the other kinds. White metal is also called *Forge pig*, because it is preferred for puddling, since it loses its carbon more readily than the gray metal. The intermediate quality of mottled pig goes generally to the forge.

From what we have said about the two states in which carbon exists in cast iron, and the greater facility of its removal in one than in the other, we may rightly infer that white cast iron is to be preferred for malleable castings. Another reason for doing so, is the appearance of the castings. Indeed, let us suppose an article made of gray metal, rich in

graphitic carbon ; if, after a protracted heating in contact with oxidizing substances we have succeeded in burning off the graphite, the place it occupied in the metal will be empty, and the article will be porous, and will show it. On the contrary, the article cast from white metal, where the combined carbon is not visible, will appear with the same sharpness of shape and smoothness of surface after as before the annealing process.

Therefore, and provided the metal employed contains sufficient combined carbon to insure the fluidity necessary for sharp castings, white pig iron is to be preferred to gray metal for the manufacture of " malleable iron " castings, because the decarburization is more complete and rapid the appearance more pleasing, and the quality of the resulting metal better.

Carbon is removed from the cast iron by submitting it, at a certain temperature, to the action of substances holding oxygen, and the resulting combination will be carbonic oxide, very possibly mixed with a certain proportion of carbonic acid. Air will cause the carbon to burn, but its action is too energetic, and is not well under control. The substances preferred for the purpose are the magnetic scales of oxide of iron, produced by blacksmiths and at rolling mills, and iron ores or peroxides of iron, which fulfil the requirements of cheapness, with regularity and facility of working.

We must, however, remark that these oxides should be, as far as practicable, free from silica and earths which, at the temperature of the annealing furnace, will fuse and form a slag or cinder, preventing the oxidizing action, especially if the castings should

become coated with it. For this reason smithy scales are preferred, although they contain less oxygen than the ores; but the latter are with difficulty found entirely free from the above fluxing impurities.

There is, up to a certain point, an analogy in the mode of operation between cementing steel and annealing cast iron. In either case, the metals are submitted to a protracted heat in air-tight vessels, filled with the reacting substances, and the transformation takes place from the surface to the centre. But here the similarity ceases; in one case the carbon of the charcoal used penetrates the iron bar to form steel; in the other, the oxygen of the surrounding oxide penetrates the cast iron, combines with its carbon, and escapes in the gaseous form.

It is easily understood that the thinner the casting, the more rapid will be its transformation into malleable metal. Thicker castings, if the heat has not been sufficiently high or protracted, will exhibit in their fracture a kind of gamut of the graduation of the transformation. The external parts, which have been thoroughly decarburized, are gray, easily filed and drilled, and have lost their brittleness; and proceeding towards the centre (which we suppose not to be decarburized), we see the qualities of color, softness, etc., gradually diminishing, until we find the previous white metal.

For some reason, not well understood, it would appear that a temperature too high or prolonged, will harden surfaces already softened. Possibly, this may be due to a superficial skin of magnetic oxide, hard and brittle, or to a coating of fluxed impurities. At all events, castings not too thick, of a good metal, and

thoroughly decarburized, may be considered chemically as iron without fibre, and a fibre may be imparted to them by rolling or hammering. Indeed, we have seen such malleable castings bent double, while cold, without breaking, and without any previous condensation under the hammer. Their ring, or sound, very nearly approximates to that of wrought iron.

The manufacture of malleable iron castings is older than is generally thought, although the knowledge of the true principles on which it is based dates from the more recent period of the establishment of chemical science. In his work on the "Art of Converging Wrought Iron into Steel, and of Softening Cast-iron" (*l'art de convertir le fer forgé en acier, et l'art d'adoucir le fer fondu*), published in 1722, Réaumur gives the numerous experiments by which he succeeded in producing malleable iron castings, which had already been made some twenty years before, but in a secret manner.

At the epoch in which Réaumur lived, the true era of chemistry had not yet begun, the relations of carbon to iron in pig metal were not known, and the various degrees of hardness and appearance in cast-iron were attributed to the presence of various impurities, sulphur especially. After many experiments with all kinds of substances and salts—the results of which were noted with a remarkable acuteness of observation—Réaumur succeeded in his purpose with three different mixtures. Having observed that a plate of cast-iron, exposed for a long time to the direct action of a fire, was covered with a coat of black and red oxide, and that the metal underneath had become softened (malleable), he collected such oxide for the

purpose of packing with it small bars of white cast-iron, and after heating them in covered crucibles, he obtained a perfectly malleable iron (see page 472 of the above named work). His other mixtures were powdered limestone and charcoal, and charcoal with calcined bone-dust. The first mixture is evidently that used at the present time; the second may be explained by the oxidizing action, at a certain temperature of the carbonic acid disengaged, which parts with an atom of oxygen ($\text{CO}^2 + \text{C} = 2 \text{ CO}$) combining with the carbon of the cast-iron, and which becomes carbonic oxide. In the third case, we may surmise that the carbon was burned out by the air of the fire-place, penetrating through the interstices of the cast-iron plates forming the boxes in which the metal and the mixture were packed. The air was prevented from acting violently by the mass of bone-dust and powdered charcoal with which the articles were surrounded. We do not believe that the temperature was sufficiently high to decompose the bone-dust, even in presence of the charcoal. The furnace employed was of brick, and square, and divided by vertical partitions of cast-iron plates, between two of which were packed the castings and the mixture, and around which were flues for the circulation of the gases of the fireplace.

However imperfect these dispositions may be, when compared with the present ones, Réaumur ascertained that oxides of iron and cast-iron, heated together in closed vessels, produced malleable iron; that for malleable castings white is preferable to gray metal; that the castings previous to annealing, should be deprived of the adhering sand, which becoming fluxed, pre-

vented the reaction ; that too protracted and too intense a heat may harden the castings again ; and that properly annealed articles may be bent, forged, welded, case-hardened, and present all the properties and even appearance of wrought iron.

After having explained the principles upon which the industry of malleable iron-casting is founded, and given a historical notice of the first trials made, we cannot do better than to describe the actual processes, such as are applied at the Hardware and Malleable Iron Works of Messrs. Chas. W. Carr, Jos. W. Crawley, and Thos. Devlin, successors to E. Hall Ogden, and whose store is at 307 Arch Street, Philadelphia.

In this large establishment, where everything is conducted with the best order and understanding, anything in the line of ordinary and malleable castings for building and cabinet, carriage and saddlery hardware, etc., is made complete, from the pattern to the casting, annealing, coppering, adjusting and japanning of the articles. Indeed, the mechanical appliances for finishing and adjusting different parts, comprise one of the most interesting departments of the works, with their planing machines, lathes, punches, screw-cutting tools, grinding and polishing stones, and drills which allow of the drilling of several holes in the same piece at the same, and at various angles.

The pig iron used preferably for malleable castings is a white charcoal pig, and is melted in cupolas, or in a reverberatory furnace (Fig. 43). This latter furnace, of which A is the fire-place, B the hearth, C the tap-hole, D the flue towards the stack, and E the door through which the impurities are removed from

the top of the molten metal, consumes more fuel, and produces more waste than the cupola. On the other hand, the metal is purer, because it is not melted in

Fig. 43.



direct contact with the fuel, and does not absorb its impurities, sulphur especially. There is also the advantage that, should the metal contain too much

carbon, part of it may be removed by the oxidizing action of the flame.

Most of the castings are made in green sand, from metallic patterns, which insure a constancy of shape and of smooth surfaces.

The castings, which are as brittle as glass, are then put into "tumblers," which are revolving cylinders of cast iron with ribs inside, in which the articles are deprived of adhering sand, and become polished by mutual friction.

The cleaned castings, intended for conversion into malleable iron, are next packed close, with alternate layers of powdered iron scales from rolling mills, into rectangular cast iron boxes, D (Fig. 44), which become of a rather elliptic shape, after a certain length of use, and which can be placed one upon top of the other, if need be, and closed at the top by a mixture of sand and clay, which prevents contact with the air, and follows the settling of the mass.


Fig. 44 represents the disposition of the annealing furnace, which resembles those employed for making the bone-black of sugar refineries. A is the fire-place, B a flue conducting the flame into the annealing chamber, C and D D D are the cast iron boxes filled with the iron scales and the articles to be softened.

Leaving aside the time necessary for raising the temperature, and the cooling off, the articles are subjected for about a week to a white heat, not sufficient, however, to melt what may still remain of cast iron.

After a proper annealing, the castings are covered with a film of oxide of iridescent colors—the yellow and azure blue predominating—which resembles that kind of Champlain iron ore called *peacock*, on account of its coloration.

Any adherent oxide is removed by another passage through the "tumblers," and the process of malleable iron making is finished. Any further grinding,

Fig. 44.

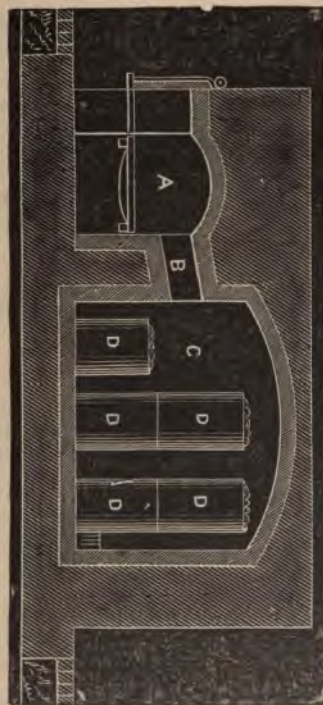

polishing, boring, and adjusting which may be needed, is made in the same works.

The oxide of iron, or scales, employed, have parted

with a portion of their oxygen during the annealing process, and the loss is made good by grinding the scales, and rusting them with a solution of sal ammoniac (hydrochlorate of ammonia). It seems to us possible to do without the expense of sal ammoniac, by wetting the powdered scales several times with water, stirring and drying them on the top of the annealing furnace. Among the products manufactured by the above mentioned firm, we have noticed hinges, entirely of cast iron, and others with wrought iron pivots; patent elastic washers for railroad fish-plates, which prevent the nut from unscrewing, and keep it tight; castors for furniture, bolts, pulleys for cords of window sashes, keys, padlocks, screw presses, carriage parts, saddlery hardware, etc., etc. In fact, it would be necessary to make a catalogue with an index, of all of the patterns which were shown to us.

It is difficult to state the cost of malleable iron castings, since it depends to a great extent upon the size and the quantity of the articles. We may say, however, that being given a certain pattern, the malleable iron castings will cost from seventy to eighty per cent. more than ordinary castings from the same pattern. This increase of price is necessitated by more labor, the consumption of fuel for annealing, greater cost of pig metal employed, etc., etc.

To sum up, malleable iron castings are useful, whenever equal strength of material being not needed, the cost in labor, if made of wrought iron, would be too great; or when a casting is needed without the brittleness of common cast iron. Scissors, sewing machine parts, the butt ends and guards, and many

other parts of gun locks, ornaments, etc., etc., are made in quantities from malleable iron castings. Even nails, of all sizes, are thus manufactured in England, and we are disposed to believe that, if made of good metal and well annealed, they may be at least equal to certain cut-nails produced from inferior plate, and the fibre of which has been broken by the concussion of the cutting machine.

Oxide of zinc has been proposed as a substitute for oxide of iron, under the plea that the operation is more rapid.

INDEX.

	PAGE.		PAGE.
Accidents in moulding.....	255	Bags, linen, for coal dust, etc.	30
Accidents, repairing.....	271	Baker's blower.....	291
Air and gas passage.....	267	Bas-relief.....	142, 143
Air for combustion.....	212	Bath tub, to mould an oval.	132
Air furnace for melting iron		Battisterio in Florence, doors	
in crucibles.....	192-193	of.....	137
Allegories, moulding sand		Beams, what to be cast in.....	188
in the.....	21	Bed plates, heavy, for steam	
Alloys and metals, contrac-		engines.....	134
tion of.....	316-319	Bell, bronze for.....	224
Alloys and Metals, table of		Bell metals.....	226
specific gravities of.....	252	Bell, silver, of Rouen.....	229
Alloys and metals, table of		Bells, defects in.....	145
tenacities and resistances		Bells, moulding of.....	143-146
of.....	251	Bellows.....	30
Alloys, casting of.....	224	Bent pipe, moulding a.....	128-132
Alloys melting in crucibles.....	211	Bevelled wheel, moulding a.....	82
Alloys, new.....	280-283	Bituminous stone coal dust.....	20
Alloys of copper.....	228	Blackening liquid.....	75
Alloys of iron.....	226-228	Blackening, mills for grind-	
Alloys of the precious metals.....	228	ing.....	22
Alum casting.....	176	Blackening of iron casts.....	247
Alum plaster.....	275	Blackening the mould.....	41
Aluminum-bronze.....	280, 281	Black iron, spongy.....	182
Ancients, bronze weapons		Blacklead.....	19
of.....	229, 230	Black wash for parting.....	110
Angles in patterns.....	301, 302	Blast.....	290, 291
Animals, moulding.....	176	Blast, hot.....	217
Annealing furnace for mal-		Blast machines.....	212-217
leable iron castings.....	330, 331	Boshes for wheels.....	146
Anthracite dust.....	19	Box suspending from a crane.....	25
Anthracite pig No. 1.....	180	Box to turn upside down.....	56
Anthracite regions, mould-		Boxes, bending of.....	56
ing sands in the.....	21	Boxes for dry sand mould-	
Anti-friction metal.....	239	ing.....	86
Antimony and copper, alloy		Boxes, large, should be made	
of.....	236	of iron.....	26
Antimony, melting.....	211	Boxes or flasks.....	23
Antique bronze.....	241	Boxes, square.....	26
Anvils.....	152	Boxes, wooden and iron, rel-	
Argentam.....	235, 236	ative advantages of.....	28
Arsenic and copper, alloy of		Brass.....	234
of.....	236	Brass and bronze orna-	
Arsenic, effect of on iron.....	227	mental castings.....	278, 279
Artificial wood impressions.....	162	Brass and copper, moulds	
Aztecs, bronze of the.....	232	for.....	154, 155
		Brass for hammering.....	234

PAGE.	PAGE.
Brass for ship nails..... 235	Cannon balls, casting 298, 299
Brass, gilding of..... 243, 244	Capital of a column, forming 78
Brass, making..... 224, 225	Carbon, effect of, on copper..... 237
Brass, melting in crucibles..... 211, 224	Carbon, effect of, on iron..... 236
Brass or bronze moulding..... 95	Carbon in pig iron, to burn off..... 321
Brass or bronze moulds..... 154	Carbon, to remove, from cast iron..... 324
Brass ornaments cast hollow..... 99	Carr, Crawley & Develin's Malleable Iron Works..... 328
Bread in crumbs as a material for taking impressions..... 150	Car wheels..... 146
Britannia metal..... 239	Car wheels, chilled..... 302-305
Britannia metals, moulds for..... 154	Cast and wrought iron, uniting 288
Bronze and brass ornamental castings..... 278, 279	Cast iron, malleable..... 248, 249, 322-323
Bronze, boiling..... 242	Cast iron, melting of..... 189-211
Bronze, casting..... 223	Cast iron pipes, table of, weight of..... 250
Bronze, casting of..... 94	Cast steel guns..... 297
Bronze castings of large size..... 138	Casting, expenses of..... 221
Bronze color..... 242	Casting, horizontal and vertical..... 86
Bronze, effect of sudden cooling..... 230	Casting iron on to steel..... 152, 153
Bronze for medals..... 233	Casting pipes without cores..... 93-94
Bronze for ordnance..... 294	Casting cannon balls..... 98, 299
Bronze for statues..... 230	Castings, chilled..... 302
Bronze for strong castings..... 224	Castings, cleansing of..... 218-220
Bronze for tools..... 29	Castings, heavy..... 219
Bronze, French, of the time of Louis XIV..... 231	Castings, sharp..... 321
Bronze, gilding of..... 243, 244	Castings, table of shrinkages of..... 318
Bronze, increasing the hardness and tenacity of..... 296	Castings, thin, to remove brittleness..... 321, 322
Bronze in imitation of gold..... 233	Castings, weights of, from patterns..... 319, 320
Bronze, melting and pouring..... 295	Castings which ought to have a good surface—what they should be cast in..... 188
Bronze, melting in crucibles..... 211	Castings which require strength to be cast upright or inclined..... 188
Bronze of great tenacity..... 229	Centrifugal blast machine..... 212
Bronze of the ancient Greeks..... 231	Chaplet..... 75
Bronze of the statue of Louis XV..... 231	Charcoal iron, No. 1..... 180
Bronze of the Vendome Column..... 231	Charcoal pig iron..... 182
Bronze or iron moulding, small articles..... 95	Charcoal powder..... 20
Bronze ornaments, moulding of..... 136-138	Chilled car wheels..... 302-305
Bronze, shrinking of ordnance..... 295	Chilled castings..... 302
Bronze statuary, Philadelphia..... 255	Chilled railroad car wheels..... 146-148
Bronze, the ancient Mexican..... 232	Chilled rollers..... 148
Bronze to be gilt..... 233	Chilled rollers, important point in making..... 150
Bronze, waste of, in casting..... 223-224	Chilled rollers or chilled wheels, iron for..... 188
Bronzes, ancient..... 136-138	Chinese gongs..... 250
Bronzing and coating..... 241-249	Chinese packfong..... 235, 236
Bugs, moulding..... 176	Chromium, effect of, on iron..... 227
Bureau Bros. & Heaton..... 255	Clay..... 17
Burning of the sand, preventing..... 19, 20	
Button brass..... 234	

	PAGE.		PAGE
Clay, for taking impressions in.....	162	Core inside, or real, requirements for.....	266
Clay, plastic, for deeply cut patterns.....	277	Core irons dipped in clay water.....	122
Cleaner.....	29	Core irons, hemp, cotton, or straw in.....	122
Cleansing of castings, 218, 219, 220	220	Core loam, cow hair in.....	122
Coal basins, moulding sand in the.....	21	Core, removing the.....	116
Coal burning out of the sand	21	Core sand.....	16, 44
Coal districts, sands of.....	15	Core sand, safest.....	74
Coal dust.....	19	Core spindles.....	23
Coal powder, disadvantages of too much in moulding.....	57, 59	Core, true, finishing.....	267
Coal powder inadmissible for small castings.....	94	Core, true, to remove.....	238
Coal powder not to be mixed with coarse sand.....	58, 59	Cores.....	73
Coarse grain pig iron.....	182	Cores, black washing.....	122
Coarse sand, ramming the.....	33	Cores, curved or angular.....	74
Coarse open sand for heavy castings.....	58	Cores, false.....	261-263
Coating the mould.....	269	Cores, fastening with wires.....	238
Coffee kettle, moulding a.....	67-70	Cores for moulding a stag 97, 98, 99	99
Cog wheel, moulding a.....	52	Cores forming the steam ways.....	121
Coke dust.....	20	Cores, globular.....	76
Coke pig iron.....	180	Cores, heating to redness.....	122
Cold and hot blast iron, to distinguish.....	183	Cores, heavy, of loam.....	81
Cold blast iron.....	182	Cores, in a lying box, to make	81
Column, capital of a, forming hollow.....	78	Cores, long or thin, stiffened by iron wires.....	74
Column, moulding a square hollow.....	63-66	Cores of complicated figures	100
Column, moulding of a.....	76-80	Cores, round.....	76
Columns of cast iron, table of, to sustain a given load.....	251	Cores, small common.....	75, 76
Combustion, air for.....	212	Cores sand, small.....	288, 289
Complicated forms, to mould	134	Crane.....	25
Composition of moulding sand.....	43-46	Crucibles, copper, bronze, etc., melted in.....	211
Contraction of metals and alloys.....	316-319	Crucibles, melting iron in 192-196	196
Copper, alloys of.....	228	Crucibles, melting of metals in cooling.....	303, 301
Copper and arsenic, alloy of	237	Cupola furnace, work done by.....	208
Copper and antimony, alloy of.....	236	Cupola, the.....	201-209
Copper and brass, moulds for.....	154, 155	Cupolas.....	200
Copper and platinum, alloy for.....	236	Curved forms, moulding.....	133
Copper and silver, alloy of.....	236	Cymbals.....	230
Copper, antimony and zinc, alloy of.....	237	Cylinder blast machine.....	212
Copper, effect of, on iron.....	227	Cylinder for steam engine, moulding a.....	117, 118
Copper melting in crucibles	211	Cylindrical columns of cast iron, table of, to sustain a given load.....	251
Core box for water and gas pipes.....	80	Dark gray pig iron.....	179, 180, 181
Core, fitting in its place.....	289	Deeply cut pattern, plastic clay for.....	277
Core for a pipe.....	80	Diamonds, imitation.....	240
Core for cylinder.....	122-127	Dished utensils, casting of.....	70
Core, hair for preventing of cracking of loam.....	103	Dividing the pattern.....	239
		Division of labor in green sand moulding.....	46
		Door hinges, cast iron.....	236
		Dried cores with green sand	73
		Drying stoves.....	217, 218

INDEX.

837

	PAGE.		PAGE.
Dry sand moulding.....	84-96	Gas and air passages.....	267
Drying the moulds.....	270	Gas pipes.....	80
Electron.....	236	Gas pipes or air pipes of a heavy casting.....	115
Electroplaters, moulds for.....	813, 814	Gases generated in a loam mould.....	108
Electrotype.....	307, 308	Gases from charcoal dust, to avoid.....	321
Emory wheels.....	822	Gates.....	36, 37, 38
Enameling of metal castings.....	246	Gates for entrance of metal.....	263
Expenses of moulding and casting.....	221	Gelatine for moulds.....	314, 315
Extremities, difficulty of metal reaching.....	280	German silver.....	235-236
Face dust for castings.....	20	German silver melting in crucibles.....	211
Facing sand.....	32	German silver, solder for.....	236
False cores.....	261-263	Gilding of bronze and brass.....	243, 244
False cores, fastening, with wires.....	268	Gilding of iron.....	244
Fan, the.....	212-217	Glands.....	34
Feldspar, sand of.....	15	Glass, colored impressions in.....	161
Fine castings, moulding of.....	94	Glass, impressions in.....	158-161
Fine strong sand not to be used for heavy mouldings in green sand.....	57	Glazing of metal castings.....	246, 247
Finishing of castings.....	255	Glue as a material for making casts.....	175
Fire grates, moulding.....	66	Gold, alloys of.....	225
Flame issuing from a loam mould.....	108	Gold bronze, imitation of.....	238
Flasks.....	27, 259	Gold combination with iron.....	227
Flasks, appearance of when boxes, patterns, and gates are in their places.....	38, 39	Gold melting in crucible.....	211
Flasks or boxes.....	23	Gongs, bronze of.....	230
Flasks, snap.....	283-285	Grate bars, moulding.....	66
Flasks, turning the, over.....	285	Gray-wache, sand of.....	15
Flexible moulds.....	308-309	Greeks, ancient, bronze of.....	231
Flies, moulding.....	176	Green sand moulding, difficulties in.....	46, 47
Flowers, moulding.....	176	Green sand, moulding in.....	81
Flow gates.....	113-114	Green sand with dried cores.....	73
Fluid iron will make fine and sharp castings.....	100	Grinding of cast iron.....	248
Fonderie a Calebasse.....	292, 293	Gun, cast steel.....	297
Founding.....	179-225	Gutta-percha moulds.....	313, 314
Foundry, iron.....	179-180	Hardening of plaster.....	275
French bronze of the time of Louis XIV.....	231	Heavy castings.....	219
French mode of moulding statues.....	139	Heavy castings, sand for.....	58, 59
French speculum metal.....	232	Heavy machinery, iron of which best made.....	187
French system of moulding, objection and advantages.....	256	Hinges, moulding.....	66
French system, practical process.....	257, 258	Hinges, ornamental castings for.....	278
Fuel, consumption of in melting.....	221	Hollow column, moulding a.....	63-66
Furnace air for melting iron.....	192-193	Hollow projectiles.....	299
Fusible metals melting in iron pots.....	211	Hollow ware boxes used in moulding.....	71
		Hollow ware casting.....	28
		Hollow ware moulders, peculiarly shaped tools required by.....	71
		Hollow ware moulding.....	68-68
		Hollow ware of cast iron.....	182
		Hollow ware, patterns for.....	71
		Hollow ware, plumbago blackening for.....	71

	PAGE.		PAGE.
Hollowness in solid shot.....	300	Irons, testing of.....	184
Horizontal and vertical casting.....	86	Iron trinkets, solder for.....	99
Horn, impressions in.....	158	Isinglass as a material for making casts.....	175
Hot blast.....	217	Joining the parts of a statue.....	272, 273
Hot blast and cold blast iron.....	182	Joints of separately cast pieces.....	272, 274
Impressions in castings.....	158	Kettles, moulding.....	66, 104
Inside or real core, requirements for.....	266	Knobs, ornamental castings for.....	278
Iron, alloys of.....	226-228	Labor, division of in green sand moulding.....	46
Iron and copper.....	227	Ladies.....	191
Iron and gold.....	227	Large pipe, moulding of.....	87-93
Iron and lead, alloy of.....	227	Latches, moulding.....	66
Iron and silver, alloy of.....	227	Lead, alloys of.....	237-239
Iron and tin.....	227	Lead and iron, alloy of.....	227
Iron, arsenic in.....	227	Lead, melting.....	211, 224
Iron boxes.....	23	Lead, tin, etc., mould for.....	153, 154
Iron, carbon in.....	226	Leaves, moulding.....	146
Iron castings, malleable.....	322-333	Lifting screws.....	40
Iron, casting on to steel.....	152, 153	Lifting the pattern.....	43
Iron casting, when cast hollow and when not.....	100	Light iron castings.....	31
Iron casts, blackening of.....	247	Loam.....	18
Iron columns, table of.....	251	Loam articles used for preventing cracking.....	106
Iron containing too little carbon, how improved.....	186	Loam board.....	108
Iron, dark gray pig.....	179, 180	Loam, importance of the porosity of.....	102
Iron, different kinds of.....	179-188	Loam mortar.....	107
Irons, elasticity of.....	184	Loam moulding.....	100-103
Iron flasks.....	71	Loam moulding, general remarks on.....	127
Iron for chilled rollers or chilled wheels.....	188	Loam worked to make texture uniform.....	103
Iron for railings and ornaments.....	187	Locks, moulding.....	66
Irregular forms, moulding.....	128-132	Locks, ornamental castings for.....	278
Iron, gliding of.....	244	Lottinoplastique.....	309-312
Iron, grinding of cast.....	248	Machine frames, what to be cast in.....	188
Iron hot blast, advantage of.....	185	Machinery, moulding small articles of.....	61
Iron, hot blast and cold blast.....	182	Maine, moulding sand in.....	1
Iron, if too gray how improved.....	185	Malleable cast iron.....	248, 249
Iron in the blast furnace.....	188	Malleable iron castings.....	283, 284, 322-333
Iron, loss of in melting.....	222	Malleable iron castings, cost of.....	332
Iron melting in crucibles.....	192-196	Malleable iron castings, uses of.....	332
Irons mixed together stronger than the average.....	186	Manganese copper.....	260
Iron mixing of.....	184	Manheim gold.....	234
Iron No. 1.....	179, 180	Maryland, moulding sand in.....	21
Iron No. 2.....	181	Mastic for filling holes.....	321
Iron No. 3.....	181		
Iron of which to cast a chill.....	150		
Iron, phosphorus in.....	226		
Iron plates.....	23		
Iron required for small castings.....	187		
Iron, silicon in.....	227		
Iron statues.....	142		
Iron, sulphur in.....	226		

	PAGE.		PAGE.
Meal.....	31	Moulding, noblest of the arts.....	13
Medals, bronze for.....	233	Moulding of a column.....	76-8
Melting in reverberatory furnaces.....	196-201	Moulding of a large pipe.....	87-9
Melting iron in crucibles.....	192-195	Moulding of bells.....	113-14
Melting of cast iron.....	188-201	Moulding of bronze ornaments.....	13-15
Melting of metals.....	179-211	Moulding of fine castings.....	5
Melting the metal.....	271	Moulding of more than two boxes.....	5
Metal castings, glazing of.....	245, 247	Moulding of simple round forms.....	104
Metal, fluid, temperature of.....	270	Moulding of statues.....	133-142
Metal moulds.....	153	Moulding of statues in plaster of Paris.....	168-174
Metal used for ordnance.....	296, 297	Moulding ordnance.....	294-295
Metals and alloys, contraction of.....	316-319	Moulding, ornamental.....	62
Metals and alloys, table of specific gravities of.....	252	Moulding oval forms.....	132
Metals and alloys, table of tenacities and resistances.....	251	Moulding plate.....	283-285
Metals, crystallization of, in cooling.....	300, 301	Moulding pipes.....	86
Metals, melting of.....	179-211	Moulding proper.....	13, 14
Metamorphic strata, moulding sand in.....	21	Moulding sand.....	14
Mills for grinding blackening.....	22	Moulding sand, composition of.....	43-46
Mixed sand moulding.....	73	Moulding sand for ordnance.....	297
Mixing of iron.....	184	Moulding sand, good, where found in the United States.....	21
Mortises and tenons.....	258	Moulding sand, importance of, for small articles.....	94
Mould, blackening the.....	41	Moulding small articles, osseous for.....	279
Mould, coating the.....	269	Moulding triangular forms.....	132
Mould in which iron is cast has an influence on its strength.....	188	Moulding, two distinct branches.....	13
Mould, preparation of, for casting.....	236	Moulding with plates.....	82
Moulding.....	13-178	Moulds, drying the.....	270
Moulding a coffee kettle.....	68-70	Moulds, flexible.....	308, 309
Moulding a cog wheel.....	52	Moulds for castings of white metals.....	276
Moulding a stag.....	96	Moulds for copper and brass.....	154, 155
Moulding curved forms.....	132, 153	Moulds for lead, tin, etc.....	153, 154
Moulding, dry sand.....	84-86	Moulds for ordnance.....	296
Moulding, expenses of.....	221	Moulds, gelatine.....	314
Moulding, French system.....	260	Moulds, gutta-percha.....	313, 314
Moulding, high interest of.....	13	Moulds, metal.....	133
Moulding hollow ware.....	66-68	Moulds partly of loam and sand, and partly of metal.....	146
Moulding in green sand.....	31	Moulds, temperature of the.....	270
Moulding in greensand with dried cores.....	73	Mounting or joining the parts of a statue.....	272, 273
Moulding in loam without thickness.....	116	Musical instruments, to give a sonorous property to.....	230
Moulding in one box.....	50-52	Music metal.....	239
Moulding in open sand.....	48-50		
Moulding in wax.....	276, 277		
Moulding irregular forms.....	124-132		
Moulding loam.....	100-103	Natural objects, moulding.....	176-178
Moulding loam, composition of artificial.....	102	New or French system of moulding.....	256
Moulding, materials used in.....	14	No. 1 iron.....	179-180
Moulding, mixed sand.....	73	No. 2 iron.....	181
Moulding natural objects.....	176-178	No. 3 iron.....	181

	PAGE.		PAGE.
No. 3, white pig iron.....	181	Pipes.....	80
Nurnburg gold.....	234	Pipes, casting.....	23
Openings or gates for en-		Pipes, cast iron, weight of.....	250
trance of metal.....	253	Pipes, moulding.....	86
Open porous sand.....	58	Pipes without cores.....	93-94
Open sand, moulding in.....	48-50	Pittsburgh, or hanging rock	
Operations in the cupola.....	205-209	iron.....	180
Ordinance.....	293-300	Plaster, alum.....	275
Ordinance, bronze for.....	294	Plaster castings, large, made	
Ordinance, bronze, shrink-		hollow.....	172
age of.....	295	Plaster, hardening the.....	275
Ordinance cast solid and with		Plaster of Paris, impressions	
cores.....	297, 298	in.....	163-168
Ordinance, moulding.....	294, 295	Plaster of Paris, moulding of	
Ordinance, moulds for.....	296	statues in.....	168-174
Ordinance, pig metal used		Plaster pattern, separating	
for.....	296, 297	the parts of.....	258
Ordinance, sand for mould-		Plastic clay for deeply cut	
ing.....	297	patterns.....	277
Organ pipes, metals for.....	239, 240	Plate moulding.....	283-285
Ornamental castings for		Plates, moulding with.....	82
door locks, knobs, etc.....	278	Platinum and copper, alloy	
Ornamental compositions.....	93	for.....	236
Ornamental moulding.....	62	Plumbago blackening for	
Oval forms, moulding.....	132	hollow ware.....	71
Packfong, Chinese.....	235, 236	Plumbago, where found.....	22
Paper, impressions in.....	158	Polishing tools.....	29
Parting sand.....	30, 36	Porous sand.....	45
Passages for the metal.....	37	Potash, use of, in casting.....	223
Pattern, cleaning the.....	41	Pots.....	210, 211
Pattern, dividing the.....	269	Pots, moulding.....	63
Pattern, forming the.....	14	Precious metals, alloys of.....	228
Pattern, lifting the.....	43	Pressure of fluid metal.....	270
Pattern, removing the.....	265	Princess metal.....	234
Pattern, separating.....	258	Processes and receipts, mis-	
Pattern, to withdraw a.....	40	cellaneous.....	320-322
Patterns for hollow ware re-		Projectiles, hollow.....	299
quired to be accurate.....	70	Pulley, moulding a.....	59, 60
Patterns which may be cast		Queen's metal.....	239
by French process.....	274, 275	Railing, moulding.....	62
Patterns, no sharp angles.....	301, 302	Railing post, moulding a.....	62-66
Pease-meal.....	31	Railings, irons for.....	187
Pennsylvania, moulding		Railroad car wheels, chilled	
sand in.....	21	146-148	
Pewter.....	209	Rammers of wood and iron.....	29
Pewter, moulds for.....	154	Reaumur, M.....	322
Philadelphia bronze statu-		Receipts and processes, mis-	
ary.....	155	cellaneous.....	320-322
Phosphor bronze.....	280-283	Receipts and tables.....	226-252
Phosphorus, effect of, on		Red brass.....	224
copper.....	237	Reflectors, metal for.....	240
Phosphorus, effect of on		Refuse and scrap in making	
iron.....	226	castings.....	223
Phosphorus in pig iron.....	182	Relief impressions.....	158
Piercers or pricklers.....	30	Repairing accidents.....	271
Pig metal holding copper,		Reverberatory furnace for	
castings from.....	321	malleable iron castings.....	328-330
Pipe, moulding a bent.....	128-132	Reverberatory furnaces, melt-	
Pipe, moulding a large.....	87-93	ing in.....	196-201

PAGE.	PAGE.
Reverberatory furnaces, the... 197	Shrinkage of metals and alloys 316-319
Riddle..... 30	Shrinkage of ordnance bronze..... 205
Roller, to cast a..... 150-152	Shrinkages of castings..... 318
Rollers, chilled..... 148	Ship nails, brass for..... 235
Rollers, chilled, important point in making..... 150	Shot, hollowness in..... 300
Rollers for iron works..... 134	Shovels..... 30
Rollers, what to be cast in..... 188	Sieves..... 30
Root's blower..... 291	Silicon, effect of, on iron..... 227
Rosette, to mould a..... 95	Silicium-copper..... 230
Rosse's telescope, speculum metal of..... 232-233	Silver, alloys of..... 228
Round forms, simple moulding..... 104	Silver and copper, alloy of..... 236
	Silver and iron, alloy of..... 227
	Silver leaf, spurious..... 231
	Silver melting in crucibles..... 211
	Similor..... 234
Sand, bells moulded in..... 143	Simple sand forms, moulding..... 104
Sand, best moulding..... 15	Slate, sand of..... 15
Sand, blackening or coating..... 19	Sleek washing..... 111
Sand, coating of fine, to make smooth castings..... 58	Small articles, importance of moulding sand..... 94
Sand, core..... 16	Small articles of machinery, moulding..... 61
Sand cores, ramming the..... 33	Small castings, iron for..... 187
Sand cores, small..... 288, 289	Small tools..... 28
Sand, different kinds required for moulding..... 15	Smooth surface for large castings, to obtain..... 320
Sand, facing..... 32	Snap flasks..... 233-235
Sand from mountain streams..... 15	Soap kettle or pan, moulding a..... 104
Sand for dry moulding..... 16	Soap stone powder for preventing the burning of the sand..... 30
Sand for moulding ordnance..... 297	Solder for brass and bronze..... 99
Sand for undried moulds..... 16	Solder for German silver..... 236
Sand, good moulding, where found in the United States..... 21	Solder for iron trinkets..... 99
Sand, melting of the..... 19	Solders..... 276
Sand, moulding..... 14	Sonorous property of musical instruments..... 230
Sand, moulding, color of..... 16	Specific gravities of metals and alloys..... 252
Sand, moulding in open..... 48-50	Speculum metal..... 232, 233
Sand of transition or metamorphous rocks..... 15	Speculum metal of Lord Rosse's telescope..... 232, 233
Sand, open porous..... 45, 58	Spiegeleisen..... 230, 233
Sand, parting..... 30, 36	Spinning machines, castings for..... 61
Sand, preventing the burning of the..... 19, 30	Square hollow column, moulding a..... 63-66
Sand, primary rocks..... 15	Stag, moulding a..... 96
Sand, river..... 15	Statuary and ornamental moulding..... 253-277
Sand used for malleable iron casting..... 330	Statue, mounting or joining the parts of..... 273, 275
Sands used..... 263, 264	Statues, bronze for..... 230
Sands, white or gray..... 16	Statues, French mode of moulding..... 139
Scaffolding..... 293	Statues in plaster of Paris..... 168-174
Scotch pig iron..... 180	Statues, iron..... 142
Screw propeller..... 135, 136	
Sealing wax, impressions in..... 159, 175	
Separately cast pieces, joints of..... 273, 274	
Separating the parts of plaster pattern..... 258	
Sharp angles in patterns..... 301, 302	
Sharp castings..... 321	

	PAGE.		PAGE.
Statues, moulding of.....	138-142	Undercut plaster patterns,	
Steel guns.....	297	to destroy.....	321
Ste in ways, the cores form-		Vendome, bronze of column	231
ing the.....	121	Vent holes.....	43
Stereotypes.....	305-307	Vent holes for escape of gases	74
Stereotyping.....	155-157	Vertical and horizontal cast-	
Stoves, drying.....	217, 218	ing.....	86
Stoves, moulding.....	96, 97	Virginia, moulding sand in	21-22
Stove plates, moulding.....	96	Vises.....	132
Sulphur a valuable material		Water pipes.....	80
for sharp castings.....	174	Wax, a firm and fusible.....	320
Sulphur, effect of, on iron.....	226	Wax as a material for taking	
Sulphur, impressions in.....	158, 160	impressions with.....	159
Swivels.....	286-288	Wax a useful material for	
Tables.....	250-252	casting.....	175
Tables of shrinkages of cast-		Wax, impressions in.....	158
ings.....	318	Wax, moulding in.....	276, 277
Tables of weights of castings		Wax, moulding with.....	139
from patterns.....	319, 320	Wax, pattern mixture for.....	321
Tamams.....	230	Wax process.....	253-255
Temperature of the moulds.....	270	Welding together steel and	
Tenacities and resistances of		cast iron.....	152
metals and alloys, table of	251	Weights of castings from	
Tennons and mortises.....	258	patterns.....	319, 320
Tertiary, deposits in the.....	21	Whalebone, impressions in	158
Thin castings, to remove		Wheel, beveled, moulding a	82
brittleness from.....	321, 322	Wheels, chilled car.....	302-305
Time for casting.....	220	White metals, moulds for	
Tin, alloys of.....	233-41	castings of.....	276
Tin and iron, alloy of.....	227	White pig iron No. 3.....	181
Tin foil.....	240	Whitney & Son's chilled car	
Tin, lead, etc., moulds for.....	153, 154	wheels.....	302-305
Tin, melting.....	211, 224	Wires for false cores.....	268
Tin, waste of, in casting.....	223	Wood, artificial impressions	
Tinning of brass, iron and		in.....	162
copper.....	245	Wood, Robt. & Co.....	255
Tombac.....	254	Wrought and cast iron, unfit-	
Tools for moulding.....	23	ing.....	288
Tools required.....	274	Zinc, alloys of.....	241
Tools, small.....	28	Zinc castings.....	276
Traverses.....	33, 34, 36	Zinc, melting.....	211
Triangular forms, moulding		Zinc, moulds for.....	154
Trowels.....	28	Zinc, waste of, in casting.....	223
True core, finishing the.....	267	Zinking of copper or bronze	
True core, to remove.....	268		243, 246
Turning the flasks over.....	263		
Types, moulds for.....	154		
Uchatius, Gen'l. experi-			
ments with bronze.....	296		

CATALOGUE

OF

Practical and Scientific Books

PUBLISHED BY

HENRY CAREY BAIRD & CO.

INDUSTRIAL PUBLISHERS, BOOKSELLERS AND IMPORTERS.

810 Walnut Street, Philadelphia.

- Any of the Books comprised in this Catalogue will be sent by mail, free of postage, to any address in the world, at the publication prices.
- A Descriptive Catalogue, 84 pages, 8vo., will be sent free and free of postage, to any one in any part of the world, who will furnish his address.
- Where not otherwise stated, all of the Books in this Catalogue are bound in muslin.

AMATEUR MECHANICS' WORKSHOP:

A treatise containing plain and concise directions for the manipulation of Wood and Metals, including Casting, Forging, Brazing, Soldering and Carpentry. By the author of the "Lathe and Its Uses." Seventh edition. Illustrated. 8vo. . . . \$2.50

ANDRES.—A Practical Treatise on the Fabrication of Volatile and Fat Varnishes, Lacquers, Siccatives and Sealing Waxes.

From the German of ERWIN ANDRES, Manufacturer of Varnishes and Lacquers. With additions on the Manufacture and Application of Varnishes, Stains for Wood, Horn, Ivory, Bone and Leather. From the German of DR. EMIL WINCKLER and LOUIS E. ANDES. The whole translated and edited by WILLIAM T. BRANNT. With 11 illustrations. 12mo. . . . \$2.50

ARLOT.—A Complete Guide for Coach Painters:

Translated from the French of M. ARLOT, Coach Painter, for eleven years Foreman of Painting to M. Eherler, Coach Maker, Paris. By A. A. FESQUET, Chemist and Engineer. To which is added an Appendix, containing Information respecting the Materials and the Practice of Coach and Car Painting and Varnishing in the United States and Great Britain. 12mo. . . . \$1.25

ARMENGAUD, AMOROUX, AND JOHNSON.—The Practical Draughtsman's Book of Industrial Design, and Machinist's and Engineer's Drawing Companion:

Forming a Complete Course of Mechanical Engineering and Architectural Drawing. From the French of M. Armengaud the elder, Prof. of Design in the Conservatoire of Arts and Industry, Paris, and MM. Armengaud the younger, and Amoroux, Civil Engineers. Rewritten and arranged with additional matter and plates, selections from and examples of the most useful and generally employed mechanism of the day. By WILLIAM JOHNSON, Assoc. Inst. C. E. Illustrated by fifty folio steel plates, and fifty wood-cuts. A new edition, 4to., half morocco \$10.00

ARMSTRONG.—The Construction and Management of Steam Boilers:

By R. ARMSTRONG, C. E. With an Appendix by ROBERT MALLET, C. E., F. R. S. Seventh Edition. Illustrated. 1 vol. 12mo. 75

ARROWSMITH.—Paper-Hanger's Companion:

A Treatise in which the Practical Operations of the Trade are Systematically laid down: with Copious Directions Preparatory to Papering; Preventives against the Effect of Damp on Walls; the various Cements and Pastes Adapted to the Several Purposes of the Trade; Observations and Directions for the Panelling and Ornamenting of Rooms, etc. By JAMES ARROWSMITH. 12mo., cloth \$1.25

ASHTON.—The Theory and Practice of the Art of Designing Fancy Cotton and Woollen Cloths from Sample:

Giving full instructions for reducing drafts, as well as the methods of spooling and making out harness for cross drafts and finding any required reed; with calculations and tables of yarn. By FREDERIC T. ASHTON, Designer, West Pittsfield, Mass. With fifty-two illustrations. One vol. folio \$6.00

ASKINSON.—Perfumes and their Preparation:

A Comprehensive Treatise on Perfumery, containing Complete Directions for Making Handkerchief Perfumes, Smelling-Salts, Sachets, Fumigating Pastils; Preparations for the Care of the Skin, the Mouth, the Hair; Cosmetics, Hair Dyes, and other Toilet Articles. By G.W. ASKINSON. Translated from the German by ISIDOR FURST. Revised by CHARLES RICE. 32 Illustrations. 8vo. \$3.00

BAIRD.—Miscellaneous Papers on Economic Questions. By Henry Carey Baird. (*In preparation.*)

BAIRD.—The American Cotton Spinner, and Manager's and Carder's Guide:

A Practical Treatise on Cotton Spinning; giving the Dimensions and Speed of Machinery, Draught and Twist Calculations, etc.; with notices of recent Improvements: together with Rules and Examples for making changes in the sizes and numbers of Roving and Yarn. Compiled from the papers of the late ROBERT H. BAIRD. 12mo. \$1.50

BAIRD.—Standard Wages Computing Tables:

An Improvement in all former Methods of Computation, so arranged that wages for days, hours, or fractions of hours, at a specified rate per day or hour, may be ascertained at a glance. By T. SPANGLER.

BAIRD. Oblong folio \$5.00

BAKER.—Long-Span Railway Bridges:

Comprising Investigations of the Comparative Theoretical and Practical Advantages of the various Adopted or Proposed Type Systems of Construction; with numerous Formulæ and Tables. By B. BAKER. 12mo. \$1.50

BAKER.—The Mathematical Theory of the Steam-Engine:

With Rules at length, and Examples worked out for the use of Practical Men. By T. BAKER, C. E., with numerous Diagrams. Sixth Edition, Revised by Prof. J. R. YOUNG. 12mo. 75

BARLOW.—The History and Principles of Weaving, by Hand and by Power:

Reprinted, with Considerable Additions, from "Engineering," with a chapter on Lace-making Machinery, reprinted from the Journal of the "Society of Arts." By ALFRED BARLOW. With several hundred illustrations. 8vo., 443 pages \$10.00

BARR.—A Practical Treatise on the Combustion of Coal:

Including descriptions of various mechanical devices for the Economic Generation of Heat by the Combustion of Fuel, whether solid, liquid or gaseous. 8vo. \$2.50

BARR.—A Practical Treatise on High Pressure Steam Boilers:

Including Results of Recent Experimental Tests of Boiler Materials, together with a Description of Approved Safety Apparatus, Steam Pumps, Injectors and Economizers in actual use. By WM. M. BARR. 204 Illustrations. 8vo. \$3.00

BAUERMAN.—A Treatise on the Metallurgy of Iron:

Containing Outlines of the History of Iron Manufacture, Methods of Assay, and Analysis of Iron Ores, Processes of Manufacture of Iron and Steel, etc., etc. By H. BAUERMAN, F. G. S., Associate of the Royal School of Mines. Fifth Edition, Revised and Enlarged. Illustrated with numerous Wood Engravings from Drawings by J. B. JORDAN. 12mo. \$2.00

BAYLES.—House Drainage and Water Service:

In Cities, Villages and Rural Neighborhoods. With Incidental Consideration of Certain Causes Affecting the Healthfulness of Dwellings. By JAMES C. BAYLES, Editor of "The Iron Age" and "The Metal Worker." With numerous illustrations. 8vo. cloth,

BEANS.—A Treatise on Railway Curves and Location of Railroads:

By E. W. BEANS, C. E. Illustrated. 12mo. Tucks \$1.50

BECKETT.—A Rudimentary Treatise on Clocks, and Watches and Bells:

By Sir EDMUND BECKETT, Bart., LL. D., Q. C. F. R. A. S. With numerous illustrations. Seventh Edition, Revised and Enlarged. 12mo. \$2.25

BELL.—Carpentry Made Easy:

Or, The Science and Art of Framing on a New and Improved System. With Specific Instructions for Building Balloon Frames, Barn Frames, Mill Frames, Warehouses, Church Spires, etc. Comprising also a System of Bridge Building, with Bills, Estimates of Cost, and valuable Tables. Illustrated by forty-four plates, comprising nearly 200 figures. By WILLIAM E. BELL, Architect and Practical Builder. 8vo.

\$5.00

BEMROSE.—Fret-Cutting and Perforated Carving:

With fifty-three practical illustrations. By W. BEMROSE, JR. 1 vol. quarto

\$2.50

BEMROSE.—Manual of Buhl-work and Marquetry:

With Practical Instructions for Learners, and ninety colored designs. By W. BEMROSE, JR. 1 vol. quarto

\$3.00

BEMROSE.—Manual of Wood Carving:

With Practical Illustrations for Learners of the Art, and Original and Selected Designs. By WILLIAM BEMROSE, JR. With an Introduction by LEWELLYN JEWITT, F. S. A., etc. With 128 illustrations, 4to.

\$2.50

BILLINGS.—Tobacco:

Its History, Variety, Culture, Manufacture, Commerce, and Various Modes of Use. By E. R. BILLINGS. Illustrated by nearly 200 engravings. 8vo.

\$3.00

BIRD.—The American Practical Dyers' Companion:

Comprising a Description of the Principal Dye-Staffs and Chemicals used in Dyeing, their Natures and Uses; Mordants, and How Made; with the best American, English, French and German processes for Bleaching and Dyeing Silk, Wool, Cotton, Linen, Flannel, Felt, Dress Goods, Mixed and Hosiery Yarns, Feathers, Grass, Felt, Fur, Wool, and Straw Hats, Jute Yarn, Vegetable Ivory, Mats, Skins, Furs, Leather, etc., etc. By Wood, Aniline, and other Processes, together with Remarks on Finishing Agents, and Instructions in the Finishing of Fabrics, Substitutes for Indigo, Water-Proofing of Materials, Tests and Purification of Water, Manufacture of Aniline and other New Dye Wares, Harmonizing Colors, etc., etc.; embracing in all over 800 Receipts for Colors and Shades, accompanied by 170 Dyed Samples of Raw Materials and Fabrics. By F. J. BIRD, Practical Dyer, Author of "The Dyers' Hand-Book." 8vo.

\$10.00

BLINN.—A Practical Workshop Companion for Tin, Sheet-Iron, and Copper-plate Workers:

Containing Rules for describing various kinds of Patterns used by Tin, Sheet-Iron and Copper-plate Workers; Practical Geometry; Mensuration of Surfaces and Solids; Tables of the Weights of Metals, Lead-pipe, etc.; Tables of Areas and Circumferences of Circles; Japan, Varnishes, Lackers, Cements, Compositions, etc., etc. By LEROY J. BLINN, Master Mechanic. With One Hundred and Seventy Illustrations. 12mo.

\$2.50

BOOTH.—Marble Worker's Manual :

Containing Practical Information respecting Marbles in general, their Cutting, Working and Polishing; Veneering of Marble; Mosaics; Composition and Use of Artificial Marble, Stuccos, Cements, Receipts, Secrets, etc., etc. Translated from the French by M. L. BOOTH. With an Appendix concerning American Marbles. 12mo., cloth \$1.50

BOOTH and MORFIT.—The Encyclopædia of Chemistry, Practical and Theoretical :

Embracing its application to the Arts, Metallurgy, Mineralogy, Geology, Medicine and Pharmacy. By JAMES C. BOOTH, Melter and Refiner in the United States Mint, Professor of Applied Chemistry in the Franklin Institute, etc., assisted by CAMPBELL MORFIT, author of "Chemical Manipulations," etc. Seventh Edition. Complete in one volume, royal 8vo., 978 pages, with numerous wood-cuts and other illustrations \$3.50

BRAMWELL.—The Wool Carder's Vade-Mecum :

A Complete Manual of the Art of Carding Textile Fabrics. By W. C. BRAMWELL. Third Edition, revised and enlarged. Illustrated. Pp. 400. 12mo. \$2.50

BRANNT.—A Practical Treatise on Animal and Vegetable Fats and Oils :

Comprising both Fixed and Volatile Oils, their Physical and Chemical Properties and Uses, the Manner of Extracting and Refining them, and Practical Rules for Testing them; as well as the Manufacture of Artificial Butter, Lubricants, including Mineral Lubricating Oils, etc., and on Ozokerite. Edited chiefly from the German of DRS. KARL SCHÆDLER, G. W. ASKINSON, and RICHARD BRUNNER, with Additions and Lists of American Patents relating to the Extraction, Rendering, Refining, Decomposing, and Bleaching of Fats and Oils. By WILLIAM T. BRANNT. Illustrated by 244 engravings. 739 pages. 8vo. \$7.50

BRANNT.—A Practical Treatise on the Manufacture of Soap and Candles :

Based upon the most Recent Experiences in the Practice and Science; comprising the Chemistry, Raw Materials, Machinery, and Utensils and Various Processes of Manufacture, including a great variety of formulas. Edited chiefly from the German of Dr. C. DEITE, A. ENGELHARDT, Dr. C. SCHÆDLER and others; with additions and lists of American Patents relating to these subjects. By WM. T. BRANNT. Illustrated by 163 engravings. 677 pages. 8vo. . . . \$7.50

BRANNT.—A Practical Treatise on the Raw Materials and the Distillation and Rectification of Alcohol, and the Preparation of Alcoholic Liquors, Liqueurs, Cordials, Bitters, etc. :

Edited chiefly from the German of Dr. K. STAMMER, Dr. F. ELSNER, and E. SCHNIBERT. By WM. T. BRANNT. Illustrated by thirty-one engravings. 12mo. \$2.50

BRANNT—WAHL.—The Techno-Chemical Receipt Book:

Containing several thousand Receipts covering the latest, most important, and most useful discoveries in Chemical Technology, and their Practical Application in the Arts and the Industries. Edited chiefly from the German of Drs. Winckler, Elsner, Heintze, Mierzinski, Jacobsen, Koller, and Heinzerling, with additions by Wm. T. BRANNT and Wm. H. WAHL, PH. D. Illustrated by 78 engravings. 12mo. 495 pages \$2.00

BROWN.—Five Hundred and Seven Mechanical Movements:

Embracing all those which are most important in Dynamics, Hydraulics, Hydrostatics, Pneumatics, Steam-Engines, Mill and other Gearing, Presses, Horology and Miscellaneous Machinery; and including many movements never before published, and several of which have only recently come into use. By HENRY T. BROWN. 12mo. \$1.00

BUCKMASTER.—The Elements of Mechanical Physics:

By J. C. BUCKMASTER. Illustrated with numerous engravings. 12mo. \$1.00

BULLOCK.—The American Cottage Builder:

A Series of Designs, Plans and Specifications, from \$200 to \$20,000, for Homes for the People; together with Warming, Ventilation, Drainage, Painting and Landscape Gardening. By JOHN BULLOCK, Architect and Editor of "The Rudiments of Architecture and Building," etc., etc. Illustrated by 75 engravings. 8vo. \$3.50

BULLOCK.—The Rudiments of Architecture and Building:

For the use of Architects, Builders, Draughtsmen, Machinists, Engineers and Mechanics. Edited by JOHN BULLOCK, author of "The American Cottage Builder." Illustrated by 250 Engravings. 8vo. \$3.50

BURGH.—Practical Rules for the Proportions of Modern Engines and Boilers for Land and Marine Purposes.

By N. P. BURGH, Engineer. 12mo. \$1.50

BYLES.—Sophisms of Free Trade and Popular Political Economy Examined.

By a BARRISTER (SIR JOHN BARNARD BYLES, Judge of Common Pleas). From the Ninth English Edition, as published by the Manchester Reciprocity Association. 12mo. \$1.25

BOWMAN.—The Structure of the Wool Fibre in its Relation to the Use of Wool for Technical Purposes:

Being the substance, with additions, of Five Lectures, delivered at the request of the Council, to the members of the Bradford Technical College, and the Society of Dyers and Colorists. By F. H. BOWMAN, D.Sc., F.R.S.E., F.L.S. Illustrated by 32 engravings. 8vo. \$6.50

BYRNE.—Hand-Book for the Artisan, Mechanic, and Engineer:

Comprising the Grinding and Sharpening of Cutting Tools, Abrasive Processes, Lapidary Work, Gem and Glass Engraving, Varnishing and Lackering, Apparatus, Materials and Processes for Grinding and

Polishing, etc. By OLIVER BYRNE. Illustrated by 185 wood engravings. 8vo. \$5.00

BYRNE.—Pocket-Book for Railroad and Civil Engineers:

Containing New, Exact and Concise Methods for Laying out Railroad Curves, Switches, Frog Angles and Crossings; the Staking out of work; Levelling; the Calculation of Cuttings; Embankments; Earthwork, etc. By OLIVER BYRNE. 18mo., full bound, pocket-book form \$1.75

BYRNE.—The Practical Metal-Worker's Assistant:

Comprising Metallurgic Chemistry; the Arts of Working all Metals and Alloys; Forging of Iron and Steel; Hardening and Tempering; Melting and Mixing; Casting and Founding; Works in Sheet Metal; the Processes Dependent on the Ductility of the Metals; Soldering; and the most Improved Processes and Tools employed by Metal-Workers. With the Application of the Art of Electro-Metallurgy to Manufacturing Processes; collected from Original Sources, and from the works of Holtzapffel, Bergeron, Leupold, Plumier, Napier, Scoffern, Clay, Fairbairn and others. By OLIVER BYRNE. A new, revised and improved edition, to which is added an Appendix, containing The Manufacture of Russian Sheet-Iron. By JOHN PERCY, M. D., F. R. S. The Manufacture of Malleable Iron Castings, and Improvements in Bessemer Steel. By A. A. FESQUET, Chemist and Engineer. With over Six Hundred Engravings, Illustrating every Branch of the Subject. 8vo. \$5.00

BYRNE.—The Practical Model Calculator:

For the Engineer, Mechanic, Manufacturer of Engine Work, Naval Architect, Miner and Millwright. By OLIVER BYRNE. 8vo., nearly 600 pages \$3.00

CABINET MAKER'S ALBUM OF FURNITURE:

Comprising a Collection of Designs for various Styles of Furniture. Illustrated by Forty-eight Large and Beautifully Engraved Plates. Oblong, 8vo. \$2.00

CALLINGHAM.—Sign Writing and Glass Embossing:

A Complete Practical Illustrated Manual of the Art. By JAMES CALLINGHAM. 12mo. \$1.50

CAMPIN.—A Practical Treatise on Mechanical Engineering:

Comprising Metallurgy, Moulding, Casting, Forging, Tools, Work-shop Machinery, Mechanical Manipulation, Manufacture of Steam-Engines, etc. With an Appendix on the Analysis of Iron and Iron Ores. By FRANCIS CAMPIN, C. E. To which are added, Observations on the Construction of Steam Boilers, and Remarks upon Furnaces used for Smoke Prevention; with a Chapter on Explosions. By R. ARMSTRONG, C. E., and JOHN BOURNE. Rules for Calculating the Change Wheels for Screws on a Turning Lathe, and for a Wheel-cutting Machine. By J. LA NICCA. Management of Steel, Including Forging, Hardening, Tempering, Annealing, Shrinking and Expansion; and the Case-hardening of Iron. By G. EDE. 8vo. Illustrated with twenty-nine plates and 100 wood engravings \$5.00

- CAREY.**—A Memoir of Henry C. Carey.
By DR. WM. ELDER. With a portrait. 8vo., cloth . . . 75
- CAREY.**—The Works of Henry C. Carey :
Harmony of Interests: Agricultural, Manufacturing and Commercial. 8vo. . . \$1.25
Manual of Social Science. Condensed from Carey's "Principles of Social Science." By KATE MCKEAN. 1 vol. 12mo. . . \$2.00
Miscellaneous Works. With a Portrait. 2 vols. 8vo. . . \$10.00
Past, Present and Future. 8vo. . . \$2.50
Principles of Social Science. 3 volumes, 8vo. . . \$7.50
The Slave-Trade, Domestic and Foreign; Why it Exists, and How it may be Extinguished (1853). 8vo. . . \$2.00
The Unity of Law: As Exhibited in the Relations of Physical, Social, Mental and Moral Science (1872). 8vo. . . \$2.50
- CLARK.**—Tramways, their Construction and Working :
Embracing a Comprehensive History of the System. With an exhaustive analysis of the various modes of traction, including horsepower, steam, heated water and compressed air; a description of the varieties of Rolling stock, and ample details of cost and working expenses. By D. KINNEAR CLARK. Illustrated by over 200 wood engravings, and thirteen folding plates. 2 vols. 8vo. . . \$12.50
- COLBURN.**—The Locomotive Engine :
Including a Description of its Structure, Rules for Estimating its Capabilities, and Practical Observations on its Construction and Management. By ZERAH COLBURN. Illustrated. 12mo. . . \$1.00
- COLLENS.**—The Eden of Labor; or, the Christian Utopia.
By T. WHARTON COLLENS, author of "Humanics," "The History of Charity," etc. 12mo. Paper cover, \$1.00; Cloth . . . \$1.25
- COOLEY.**—A Complete Practical Treatise on Perfumery :
Being a Hand-book of Perfumes, Cosmetics and other Toilet Articles. With a Comprehensive Collection of Formulæ. By ARNOLD J. COOLEY. 12mo. . . \$1.50
- COOPER.**—A Treatise on the use of Belting for the Transmission of Power.
With numerous illustrations of approved and actual methods of arranging Main Driving and Quarter Twist Belts, and of Belt Fastenings. Examples and Rules in great number for exhibiting and calculating the size and driving power of Belts. Plain, Particular and Practical Directions for the Treatment, Care and Management of Belts. Descriptions of many varieties of Beltings, together with chapters on the Transmission of Power by Ropes; by Iron and Wood Frictional Gearing; on the Strength of Belting Leather; and on the Experimental Investigations of Morin, Briggs, and others. By JOHN H. COOPER, M. E. 8vo. . . \$3.50
- CRAIK.**—The Practical American Millwright and Miller.
By DAVID CRAIK, Millwright. Illustrated by numerous wood engravings and two folding plates. 8vo. . . \$3.50

CREW.—A Practical Treatise on Petroleum :

Comprising its Origin, Geology, Geographical Distribution, History, Chemistry, Mining, Technology, Uses and Transportation. Together with a Description of Gas Wells, the Application of Gas as Fuel, etc. By BENJAMIN J. CREW. With an Appendix on the Product and Exhaustion of the Oil Regions, and the Geology of Natural Gas in Pennsylvania and New York. By CHARLES A. ASHBURNER, M. S., Geologist in Charge Pennsylvania Survey, Philadelphia. Illustrated by 70 engravings. 8vo. 508 pages . . . \$5.00

CROSS.—The Cotton Yarn Spinner :

Showing how the Preparation should be arranged for Different Counts of Yarns by a System more uniform than has hitherto been practiced; by having a Standard Schedule from which we make all our Changes. By RICHARD CROSS. 122 pp. 12mo. . . 75

CRISTIANI.—A Technical Treatise on Soap and Candles :

With a Glance at the Industry of Fats and Oils. By R. S. CRISTIANI, Chemist. Author of "Perfumery and Kindred Arts." Illustrated by 176 engravings. 581 pages, 8vo. . . \$15.00

CRISTIANI.—Perfumery and Kindred Arts :

A Comprehensive Treatise on Perfumery, containing a History of Perfumes from the remotest ages to the present time. A complete detailed description of the various Materials and Apparatus used in the Perfumer's Art, with thorough Practical Instruction and careful Formulæ, and advice for the fabrication of all known preparations of the day, including Essences, Tinctures, Extracts, Spirits, Waters, Vinegars, Pomades, Powders, Paints, Oils, Emulsions, Cosmetics, Infusions, Pastilles, Tooth Powders and Washes, Cachous, Hair Dyes, Sachets, Essential Oils, Flavoring Extracts, etc.; and full details for making and manipulating Fancy Toilet Soaps, Shaving Creams, etc., by new and improved methods. With an Appendix giving hints and advice for making and fermenting Domestic Wines, Cordials, Liqueurs, Candies, Jellies, Syrups, Colors, etc., and for Perfuming and Flavoring Segars, Snuff and Tobacco, and Miscellaneous Receipts for various useful Analogous Articles. By R. S. CRISTIANI, Consulting Chemist and Perfumer, Philadelphia. 8vo. . . \$10.00

DAVIDSON.—A Practical Manual of House Painting, Graining, Marbling, and Sign-Writing :

Containing full information on the processes of House Painting in Oil and Distemper, the Formation of Letters and Practice of Sign-Writing, the Principles of Decorative Art, a Course of Elementary Drawing for House Painters, Writers, etc., and a Collection of Useful Receipts. With nine colored illustrations of Woods and Marbles, and numerous wood engravings. By ELLIS A. DAVIDSON. 12mo. \$3.00

DAVIES.—A Treatise on Earthy and Other Minerals and Mining :

By D. C. DAVIES, F. G. S., Mining Engineer, etc. Illustrated by 76 Engravings. 12mo. . . \$5.00

DAVIES.—A Treatise on Metalliferous Minerals and Mining:

By D. C. DAVIES, F. G. S., Mining Engineer, Examiner of Mines, Quarries and Collieries. Illustrated by 148 engravings of Geological Formations, Mining Operations and Machinery, drawn from the practice of all parts of the world. 2d Edition, 12mo., 450 pages \$5.00

DAVIES.—A Treatise on Slate and Slate Quarrying:

Scientific, Practical and Commercial. By D. C. DAVIES, F. G. S., Mining Engineer, etc. With numerous illustrations and folding plates. 12mo. \$2.00

DAVIS.—A Treatise on Steam-Boiler Incrustation and Methods for Preventing Corrosion and the Formation of Scale:

By CHARLES T. DAVIS. Illustrated by 65 engravings. 8vo. \$1.50

DAVIS.—The Manufacture of Paper:

Being a Description of the various Processes for the Fabrication, Coloring and Finishing of every kind of Paper, Including the Different Raw Materials and the Methods for Determining their Values, the Tools, Machines and Practical Details connected with an intelligent and a profitable prosecution of the art, with special reference to the best American Practice. To which are added a History of Paper, complete Lists of Paper-Making Materials, List of American Machines, Tools and Processes used in treating the Raw Materials, and in Making, Coloring and Finishing Paper. By CHARLES T. DAVIS. Illustrated by 156 engravings. 608 pages, 8vo. \$6.00

DAVIS.—The Manufacture of Leather:

Being a description of all of the Processes for the Tanning, Tawing, Currying, Finishing and Dyeing of every kind of Leather; including the various Raw Materials and the Methods for Determining their Values; the Tools, Machines, and all Details of Importance connected with an Intelligent and Profitable Prosecution of the Art, with Special Reference to the Best American Practice. To which are added Complete Lists of all American Patents for Materials, Processes, Tools, and Machines for Tanning, Currying, etc. By CHARLES THOMAS DAVIS. Illustrated by 302 engravings and 12 Samples of Dyed Leathers. One vol., 8vo., 824 pages \$10.00

DAWIDOWSKY—BRANNT.—A Practical Treatise on the Raw Materials and Fabrication of Glue, Gelatine, Gelatine Veneers and Foils, Isinglass, Cements, Pastes, Mucilages, etc.:

Based upon Actual Experience. By F. DAWIDOWSKY, Technical Chemist. Translated from the German, with extensive additions, including a description of the most Recent American Processes, by WILLIAM T. BRANNT, Graduate of the Royal Agricultural College of Eldena, Prussia. 35 Engravings. 12mo. . . . \$2.50

DE GRAFF.—The Geometrical Stair-Builders' Guide:

Being a Plain Practical System of Hand-Railing, embracing all its necessary Details, and Geometrically Illustrated by twenty-two Steel Engravings; together with the use of the most approved principles of Practical Geometry. By SIMON DE GRAFF, Architect. 4to. \$2.50

DE KONINCK—DIETZ.—A Practical Manual of Chemical Analysis and Assaying:

As applied to the Manufacture of Iron from its Ores, and to Cast Iron, Wrought Iron, and Steel, as found in Commerce. By L. L. DE KONINCK, Dr. Sc., and E. DIETZ, Engineer. Edited with Notes, by ROBERT MALLETT, F. R. S., F. S. G., M. I. C. E., etc. American Edition, Edited with Notes and an Appendix on Iron Ores, by A. A. FESQUET, Chemist and Engineer. 12mo. . . . \$1.50

DUNCAN.—Practical Surveyor's Guide:

Containing the necessary information to make any person of common capacity, a finished land surveyor without the aid of a teacher. By ANDREW DUNCAN. Revised. 72 engravings, 214 pp. 12mo. \$1.50

DUPLAIS.—A Treatise on the Manufacture and Distillation of Alcoholic Liquors:

Comprising Accurate and Complete Details in regard to Alcohol from Wine, Molasses, Beets, Grain, Rice, Potatoes, Sorghum, Asphodel, Fruits, etc.; with the Distillation and Rectification of Brandy, Whiskey, Rum, Gin, Swiss Absinthe, etc., the Preparation of Aromatic Waters, Volatile Oils or Essences, Sugars, Syrups, Aromatic Tinctures, Liqueurs, Cordial Wines, Effervescing Wines, etc., the Ageing of Brandy and the improvement of Spirits, with Copious Directions and Tables for Testing and Reducing Spirituous Liquors, etc., etc. Translated and Edited from the French of MM. DUPLAIS, Ainé et Jeune. By M. McKENNIE, M. D. To which are added the United States Internal Revenue Regulations for the Assessment and Collection of Taxes on Distilled Spirits. Illustrated by fourteen folding plates and several wood engravings. 743 pp. 8vo. \$10 00

DUSSAUCE.—Practical Treatise on the Fabrication of Matches, Gun Cotton, and Fulminating Powder.

By Professor H. DUSSAUCE. 12mo. . . . \$3 00

DYER AND COLOR-MAKER'S COMPANION:

Containing upwards of two hundred Receipts for making Colors, on the most approved principles, for all the various styles and fabrics now in existence; with the Scouring Process, and plain Directions for Preparing, Washing-off, and Finishing the Goods. 12mo. \$1.00

EDWARDS.—A Catechism of the Marine Steam-Engine,

For the use of Engineers, Firemen, and Mechanics. A Practical Work for Practical Men. By EMORY EDWARDS, Mechanical Engineer. Illustrated by sixty-three Engravings, including examples of the most modern Engines. Third edition, thoroughly revised, with much additional matter. 12mo. 414 pages . . . \$2 00

EDWARDS.—Modern American Locomotive Engines,

Their Design, Construction and Management. By EMORY EDWARDS, Illustrated 12mo. . . . \$2.00

EDWARDS.—The American Steam Engineer:

Theoretical and Practical, with examples of the latest and most approved American practice in the design and construction of Steam Engines and Boilers. For the use of engineers, machinists, boiler-makers, and engineering students. By EMORY EDWARDS. Fully illustrated, 419 pages. 12mo. . . . \$2.50

EDWARDS.—Modern American Marine Engines, Boilers, and Screw Propellers,

Their Design and Construction. Showing the Present Practice of the most Eminent Engineers and Marine Engine Builders in the United States. Illustrated by 30 large and elaborate plates. 4to. \$5.00

EDWARDS.—The Practical Steam Engineer's Guide

In the Design, Construction, and Management of American Stationary, Portable, and Steam Fire-Engines, Steam Pumps, Boilers, Injectors, Governors, Indicators, Pistons and Rings, Safety Valves and Steam Gauges. For the use of Engineers, Firemen, and Steam Users. By EMORY EDWARDS. Illustrated by 119 engravings. 420 pages. 12mo. \$2 50

EISSLER.—The Metallurgy of Gold:

A Practical Treatise on the Metallurgical Treatment of Gold-Bearing Ores, including the Processes of Concentration and Chlorination, and the Assaying, Melting, and Refining of Gold. By M. EISSLER. With 132 Illustrations. 12mo. \$3.50

EISSLER.—The Metallurgy of Silver:

A Practical Treatise on the Amalgamation, Roasting, and Lixivation of Silver Ores, including the Assaying, Melting, and Refining of Silver Bullion. By M. EISSLER. 124 Illustrations. 336 pp. 12mo. \$4.25

ELDER.—Conversations on the Principal Subjects of Political Economy.

By DR. WILLIAM ELDER. 8vo. \$2.50

ELDER.—Questions of the Day,

Economic and Social. By DR. WILLIAM ELDER. 8vo. . . . \$3.00

ERNI.—Mineralogy Simplified.

Easy Methods of Determining and Classifying Minerals, including Ores, by means of the Blowpipe, and by Humid Chemical Analysis, based on Professor von Kobell's Tables for the Determination of Minerals, with an Introduction to Modern Chemistry. By HENRY ERNI, A.M., M.D., Professor of Chemistry. Second Edition, rewritten, enlarged and improved. 12mo. \$3.00

FAIRBAIRN.—The Principles of Mechanism and Machinery of Transmission

Comprising the Principles of Mechanism, Wheels, and Pulleys, Strength and Proportions of Shafts, Coupling of Shafts, and Engaging and Disengaging Gear. By SIR WILLIAM FAIRBAIRN, Bart. C. E. Beautifully illustrated by over 150 wood-cuts. In one volume, 12mo. \$2.50

FLEMING.—Narrow Gauge Railways in America.

A Sketch of their Rise, Progress, and Success. Valuable Statistics as to Grades, Curves, Weight of Rail, Locomotives, Cars, etc. By HOWARD FLEMING. Illustrated, 8vo. \$1.00

FORSYTH.—Book of Designs for Headstones, Mural, and other Monuments:

Containing 78 Designs. By JAMES FORSYTH. With an Introduction by CHARLES BOUTELL, M. A. 4 to., cloth \$5.00

FRANKEL—HUTTER.—A Practical Treatise on the Manufacture of Starch, Glucose, Starch-Sugar, and Dextrine:

Based on the German of LADISLAUS VON WAGNER, Professor in the Royal Technical High School, Buda-Pest, Hungary, and other authorities. By JULIUS FRANKEL, Graduate of the Polytechnic School of Hanover. Edited by ROBERT HUTTER, Chemist, Practical Manufacturer of Starch-Sugar. Illustrated by 58 engravings, covering every branch of the subject, including examples of the most Recent and Best American Machinery. 8vo., 344 pp. . \$3.50

GARDNER.—The Painter's Encyclopædia:

Containing Definitions of all Important Words in the Art of Plain and Artistic Painting, with Details of Practice in Coach, Carriage, Railway Car, House, Sign, and Ornamental Painting, including Graining, Marbling, Staining, Varnishing, Polishing, Lettering, Stenciling, Gilding, Bronzing, etc. By FRANKLIN B. GARDNER. 158 Illustrations. 12mo. 427 pp. . \$2.00

GARDNER.—Everybody's Paint Book:

A Complete Guide to the Art of Outdoor and Indoor Painting, Designed for the Special Use of those who wish to do their own work, and consisting of Practical Lessons in Plain Painting, Varnishing, Polishing, Staining, Paper Hanging, Kalsomining, etc., as well as Directions for Renovating Furniture, and Hints on Artistic Work for Home Decoration. 38 Illustrations. 12mo., 183 pp. . \$1.00

GEE.—The Goldsmith's Handbook:

Containing full instructions for the Alloying and Working of Gold, including the Art of Alloying, Melting, Reducing, Coloring, Collecting, and Refining; the Processes of Manipulation, Recovery of Waste; Chemical and Physical Properties of Gold; with a New System of Mixing its Alloys; Solders, Enamels, and other Useful Rules and Recipes. By GEORGE E. GEE. 12mo. . \$1.75

GEE.—The Silversmith's Handbook:

Containing full instructions for the Alloying and Working of Silver, including the different modes of Refining and Melting the Metal; its Solders; the Preparation of Imitation Alloys; Methods of Manipulation; Prevention of Waste; Instructions for Improving and Finishing the Surface of the Work; together with other Useful Information and Memoranda. By GEORGE E. GEE. Illustrated. 12mo. \$1.75

GOTHIC ALBUM FOR CABINET-MAKERS:

Designs for Gothic Furniture. Twenty-three plates. Oblong \$2.00

GRANT.—A Handbook on the Teeth of Gears:

Their Curves, Properties, and Practical Construction. By GEORGE B. GRANT. Illustrated. Third Edition, enlarged. 8vo. \$1.00

GREENWOOD.—Steel and Iron:

Comprising the Practice and Theory of the Several Methods Pursued in their Manufacture, and of their Treatment in the Rolling-Mills, the Forge, and the Foundry. By WILLIAM HENRY GREENWOOD, F. C. S. With 97 Diagrams, 536 pages. 12mo. \$2.00

GREGORY.—Mathematics for Practical Men:

Adapted to the Pursuits of Surveyors, Architects, Mechanics, and Civil Engineers. By OLINTHUS GREGORY. 8vo., plates \$3.00

GRISWOLD.—Railroad Engineer's Pocket Companion for the Field:

Comprising Rules for Calculating Deflection Distances and Angles, Tangential Distances and Angles, and all Necessary Tables for Engineers; also the Art of Levelling from Preliminary Survey to the Construction of Railroads, intended Expressly for the Young Engineer, together with Numerous Valuable Rules and Examples. By

W. GRISWOLD. 12mo., tucks \$1.75

GRUNER.—Studies of Blast Furnace Phenomena:

By M. L. GRUNER, President of the General Council of Mines of France, and lately Professor of Metallurgy at the Ecole des Mines. Translated, with the author's sanction, with an Appendix, by L. D. B. GORDON, F. R. S. E., F. G. S. 8vo. \$2.50

Hand-Book of Useful Tables for the Lumberman, Farmer and Mechanic:

Containing Accurate Tables of Logs Reduced to Inch Board Measure, Plank, Scantling and Timber Measure; Wages and Rent, by Week or Month; Capacity of Granaries, Bins and Cisterns; Land Measure, Interest Tables, with Directions for Finding the Interest on any sum at 4, 5, 6, 7 and 8 per cent., and many other Useful Tables. 32 mo., boards. 186 pages25

HASERICK.—The Secrets of the Art of Dyeing Wool, Cotton, and Linen,

Including Bleaching and Coloring Wool and Cotton Hosiery and Random Yarns. A Treatise based on Economy and Practice. By E. C. HASERICK. *Illustrated by 323 Dyed Patterns of the Yarns or Fabrics.* 8vo. \$7.50

HATS AND FELTING:

A Practical Treatise on their Manufacture. By a Practical Hatter. Illustrated by Drawings of Machinery, etc. 8vo. . . . \$1.25

HOFFER.—A Practical Treatise on Caoutchouc and Gutta Percha,

Comprising the Properties of the Raw Materials, and the manner of Mixing and Working them; with the Fabrication of Vulcanized and Hard Rubbers, Caoutchouc and Gutta Percha Compositions, Waterproof Substances, Elastic Tissues, the Utilization of Waste, etc., etc. From the German of RAIMUND HOFFER. By W. T. BRANNT. Illustrated 12mo. \$2.50

HAUPT.—Street Railway Motors:

With Descriptions and Cost of Plants and Operation of the Various Systems now in Use. 12mo. \$1.75

HAUPT—RHAWN.—A Move for Better Roads :

Essays on Road-making and Maintenance and Road Laws, for which Prizes or Honorable Mention were Awarded through the University of Pennsylvania by a Committee of Citizens of Philadelphia, with a Synopsis of other Contributions and a Review by the Secretary, LEWIS M. HAUPT, A. M., C. E.; also an Introduction by WILLIAM H. RHAWN, Chairman of the Committee. 319 pages. 8vo. \$2.00

HUGHES.—American Miller and Millwright's Assistant :

By WILLIAM CARTER HUGHES. 12mo. \$1.50

HULME.—Worked Examination Questions in Plane Geometrical Drawing :

For the Use of Candidates for the Royal Military Academy, Woolwich; the Royal Military College, Sandhurst; the Indian Civil Engineering College, Cooper's Hill; Indian Public Works and Telegraph Departments; Royal Marine Light Infantry; the Oxford and Cambridge Local Examinations, etc. By F. EDWARD HULME, F. L. S., F. S. A., Art-Master Marlborough College. Illustrated by 300 examples. Small quarto \$2.50

JERVIS.—Railroad Property :

A Treatise on the Construction and Management of Railways; designed to afford useful knowledge, in the popular style, to the holders of this class of property; as well as Railway Managers, Officers, and Agents. By JOHN B. JERVIS, late Civil Engineer of the Hudson River Railroad, Croton Aqueduct, etc. 12mo., cloth \$2.00

KEENE.—A Hand-Book of Practical Gauging :

For the Use of Beginners, to which is added a Chapter on Distillation, describing the process in operation at the Custom-House for ascertaining the Strength of Wines. By JAMES B. KEENE, of H. M. Customs. 8vo. \$1.25

KELLEY.—Speeches, Addresses, and Letters on Industrial and Financial Questions :

By HON. WILLIAM D. KELLEY, M. C. 544 pages, 8vo. \$2.50

KELLOGG.—A New Monetary System :

The only means of Securing the respective Rights of Labor and Property, and of Protecting the Public from Financial Revulsions. By EDWARD KELLOGG. Revised from his work on "Labor and other Capital." With numerous additions from his manuscript. Edited by MARY KELLOGG PUTNAM. Fifth edition. To which is added a Biographical Sketch of the Author. One volume, 12mo. Paper cover \$1.00
Bound in cloth 1.50

KEMLO.—Watch-Repairer's Hand-Book :

Being a Complete Guide to the Young Beginner, in Taking Apart, Putting Together, and Thoroughly Cleaning the English Lever and other Foreign Watches, and all American Watches. By F. KEMLO, Practical Watchmaker. With Illustrations. 12mo. \$1.25

- KENTISH.**—A Treatise on a Box of Instruments,
And the Slide Rule; with the Theory of Trigonometry and Logarithms, including Practical Geometry, Surveying, Measuring of Timber, Cask and Malt Gauging, Heights, and Distances. By THOMAS KENTISH. In one volume. 12mo. . . . \$1.2
- KERL.**—The Assayer's Manual:
An Abridged Treatise on the Docimastic Examination of Ores, and Furnace and other Artificial Products. By BRUNO KERL, Professor in the Royal School of Mines. Translated from the German by WILLIAM T. BRANNT. Second American edition, edited with Extensive Additions by F. LYNWOOD GARRISON, Member of the American Institute of Mining Engineers, etc. Illustrated by 87 engravings. 8vo. . . . \$3.00
- KICK.**—Flour Manufacture.
A Treatise on Milling Science and Practice. By FREDERICK KICK, Imperial Regierungsrath, Professor of Mechanical Technology in the Imperial German Polytechnic Institute, Prague. Translated from the second enlarged and revised edition with supplement by H. H. P. POWLES, Assoc. Memb. Institution of Civil Engineers. Illustrated with 28 Plates, and 167 Wood-cuts. 367 pages. 8vo. . . \$10.00
- KINGZETT.**—The History, Products, and Processes of the Alkali Trade:
Including the most Recent Improvements. By CHARLES THOMAS KINGZETT, Consulting Chemist. With 23 illustrations. 8vo. . \$2.50
- KIRK.**—The Founding of Metals:
A Practical Treatise on the Melting of Iron, with a Description of the Founding of Alloys; also, of all the Metals and Mineral Substances used in the Art of Founding. Collected from original sources. By EDWARD KIRK, Practical Foundryman and Chemist. Illustrated. Third edition. 8vo. . . . \$2.50
- LANDRIN.**—A Treatise on Steel:
Comprising its Theory, Metallurgy, Properties, Practical Working, and Use. By M. H. C. LANDRIN, JR., Civil Engineer. Translated from the French, with Notes, by A. A. FESQUET, Chemist and Engineer. With an Appendix on the Bessemer and the Martin Processes for Manufacturing Steel, from the Report of Abram S. Hewitt, United States Commissioner to the Universal Exposition, Paris, 1867. 12mo. . . . \$3.00
- LANGBEIN.**—A Complete Treatise on the Electro-Deposition of Metals:
Translated from the German, with Additions, by WM. T. BRANNT. 125 illustrations. 8vo. . . . \$4.00
- LARDNER.**—The Steam-Engine:
For the Use of Beginners. Illustrated. 12mo. . . . 75
- LEHNER.**—The Manufacture of Ink:
Comprising the Raw Materials, and the Preparation of Writing, Copying and Hektograph Inks, Safety Inks, Ink Extracts and Powders, etc. Translated from the German of SIGMUND LEHNER, with additions by WILLIAM T. BRANNT. Illustrated. 12mo. . \$2.00

LARKIN.—The Practical Brass and Iron Founder's Guide:

A Concise Treatise on Brass Founding, Moulding, the Metals and their Alloys, etc.; to which are added Recent Improvements in the Manufacture of Iron, Steel by the Bessemer Process, etc., etc. By JAMES LARKIN, late Conductor of the Brass Foundry Department in Reany, Neafe & Co.'s Penn Works, Philadelphia. New edition, revised, with extensive additions. 12mo. . . . \$2.50

LEROUX.—A Practical Treatise on the Manufacture of Worsteds and Carded Yarns:

Comprising Practical Mechanics, with Rules and Calculations applied to Spinning; Sorting, Cleaning, and Scouring Wools; the English and French Methods of Combing, Drawing, and Spinning Worsteds, and Manufacturing Carded Yarns. Translated from the French of CHARLES LEROUX, Mechanical Engineer and Superintendent of a Spinning-Mill, by HORATIO PAINE, M. D., and A. A. FESQUET, Chemist and Engineer. Illustrated by twelve large Plates. To which is added an Appendix, containing Extracts from the Reports of the International Jury, and of the Artisans selected by the Committee appointed by the Council of the Society of Arts, London, on Woolen and Worsted Machinery and Fabrics, as exhibited in the Paris Universal Exposition, 1867. 8vo. . . . \$5.00

LEFFEL.—The Construction of Mill-Dams:

Comprising also the Building of Race and Reservoir Embankments and Head-Gates, the Measurement of Streams, Gauging of Water Supply, etc. By JAMES LEFFEL & Co. Illustrated by 58 engravings. 8vo. . . . \$2.50

LESLIE.—Complete Cookery:

Directions for Cookery in its Various Branches. By MISS LESLIE. Sixtieth thousand. Thoroughly revised, with the addition of New Receipts. 12mo. . . . \$1.50

LE VAN.—The Steam Engine and the Indicator:

Their Origin and Progressive Development; including the Most Recent Examples of Steam and Gas Motors, together with the Indicator, its Principles, its Utility, and its Application. By WILLIAM BARNET LE VAN. Illustrated by 205 Engravings, chiefly of Indicator-Cards. 469 pp. 8vo. . . . \$4.00

LIEBER.—Assayer's Guide:

Or, Practical Directions to Assayers, Miners, and Smelters, for the Tests and Assays, by Heat and by Wet Processes, for the Ores of all the principal Metals, of Gold and Silver Coins and Alloys, and of Coal, etc. By OSCAR M. LIEBER. Revised. 283 pp. 12mo. \$1.50

Lockwood's Dictionary of Terms:

Used in the Practice of Mechanical Engineering, embracing those Current in the Drawing Office, Pattern Shop, Foundry, Fitting, Turning, Smith's and Boiler Shops, etc., etc., comprising upwards of Six Thousand Definitions. Edited by a Foreman Pattern Maker, author of "Pattern Making." 417 pp. 12mo. . . . \$3.00

LUKIN.—Amongst Machines:

Embracing Descriptions of the various Mechanical Appliances used in the Manufacture of Wood, Metal, and other Substances. 12mo. \$1.75

LUKIN.—The Boy Engineers:

What They Did, and How They Did It. With 30 plates. 18mo. \$1.75

LUKIN.—The Young Mechanic:

Practical Carpentry. Containing Directions for the Use of all kinds of Tools, and for Construction of Steam-Engines and Mechanical Models, including the Art of Turning in Wood and Metal. By JOHN LUKIN, Author of "The Lathe and Its Uses," etc. Illustrated. 12mo. \$1.75

MAIN and BROWN.—Questions on Subjects Connected with the Marine Steam-Engine:

And Examination Papers; with Hints for their Solution. By THOMAS J. MAIN, Professor of Mathematics, Royal Naval College, and THOMAS BROWN, Chief Engineer, R. N. 12mo., cloth. \$1.00

MAIN and BROWN.—The Indicator and Dynamometer:

With their Practical Applications to the Steam-Engine. By THOMAS J. MAIN, M. A. F. R., Ass't S. Professor Royal Naval College, Portsmouth, and THOMAS BROWN, Assoc. Inst. C. E., Chief Engineer R. N., attached to the R. N. College. Illustrated. 8vo. \$1.00

MAIN and BROWN.—The Marine Steam-Engine.

By THOMAS J. MAIN, F. R. Ass't S. Mathematical Professor at the Royal Naval College, Portsmouth, and THOMAS BROWN, Assoc. Inst. C. E., Chief Engineer R. N. Attached to the Royal Naval College. With numerous illustrations. 8vo. 50

MAKINS.—A Manual of Metallurgy:

By GEORGE HOGARTH MAKINS. 100 engravings. Second edition rewritten and much enlarged. 12mo., 592 pages. \$3.00

MARTIN.—Screw-Cutting Tables, for the Use of Mechanical Engineers:

Showing the Proper Arrangement of Wheels for Cutting the Threads of Screws of any Required Pitch; with a Table for Making the Universal Gas-Pipe Thread and Taps. By W. A. MARTIN, Engineer. 8vo. 50

MICHELL.—Mine Drainage:

Being a Complete and Practical Treatise on Direct-Acting Underground Steam Pumping Machinery. With a Description of a large number of the best known Engines, their General Utility and the Special Sphere of their Action, the Mode of their Application, and their Merits compared with other Pumping Machinery. By STEPHEN MICHELL. Illustrated by 137 engravings. 8vo., 277 pages. \$6.00

MOLESWORTH.—Pocket-Book of Useful Formulæ and Memoranda for Civil and Mechanical Engineers.

By GUILFORD L. MOLESWORTH, Member of the Institution of Civil Engineers, Chief Resident Engineer of the Ceylon Railway. Full-bound in Pocket-book form. \$1.00

MOORE.—The Universal Assistant and the Complete Mechanic:

Containing over one million Industrial Facts, Calculations, Receipts, Processes, Trades Secrets, Rules, Business Forms, Legal Items, Etc., in every occupation, from the Household to the Manufactory. By R. MOORE. Illustrated by 500 Engravings. 12mo. \$2.50

MORRIS.—Easy Rules for the Measurement of Earthworks:

By means of the Prismoidal Formula. Illustrated with Numerous Wood-Cuts, Problems, and Examples, and concluded by an Extensive Table for finding the Solidity in cubic yards from Mean Areas. The whole being adapted for convenient use by Engineers, Surveyors, Contractors, and others needing Correct Measurements of Earthwork. By ELWOOD MORRIS, C. E. 8vo. \$1.50

MAUCHLINE.—The Mine Foreman's Hand-Book:

Of Practical and Theoretical Information on the Opening, Ventilating, and Working of Collieries. Questions and Answers on Practical and Theoretical Coal Mining. Designed to Assist Students and others in Passing Examinations for Mine Foremanships. A New, Revised and Enlarged Edition. 114 illustrations. 8vo. \$3.75

NAPIER.—A System of Chemistry Applied to Dyeing.

By JAMES NAPIER, F. C. S. A New and Thoroughly Revised Edition. Completely brought up to the present state of the Science, including the Chemistry of Coal Tar Colors, by A. A. FESQUET, Chemist and Engineer. With an Appendix on Dyeing and Calico Printing, as shown at the Universal Exposition, Paris, 1867. Illustrated. 8vo. 422 pages \$3.50

NEVILLE.—Hydraulic Tables, Coefficients, and Formulæ, for finding the Discharge of Water from Orifices, Notches, Weirs, Pipes, and Rivers:

Third Edition, with Additions, consisting of New Formulæ for the Discharge from Tidal and Flood Sluices and Siphons; general information on Rainfall, Catchment-Basins, Drainage, Sewerage, Water Supply for Towns and Mill Power. By JOHN NEVILLE, C. E. M. R. I. A.; Fellow of the Royal Geological Society of Ireland. Thick 12mo. \$5.50

NEWBERY.—Gleanings from Ornamental Art of every style:

Drawn from Examples in the British, South Kensington, Indian, Crystal Palace, and other Museums, the Exhibitions of 1851 and 1862, and the best English and Foreign works. In a series of 100 exquisitely drawn Plates, containing many hundred examples. By ROBERT NEWBERY. 4to. \$12.50

NICHOLLS.—The Theoretical and Practical Boiler-Maker and Engineer's Reference Book:

Containing a variety of Useful Information for Employers of Labor. Foremen and Working Boiler-Makers, Iron, Copper, and Tinsmiths

- Draftsmen, Engineers, the General Steam-using Public, and for the Use of Science Schools and Classes.** By SAMUEL NICHOLLS. Illustrated by sixteen plates, 12mo. \$2.50
- NICHOLSON.—A Manual of the Art of Bookbinding:**
Containing full instructions in the different Branches of Forwarding, Gilding, and Finishing. Also, the Art of Marbling Book-edges and Paper. By JAMES B. NICHOLSON. Illustrated. 12mo., cloth \$2.25
- NICOLLS.—The Railway Builder:**
A Hand-Book for Estimating the Probable Cost of American Railway Construction and Equipment. By WILLIAM J. NICOLLS, Civil Engineer. Illustrated, full bound, pocket-book form \$2.00
- NORMANDY.—The Commercial Handbook of Chemical Analysis:**
Or Practical Instructions for the Determination of the Intrinsic or Commercial Value of Substances used in Manufactures, in Trades, and in the Arts. By A. NORMANDY. New Edition, Enlarged, and to a great extent rewritten. By HENRY M. NOAD, Ph.D., F.R.S., thick 12mo. \$5.00
- NORRIS.—A Handbook for Locomotive Engineers and Machinists:**
Comprising the Proportions and Calculations for Constructing Locomotives; Manner of Setting Valves; Tables of Squares, Cubes, Areas, etc., etc. By SEPTIMUS NORRIS, M. E. New edition. Illustrated, 12mo. \$1.50
- NYSTROM.—A New Treatise on Elements of Mechanics:**
Establishing Strict Precision in the Meaning of Dynamical Terms; accompanied with an Appendix on Duodenal Arithmetic and Metrology. By JOHN W. NYSTROM, C. E. Illustrated. 8vo. \$2.00
- NYSTROM.—On Technological Education and the Construction of Ships and Screw Propellers:**
For Naval and Marine Engineers. By JOHN W. NYSTROM, late Acting Chief Engineer, U. S. N. Second edition, revised, with additional matter. Illustrated by seven engravings. 12mo. \$1.50
- O'NEILL.—A Dictionary of Dyeing and Calico Printing:**
Containing a brief account of all the Substances and Processes in use in the Art of Dyeing and Printing Textile Fabrics; with Practical Receipts and Scientific Information. By CHARLES O'NEILL, Analytical Chemist. To which is added an Essay on Coal Tar Colors and their application to Dyeing and Calico Printing. By A. A. FESQUET, Chemist and Engineer. With an appendix on Dyeing and Calico Printing, as shown at the Universal Exposition, Paris, 1867. 8vo. 491 pages \$3.50
- ORTON.—Underground Treasures:**
How and Where to Find Them. A Key for the Ready Determination of all the Useful Minerals within the United States. By JAMES ORTON, A.M., Late Professor of Natural History in Vassar College, N. Y.; Cor. Mem. of the Academy of Natural Sciences, Philadelphia, and of the Lyceum of Natural History, New York; author of the "Andes and the Amazon," etc. A New Edition, with Additions. Illustrated \$1.50

OSBORN.—The Prospector's Field Book and Guide:

In the Search for and the Easy Determination of Ores and Other Useful Minerals. By Prof. H. S. OSBORN, LL. D., Author of "The Metallurgy of Iron and Steel;" "A Practical Manual of Minerals, Mines, and Mining." Illustrated by 44 Engravings. 12mo. \$1.50

OSBORN.—A Practical Manual of Minerals, Mines and Mining:

Comprising the Physical Properties, Geologic Positions, Local Occurrence and Associations of the Useful Minerals; their Methods of Chemical Analysis and Assay: together with Various Systems of Excavating and Timbering, Brick and Masonry Work, during Drilling, Lining, Bracing and other Operations, etc. By Prof. H. S. OSBORN, LL. D., Author of the "Metallurgy of Iron and Steel." Illustrated by 171 engravings from original drawings. 8vo. \$4.50

OVERMAN.—The Manufacture of Steel:

Containing the Practice and Principles of Working and Making Steel. A Handbook for Blacksmiths and Workers in Steel and Iron, Wagon Makers, Die Sinkers, Cutlers, and Manufacturers of Files and Hardware, of Steel and Iron, and for Men of Science and Art. By FREDERICK OVERMAN, Mining Engineer, Author of the "Manufacture of Iron," etc. A new, enlarged, and revised Edition. By A. A. FESQUET, Chemist and Engineer. 12mo. \$1.50

OVERMAN.—The Moulder's and Founder's Pocket Guide:

A Treatise on Moulding and Founding in Green-sand, Dry-sand, Loam, and Cement; the Moulding of Machine Frames, Mill-gear, Hollow-ware, Ornaments, Trinkets, Bells, and Statues; Description of Moulds for Iron, Bronze, Brass, and other Metals; Plaster of Paris, Sulphur, Wax, etc.; the Construction of Melting Furnaces, the Melting and Founding of Metals; the Composition of Alloys and their Nature, etc., etc. By FREDERICK OVERMAN, M. E. A new Edition, to which is added a Supplement on Statuary and Ornamental Moulding, Ordnance, Malleable Iron Castings, etc. By A. A. FESQUET, Chemist and Engineer. Illustrated by 44 engravings. 12mo. \$2.00

PAINTER, GILDER, AND VARNISHER'S COMPANION:

Containing Rules and Regulations in everything relating to the Arts of Painting, Gilding, Varnishing, Glass-Staining, Graining, Marbling, Sign-Writing, Gilding on Glass, and Coach Painting and Varnishing; Tests for the Detection of Adulterations in Oils, Colors, etc.; and a Statement of the Diseases to which Painters are peculiarly liable, with the Simplest and Best Remedies. Sixteenth Edition. Revised, with an Appendix. Containing Colors and Coloring—Theoretical and Practical. Comprising descriptions of a great variety of Additional Pigments, their Qualities and Uses, to which are added, Dryers, and Modes and Operations of Painting, etc. Together with Chevreul's Principles of Harmony and Contrast of Colors. 12mo. Cloth \$1.50

PALLET.—The Miller's, Millwright's, and Engineer's Guide.

By HENRY PALLET. Illustrated. 12mo. \$2.00

PERCY.—The Manufacture of Russian Sheet-Iron.

By JOHN PERCY, M. D., F. R. S., Lecturer on Metallurgy at the Royal School of Mines, and to The Advance Class of Artillery Officers at the Royal Artillery Institution, Woolwich; Author of "Metallurgy." With Illustrations. 8vo., paper . . . 50 cts.

PERKINS.—Gas and Ventilation :

Practical Treatise on Gas and Ventilation. With Special Relation to Illuminating, Heating, and Cooking by Gas. Including Scientific Helps to Engineer-students and others. With Illustrated Diagrams. By E. E. PERKINS. 12mo., cloth . . . \$1.25

PERKINS AND STOWE.—A New Guide to the Sheet-iron and Boiler Plate Roller :

Containing a Series of Tables showing the Weight of Slabs and Piles to Produce Boiler Plates, and of the Weight of Piles and the Sizes of Bars to produce Sheet-iron; the Thickness of the Bar Gauge in decimals; the Weight per foot, and the Thickness on the Bar or Wire Gauge of the fractional parts of an inch; the Weight per sheet, and the Thickness on the Wire Gauge of Sheet-iron of various dimensions to weigh 112 lbs. per bundle; and the conversion of Short Weight into Long Weight, and Long Weight into Short. Estimated and collected by G. H. PERKINS and J. G. STOWE. \$2.50

POWELL—CHANCE—HARRIS.—The Principles of Glass Making.

By HARRY J. POWELL, B. A. Together with Treatises on Crown and Sheet Glass; by HENRY CHANCE, M. A. And Plate Glass, by H. G. HARRIS, Asso. M. Inst. C. E. Illustrated 18mo. . . \$1.50

PROCTOR.—A Pocket-Book of Useful Tables and Formulæ for Marine Engineers :

By FRANK PROCTOR. Second Edition, Revised and Enlarged. Full-bound pocket-book form . . . \$1.50

REGNAULT.—Elements of Chemistry :

By M. V. REGNAULT. Translated from the French by T. FORREST BETTON, M. D., and edited, with Notes, by JAMES C. BOOTH, Melter and Refiner U. S. Mint, and WILLIAM L. FABER, Metallurgist and Mining Engineer. Illustrated by nearly 700 wood-engravings. Comprising nearly 1,500 pages. In two volumes, 8vo., cloth . . . \$7.50

RICHARDS.—Aluminium :

Its History, Occurrence, Properties, Metallurgy and Applications, including its Alloys. By JOSEPH W. RICHARDS, A. C., Chemist and Practical Metallurgist, Member of the Deutsche Chemische Gesellschaft. Illustrated . . . \$5.00

RIFFAULT, VERGNAUD, and TOUSSAINT.—A Practical Treatise on the Manufacture of Colors for Painting :

Comprising the Origin, Definition, and Classification of Colors; the Treatment of the Raw Materials; the best Formulæ and the Newest Processes for the Preparation of every description of Pigment, and the Necessary Apparatus and Directions for its Use; Dryers; the Testing, Application, and Qualities of Paints, etc., etc. By MM. RIFFAULT, VERGNAUD, and TOUSSAINT. Revised and Edited by M.

- F. MALEPEYRE. Translated from the French, by A. A. FESQUET, Chemist and Engineer. Illustrated by Eighty engravings. In one vol., 8vo., 659 pages \$7.50
- ROPER.—A Catechism of High-Pressure, or Non-Condensing Steam-Engines:**
Including the Modelling, Constructing, and Management of Steam-Engines and Steam Boilers. With valuable illustrations. By STEPHEN ROPER, Engineer. Sixteenth edition, revised and enlarged. 18mo., tucks, gilt edge \$2.00
- ROPER.—Engineer's Handy-Book:**
Containing a full Explanation of the Steam-Engine Indicator, and its Use and Advantages to Engineers and Steam Users. With Formulæ for Estimating the Power of all Classes of Steam-Engines; also, Facts, Figures, Questions, and Tables for Engineers who wish to qualify themselves for the United States Navy, the Revenue Service, the Mercantile Marine, or to take charge of the Better Class of Stationary Steam-Engines. Sixth edition. 16mo., 690 pages, tucks, gilt edge \$3.50
- ROPER.—Hand-Book of Land and Marine Engines:**
Including the Modelling, Construction, Running, and Management of Land and Marine Engines and Boilers. With illustrations. By STEPHEN ROPER, Engineer. Sixth edition. 12mo., tucks, gilt edge. \$3.50
- ROPER.—Hand-Book of the Locomotive:**
Including the Construction of Engines and Boilers, and the Construction, Management, and Running of Locomotives. By STEPHEN ROPER. Eleventh edition. 18mo., tucks, gilt edge \$2.50
- ROPER.—Hand-Book of Modern Steam Fire-Engines.**
With illustrations. By STEPHEN ROPER, Engineer. Fourth edition, 12mo., tucks, gilt edge \$3.50
- ROPER.—Questions and Answers for Engineers.**
This little book contains all the Questions that Engineers will be asked when undergoing an Examination for the purpose of procuring Licenses, and they are so plain that any Engineer or Fireman of ordinary intelligence may commit them to memory in a short time. By STEPHEN ROPER, Engineer. Third edition \$3.00
- ROPER.—Use and Abuse of the Steam Boiler.**
By STEPHEN ROPER, Engineer. Eighth edition, with illustrations. 18mo., tucks, gilt edge \$2.00
- ROSE.—The Complete Practical Machinist:**
Embracing Lathe Work, Vise Work, Drills and Drilling, Taps and Dies, Hardening and Tempering, the Making and Use of Tools, Tool Grinding, Marking out Work, etc. By JOSHUA ROSE. Illustrated by 356 engravings. Thirteenth edition, thoroughly revised and in great part rewritten. In one vol., 12mo., 439 pages \$2.50
- ROSE.—Mechanical Drawing Self-Taught:**
Comprising Instructions in the Selection and Preparation of Drawing Instruments, Elementary Instruction in Practical Mechanical Draw-

- ing, together with Examples in Simple Geometry and Elementary Mechanism, including Screw Threads, Gear Wheels, Mechanical Motions, Engines and Boilers. By JOSHUA ROSE, M. E. Illustrated by 330 engravings. 8vo., 313 pages . . . \$4.00
- ROSE.—The Slide-Valve Practically Explained:**
Embracing simple and complete Practical Demonstrations of the operation of each element in a Slide-valve Movement, and illustrating the effects of Variations in their Proportions by examples carefully selected from the most recent and successful practice. By JOSHUA ROSE, M. E. Illustrated by 35 engravings . . . \$1.00
- ROSS.—The Blowpipe in Chemistry, Mineralogy and Geology:**
Containing all Known Methods of Anhydrous Analysis, many Working Examples, and Instructions for Making Apparatus. By LIEUT.-COLONEL W. A. ROSS, R. A., F. G. S. With 120 Illustrations. 12mo. \$2.00
- SHAW.—Civil Architecture:**
Being a Complete Theoretical and Practical System of Building, containing the Fundamental Principles of the Art. By EDWARD SHAW, Architect. To which is added a Treatise on Gothic Architecture, etc. By THOMAS W. SILLOWAY and GEORGE M. HARDING, Architects. The whole illustrated by 102 quarto plates finely engraved on copper. Eleventh edition. 4to. \$10.00
- SHUNK.—A Practical Treatise on Railway Curves and Location, for Young Engineers.**
By W. F. SHUNK, C. E. 12mo. Full bound pocket-book form \$2.00
- SLATER.—The Manual of Colors and Dye Wares.**
By J. W. SLATER. 12mo. \$3.00
- SLOAN.—American Houses:**
A variety of Original Designs for Rural Buildings. Illustrated by 26 colored engravings, with descriptive references. By SAMUEL SLOAN, Architect. 8vo. \$1.50
- SLOAN.—Homestead Architecture:**
Containing Forty Designs for Villas, Cottages, and Farm-houses, with Essays on Stylic, Construction, Landscape Gardening, Furniture, etc., etc. Illustrated by upwards of 200 engravings. By SAMUEL SLOAN, Architect. 8vo. \$3.50
- SLOANE.—Home Experiments in Science.**
By T. O'CONOR SLOANE, E. M., A. M., F. R. S. Illustrated by 91 engravings. 12mo. \$1.50
- SMEATON.—Builder's Pocket-Companion:**
Containing the Elements of Building, Surveying, and Architecture; with Practical Rules and Instructions connected with the subject. By A. C. SMEATON, Civil Engineer, etc. 12mo. . . . \$1.50
- SMITH.—A Manual of Political Economy.**
By E. PESHINE SMITH. A New Edition, to which is added a full Index. 12mo. \$1 25

SMITH.—Parks and Pleasure-Grounds:

Or Practical Notes on Country Residences, Villas, Public Parks, and Gardens. By CHARLES H. J. SMITH, Landscape Gardener and Garden Architect, etc., etc. 12mo. \$2.00

SMITH.—The Dyer's Instructor:

Comprising Practical Instructions in the Art of Dyeing Silk, Cotton, Wool, and Worsted, and Woolen Goods; containing nearly 800 Receipts. To which is added a Treatise on the Art of Padding; and the Printing of Silk Warps, Skeins, and Handkerchiefs, and the various Mordants and Colors for the different styles of such work. By DAVID SMITH, Pattern Dyer. 12mo. \$2.00

SMYTH.—A Rudimentary Treatise on Coal and Coal-Mining.

By WARRINGTON W. SMYTH, M. A., F. R. G., President R. G. S. of Cornwall. Fifth edition, revised and corrected. With numerous illustrations. 12mo. \$1.75

SNIVELY.—Tables for Systematic Qualitative Chemical Analysis.

By JOHN H. SNIVELY, Phr. D. 8vo. \$1.00

SNIVELY.—The Elements of Systematic Qualitative Chemical Analysis:

A Hand-book for Beginners. By JOHN H. SNIVELY, Phr. D. 16mo. \$2.00

STOKES.—The Cabinet-Maker and Upholsterer's Companion:

Comprising the Art of Drawing, as applicable to Cabinet Work; Veneering, Inlaying, and Buhl-Work; the Art of Dyeing and Staining Wood, Ivory, Bone, Tortoise-Shell, etc. Directions for Lacking, Japanning, and Varnishing; to make French Polish, Glues, Cements, and Compositions; with numerous Receipts, useful to workmen generally. By STOKES. Illustrated. A New Edition, with an Appendix upon French Polishing, Staining, Imitating, Varnishing, etc., etc. 12mo. \$1.25

STRENGTH AND OTHER PROPERTIES OF METALS:

Reports of Experiments on the Strength and other Properties of Metals for Cannon. With a Description of the Machines for Testing Metals, and of the Classification of Cannon in service. By Officers of the Ordnance Department, U. S. Army. By authority of the Secretary of War. Illustrated by 25 large steel plates. Quarto. \$10.00

SULLIVAN.—Protection to Native Industry.

By Sir EDWARD SULLIVAN, Baronet, author of "Ten Chapters on Social Reforms." 8vo. \$1.00

SULZ.—A Treatise on Beverages:

Or the Complete Practical Bottler. Full instructions for Laboratory Work, with Original Practical Recipes for all kinds of Carbonated Drinks, Mineral Waters, Flavorings, Extracts, Syrups, etc. By CHAS. HERMAN SULZ, Technical Chemist and Practical Bottler. Illustrated by 428 Engravings. 818 pp. 8vo. \$10.00

SYME.—Outlines of an Industrial Science.

By DAVID SYME. 12mo.

\$2.00

TABLES SHOWING THE WEIGHT OF ROUND, SQUARE, AND FLAT BAR IRON, STEEL, ETC.,

By Measurement. Cloth

63

TAYLOR.—Statistics of Coal:

Including Mineral Bituminous Substances employed in Arts and Manufactures; with their Geographical, Geological, and Commercial Distribution and Amount of Production and Consumption on the American Continent. With Incidental Statistics of the Iron Manufacture. By R. C. TAYLOR. Second edition, revised by S. S. HALDEMAN. Illustrated by five Maps and many wood engravings. 8vo., cloth

\$10.00

TEMPLETON.—The Practical Examiner on Steam and the Steam-Engine:

With Instructive References relative thereto, arranged for the Use of Engineers, Students, and others. By WILLIAM TEMPLETON, Engineer. 12mo.

\$1.00

THAUSING.—The Theory and Practice of the Preparation of Malt and the Fabrication of Beer:

With especial reference to the Vienna Process of Brewing. Elaborated from personal experience by JULIUS E. THAUSING, Professor at the School for Brewers, and at the Agricultural Institute, Mödling, near Vienna. Translated from the German by WILLIAM T. BRANNT, Thoroughly and elaborately edited, with much American matter, and according to the latest and most Scientific Practice, by A. SCHWARZ and DR. A. H. BAUER. Illustrated by 140 Engravings. 8vo., 815 pages

\$10.00

THOMAS.—The Modern Practice of Photography:

By R. W. THOMAS, F. C. S. 8vo.

25

THOMPSON.—Political Economy. With Especial Reference to the Industrial History of Nations:

By ROBERT E. THOMPSON, M. A., Professor of Social Science in the University of Pennsylvania. 12mo.

\$1.50

THOMSON.—Freight Charges Calculator:

By ANDREW THOMSON, Freight Agent. 24mo.

\$1.25

TURNER'S (THE) COMPANION:

Containing Instructions in Concentric, Elliptic, and Eccentric Turning; also various Plates of Chucks, Tools, and Instruments; and Directions for using the Eccentric Cutter, Drill, Vertical Cutter, and Circular Rest; with Patterns and Instructions for working them

12mo.

\$1.25

TURNING: Specimens of Fancy Turning Executed on the Hand or Foot-Lathe:

With Geometric, Oval, and Eccentric Chucks, and Elliptical Cutting Frame. By an Amateur. Illustrated by 30 exquisite Photographs.

4to.

\$3.00

VAILE.—Galvanized-Iron Cornice-Worker's Manual:

Containing Instructions in Laying out the Different Mitres, and Making Patterns for all kinds of Plain and Circular Work. Also, Tables of Weights, Areas and Circumferences of Circles, and other Matter calculated to Benefit the Trade. By CHARLES A. VAILE. Illustrated by twenty-one plates. 4to. . . . \$5.00

VILLE.—On Artificial Manures:

Their Chemical Selection and Scientific Application to Agriculture. A series of Lectures given at the Experimental Farm at Vincennes, during 1867 and 1874-75. By M. GEORGES VILLE. Translated and Edited by WILLIAM CROOKS, F. R. S. Illustrated by thirty-one engravings. 8vo., 450 pages \$6.00

VILLE.—The School of Chemical Manures:

Or, Elementary Principles in the Use of Fertilizing Agents. From the French of M. GEO. VILLE, by A. A. FESQUET, Chemist and Engineer. With Illustrations. 12mo. . . . \$1.25

VOGDES.—The Architect's and Builder's Pocket-Companion and Price-Book:

Consisting of a Short but Comprehensive Epitome of Decimals, Duodecimals, Geometry and Mensuration; with Tables of United States Measures, Sizes, Weights, Strengths, etc., of Iron, Wood, Stone, Brick, Cement and Concretes, Quantities of Materials in given Sizes and Dimensions of Wood, Brick and Stone; and full and complete Bills of Prices for Carpenter's Work and Painting; also, Rules for Computing and Valuing Brick and Brick Work, Stone Work, Painting, Plastering, with a Vocabulary of Technical Terms, etc. By FRANK W. VOGDES, Architect, Indianapolis, Ind. Enlarged, revised, and corrected. In one volume, 368 pages, full-bound, pocket-book form, gilt edges \$2.00
Cloth 1.50

VAN CLEVE.—The English and American Mechanic:

Comprising a Collection of Over Three Thousand Receipts, Rules, and Tables, designed for the Use of every Mechanic and Manufacturer. By B. FRANK VAN CLEVE. Illustrated. 500 pp. 12mo. \$2.00

WAHNSCHAFPE.—A Guide to the Scientific Examination of Soils:

Comprising Select Methods of Mechanical and Chemical Analysis and Physical Investigation. Translated from the German of Dr. F. WAHNSCHAFPE. With additions by WILLIAM T. BRANNT. Illustrated by 25 engravings. 12mo. 177 pages . . . \$1.50

WALL.—Practical Graining:

With Descriptions of Colors Employed and Tools Used. Illustrated by 47 Colored Plates, Representing the Various Woods Used in Interior Finishing. By WILLIAM E. WALL. 8vo. . . \$2.50

WALTON.—Coal-Mining Described and Illustrated:

By THOMAS H. WALTON, Mining Engineer. Illustrated by 24 large and elaborate Plates, after Actual Workings and Apparatus. \$5.00

WARE.—The Sugar Beet.

Including a History of the Beet Sugar Industry in Europe, Varieties of the Sugar Beet, Examination, Soils, Tillage, Seeds and Sowing, Yield and Cost of Cultivation, Harvesting, Transportation, Conservation, Feeding Qualities of the Beet and of the Pulp, etc. By LEWIS S. WARE, C. E., M. E. Illustrated by ninety engravings. 8vo.

\$4.00

WARN.—The Sheet-Metal Worker's Instructor:

For Zinc, Sheet-Iron, Copper, and Tin-Plate Workers, etc. Containing a selection of Geometrical Problems; also, Practical and Simple Rules for Describing the various Patterns required in the different branches of the above Trades. By REUBEN H. WARN, Practical Tin-Plate Worker. To which is added an Appendix, containing Instructions for Boiler-Making, Mensuration of Surfaces and Solids, Rules for Calculating the Weights of different Figures of Iron and Steel, Tables of the Weights of Iron, Steel, etc. Illustrated by thirty-two Plates and thirty-seven Wood Engravings. 8vo.

\$3.00

WARNER.—New Theorems, Tables, and Diagrams, for the Computation of Earth-work:

Designed for the use of Engineers in Preliminary and Final Estimates, of Students in Engineering, and of Contractors and other non-professional Computers. In two parts, with an Appendix. Part I. A Practical Treatise; Part II. A Theoretical Treatise, and the Appendix. Containing Notes to the Rules and Examples of Part I.; Explanations of the Construction of Scales, Tables, and Diagrams, and a Treatise upon Equivalent Square Bases and Equivalent Level Heights. The whole illustrated by numerous original engravings, comprising explanatory cuts for Definitions and Problems, Stereometric Scales and Diagrams, and a series of Lithographic Drawings from Models: Showing all the Combinations of Solid Forms which occur in Railroad Excavations and Embankments. By JOHN WARNER, A. M., Mining and Mechanical Engineer. Illustrated by 14 Plates. A new, revised and improved edition. 8vo.

\$4.00

WATSON.—A Manual of the Hand-Lathe:

Comprising Concise Directions for Working Metals of all kinds, Ivory, Bone and Precious Woods; Dyeing, Coloring, and French Polishing; Inlaying by Veneers, and various methods practised to produce Elaborate work with Dispatch, and at Small Expense. By EGBERT P. WATSON, Author of "The Modern Practice of American Machinists and Engineers." Illustrated by 78 engravings.

\$1.50

WATSON.—The Modern Practice of American Machinists and Engineers

Including the Construction, Application, and Use of Drills, Lathe Tools, Cutters for Boring Cylinders, and Hollow-work generally, with the most Economical Speed for the same; the Results verified by Actual Practice at the Lathe, the Vise, and on the Floor. Together

- with Workshop Management, Economy of Manufacture, the Steam Engine, Boilers, Gears, Belting, etc., etc. By **EGBERT P. WATSON**. Illustrated by eighty-six engravings. 12mo. \$2.50
- WATSON.**—The Theory and Practice of the Art of Weaving by Hand and Power. With Calculations and Tables for the Use of those connected with the Trade. By **JOHN WATSON**, Manufacturer and Practical Machine-Maker. Illustrated by large Drawings of the best Power Looms. 8vo. \$6.00
- WATT.**—The Art of Soap Making: A Practical Hand-book of the Manufacture of Hard and Soft Soaps, Toilet Soaps, etc., including many New Processes, and a Chapter on the Recovery of Glycerine from Waste Leys. By **ALEXANDER WATT**. Ill. 12mo. \$3.00
- WEATHERLY.**—Treatise on the Art of Boiling Sugar, Crystallizing, Lozenge-making, Comfits, Gum Goods, And other processes for Confectionery, etc., in which are explained, in an easy and familiar manner, the various Methods of Manufacturing every Description of Raw and Refined Sugar Goods, as sold by Confectioners and others. 12mo. \$1.50
- WIGHTWICK.**—Hints to Young Architects: Comprising Advice to those who, while yet at school, are destined to the Profession; to such as, having passed their pupilage, are about to travel; and to those who, having completed their education, are about to practise. Together with a Model Specification involving a great variety of instructive and suggestive matter. By **GEORGE WIGHTWICK**, Architect. A new edition, revised and considerably enlarged; comprising Treatises on the Principles of Construction and Design. By **G. HUSKISSON GUILLAUME**, Architect. Numerous Illustrations. One vol. 12mo. \$2.00
- WILL.**—Tables of Qualitative Chemical Analysis. With an Introductory Chapter on the Course of Analysis. By Professor **HEINRICH WILL**, of Giessen, Germany. Third American, from the eleventh German edition. Edited by **CHARLES F. HIMES**, Ph. D., Professor of Natural Science, Dickinson College, Carlisle, Pa. 8vo. \$1.50
- WILLIAMS.**—On Heat and Steam: Embracing New Views of Vaporization, Condensation, and Expansion. By **CHARLES WYE WILLIAMS**, A. I. C. E. Illustrated 8vo. \$2.50
- WILSON.**—A Treatise on Steam Boilers: Their Strength, Construction, and Economical Working. By **ROBERT WILSON**. Illustrated 12mo. \$2.50
- WILSON.**—First Principles of Political Economy: With Reference to Statesmanship and the Progress of Civilization. By Professor **W. D. WILSON**, of the Cornell University. A new and revised edition. 12mo. \$1.50

WOHLER.—A Hand-Book of Mineral Analysis :

By F. WÖHLER, Professor of Chemistry in the University of Göttingen. Edited by HENRY B. NASON, Professor of Chemistry in the Rensselaer Polytechnic Institute, Troy, New York. Illustrated.
12mo. \$2.50

WORSSAM.—On Mechanical Saws :

From the Transactions of the Society of Engineers, 1869. By S. W. WORSSAM, JR. Illustrated by eighteen large plates. 8vo. \$2.50

RECENT ADDITIONS.**BRANNT.—Varnishes, Lacquers, Printing Inks, and Sealing Waxes :**

Their Raw Materials and their Manufacture. 39 Illustrations.
12mo. 338 pages. \$3.00

BRANNT.—The Practical Scourer and Garment Dyer :

Comprising Dry or Chemical Cleaning ; the Art of Removing Stains ; Fine Washing ; Bleaching and Dyeing of Straw Hats, Gloves, and Feathers of all kinds ; Dyeing of Worn Clothes of all fabrics, including Mixed Goods, by One Dip ; and the Manufacture of Soaps and Fluids for Cleansing Purposes. Edited by WILLIAM T. BRANNT, Editor of "The Techno-Chemical Receipt Book." Illustrated.
203 pages, 12mo. \$2.00

BRANNT.—The Metallic Alloys :

A Practical Guide for the Manufacture of all kinds of Alloys, Amalgams and Solders used by Metal Workers, especially by Bell Founders, Bronze Workers, Tinsmiths, Gold and Silver Workers, Dentists, etc., etc., as well as their Chemical and Physical Properties. Edited chiefly from the German of A. Krupp and Andreas Wildberger, with additions by WM. T. BRANNT. Illustrated. 12mo. \$3.00

BRANNT.—A Practical Treatise on the Manufacture of Vinegar and Acetates, Cider, and Fruit-Wines :

Preservation of Fruits and Vegetables by Canning and Evaporation ; Preparation of Fruit-Butters, Jellies, Marmalades, Catchups, Pickles, Mustards, etc. Edited from various sources. By WILLIAM T. BRANNT. Illustrated by 79 Engravings. 479 pp. 8vo. \$5.00

BRANNT.—The Metal Worker's Handy-Book of Receipts and Processes :

Being a Collection of Chemical Formulas and Practical Manipulations for the working of all Metals ; including the Decoration and Beautifying of Articles Manufactured therefrom, as well as their Preservation. Edited from various sources. By WILLIAM T. BRANNT. Illustrated. 12mo. \$2.50

DEITE.—A Practical Treatise on the Manufacture of Perfumery:

Comprising directions for making all kinds of Perfumes, Sachet Powders, Fumigating Materials, Dentifrices, Cosmetics, etc., with a full account of the Volatile Oils, Balsams, Resins, and other Natural and Artificial Perfume-substances, including the Manufacture of Fruit Ethers, and tests of their purity. By Dr. C. DEITE, assisted by L. BORCHERT, F. EICHBAUM, E. KUGLER, H. TOEFFNER, and other experts. From the German, by WM. T. BRANNT. 28 Engravings. 358 pages. 8vo. \$3.00

EDWARDS.—American Marine Engineer, Theoretical and Practical:

With Examples of the latest and most approved American Practice. By EMORY EDWARDS. 85 illustrations. 12mo. \$2.50

EDWARDS.—900 Examination Questions and Answers:

For Engineers and Firemen (Land and Marine) who desire to obtain a United States Government or State License. Pocket-book form, gilt edge \$1.50

POSSELT.—Technology of Textile Design:

Being a Practical Treatise on the Construction and Application of Weaves for all Textile Fabrics, with minute reference to the latest Inventions for Weaving. Containing also an Appendix, showing the Analysis and giving the Calculations necessary for the Manufacture of the various Textile Fabrics. By E. A. POSSELT, Head Master Textile Department, Pennsylvania Museum and School of Industrial Art, Philadelphia, with over 1000 illustrations. 292 pages. 4to. \$5.00

POSSELT.—The Jacquard Machine Analysed and Explained:

With an Appendix on the Preparation of Jacquard Cards, and Practical Hints to Learners of Jacquard Designing. By E. A. POSSELT. With 230 illustrations and numerous diagrams. 127 pp. 4to. \$3.00

POSSELT.—The Structure of Fibres, Yarns and Fabrics:

Being a Practical Treatise for the Use of all Persons Employed in the Manufacture of Textile Fabrics, containing a Description of the Growth and Manipulation of Cotton, Wool, Worsted, Silk, Flax, Jute, Ramie, China Grass and Hemp, and Dealing with all Manufacturers' Calculations for Every Class of Material, also Giving Minute Details for the Structure of all kinds of Textile Fabrics, and an Appendix of Arithmetic, specially adapted for Textile Purposes. By E. A. POSSELT. Over 400 Illustrations. quarto. \$10.00

RICH.—Artistic Horse-Shoeing:

A Practical and Scientific Treatise, giving Improved Methods of Shoeing, with Special Directions for Shaping Shoes to Cure Different Diseases of the Foot, and for the Correction of Faulty Action in Trotters. By GEORGE E. RICH. 62 Illustrations. 153 pages. 12mo. \$1.00

RICHARDSON.—Practical Blacksmithing:

A Collection of Articles Contributed at Different Times by Skilled Workmen to the columns of "The Blacksmith and Wheelwright," and Covering nearly the Whole Range of Blacksmithing, from the Simplest Job of Work to some of the Most Complex Forgings. Compiled and Edited by M. T. RICHARDSON.

Vol. I.	210 Illustrations.	224 pages.	12mo.	\$1.00
Vol. II.	230 Illustrations.	262 pages.	12mo.	\$1.00
Vol. III.	390 Illustrations.	307 pages.	12mo.	\$1.00
Vol. IV.	226 Illustrations.	276 pages.	12mo.	\$1.00

RICHARDSON.—The Practical Horseshoer:

Being a Collection of Articles on Horseshoeing in all its Branches which have appeared from time to time in the columns of "The Blacksmith and Wheelwright," etc. Compiled and edited by M. T. RICHARDSON. 174 illustrations.

\$1.00

ROPER.—Instructions and Suggestions for Engineers and Firemen:

By STEPHEN ROPER, Engineer. 18mo. Morocco . \$2.00

ROPER.—The Steam Boiler: Its Care and Management:

By STEPHEN ROPER, Engineer. 12mo., tuck, gilt edges. \$2.00

ROPER.—The Young Engineer's Own Book:

Containing an Explanation of the Principle and Theories on which the Steam Engine as a Prime Mover is Based. By STEPHEN ROPER, Engineer. 160 illustrations, 363 pages. 18mo., tuck . \$3.00

ROSE.—Modern Steam-Engines:

An Elementary Treatise upon the Steam-Engine, written in Plain language; for Use in the Workshop as well as in the Drawing Office. Giving Full Explanations of the Construction of Modern Steam-Engines: Including Diagrams showing their Actual operation. Together with Complete but Simple Explanations of the operations of Various Kinds of Valves, Valve Motions, and Link Motions, etc., thereby Enabling the Ordinary Engineer to clearly Understand the Principles Involved in their Construction and Use, and to Plot out their Movements upon the Drawing Board. By JOSHUA ROSE, M. E. Illustrated by 422 engravings. Revised. 358 pp. . \$6.00

 
ROSE.—Steam Boilers:

A Practical Treatise on Boiler Construction and Examination, for the Use of Practical Boiler Makers, Boiler Users, and Inspectors; and embracing in plain figures all the calculations necessary in Designing or Classifying Steam Boilers. By JOSHUA ROSE, M. E. Illustrated by 73 engravings. 250 pages. 8vo. . \$2.50

SCHRIEBER.—The Complete Carriage and Wagon Painter:

A Concise Compendium of the Art of Painting Carriages, Wagons, and Sleighs, embracing Full Directions in all the Various Branches, including Lettering, Scrolling, Ornamenting, Striping, Varnishing, and Coloring, with numerous Recipes for Mixing Colors. 73 Illustrations. 177 pp. 12mo. . \$1.00

45.745



1

2



